

Property of KOSCIUSKO COUNTY
SURVEYORS OFFICE
Address 100 W CENTER ST
COURTHOUSE WARSAW, IN
Telephone _____

MICHAEL KISSINGER - SURVEYOR

This Book is manufactured of a High Grade
50% Rag Ledger Paper having a Water Resist-
ant Surface, and is sewed with Nylon Water-
proof Thread.

815260



SECTION CORNER FIELD BOOK 9

INDEX

STARTED FEBRUARY 28, 2018

<u>TURKEY CREEK SE CORNER SECTION 18-34-7</u>	<u>1</u>
<u>PLAIN NW CORNER SECTION 26-33-6</u>	<u>2</u>
<u>PLAIN W 1/4 CORNER SECTION 26-33-6</u>	<u>3</u>
<u>HARRISON E 1/4 CORNER SECTION 33-32-5</u>	<u>4</u>
<u>HARRISON S 1/4 CORNER SECTION 28-32-5</u>	<u>5</u>
<u>HARRISON COS SECTION 28-32-5</u>	<u>6</u>
<u>PLAIN NE CORNER SECTION 30-33-6</u>	<u>7</u>
<u>WASHINGTON N 1/4 CORNER SECTION 8-32-7</u>	<u>8</u>
<u>WAYNE S 1/4 CORNER SECTION 20-32-6</u>	<u>9</u>
<u>PLAIN CENTER OF SECTION 19-33-6</u>	<u>10</u>
<u>PLAIN N 1/4 CORNER SECTION 19-33-6</u>	<u>11</u>
<u>TIPPECANOE SE CORNER SECTION 28-33-7</u>	<u>12</u>
<u>PRAIRIE W 1/4 CORNER SECTION 27-33-5</u>	<u>13</u>
<u>PRAIRIE NW CORNER SECTION 27-33-5</u>	<u>14</u>
<u>WAYNE E 1/4 CORNER SECTION 15-32-6</u>	<u>15</u>
<u>JEFFERSON N 1/4 CORNER SECTION 35-34-5</u>	<u>16</u>
<u>JEFFERSON SE CORNER SECTION 27-34-5</u>	<u>17</u>
<u>JEFFERSON S 1/4 CORNER SECTION 27-34-5</u>	<u>18</u>
<u>WAYNE N 1/4 CORNER SECTION 31-32-6</u>	<u>19</u>
_____	_____
_____	_____


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	WNW	67.20'
4 RR RAIL IN CONC. IN ROADWAY	NW	25.66'
NAIL IN B. CAP IN POWER POLE	ESE	63.76'

SURVEY FIELD BOOK 2 Pg 44 - JULY 1974 OLD TIE

RIP 25.6' NW - PK NAIL

TURKEY CREEK

1

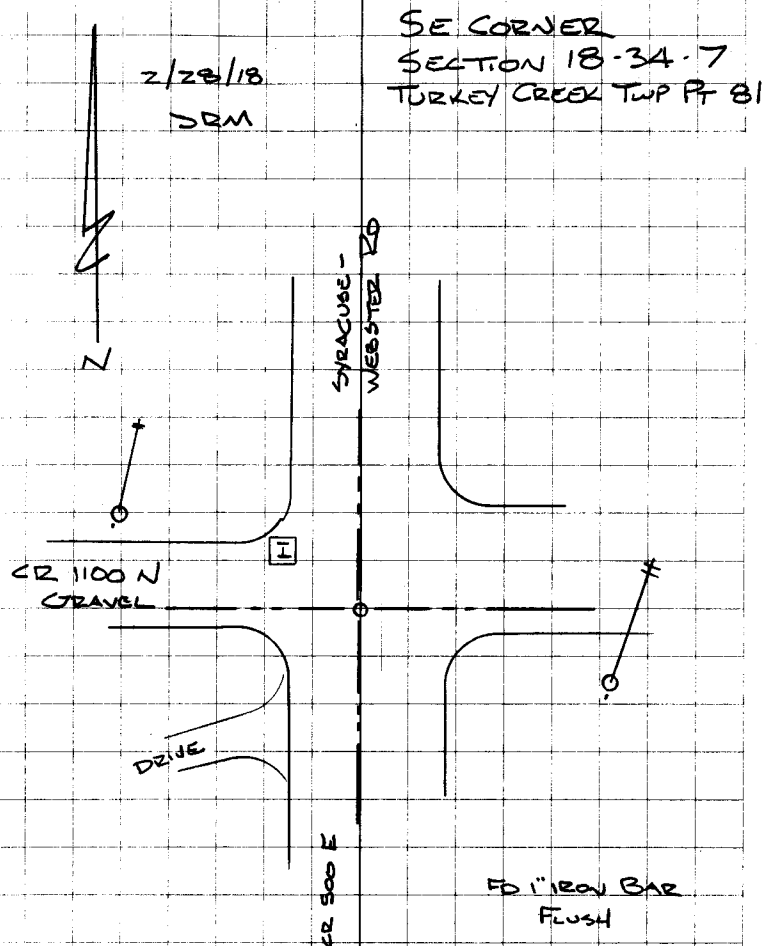

DESCRIPTION	BEARING	DISTANCE
E RAILROAD RAIL FCP	N	16.1'
NAIL IN B. CAP IN POWER POLE	NNE	16.90'
1/2" x 24" REBAR W/CAP 26.5' FROM RIP	SW	12.58'

SURVEY RECORD BOOK 3Pg 370 DEC 1, 1947

"KEMPER" SURVEY NOV 2 2005 # 2010090300

"KISSINGER" SURVEY SEPT 6 2010 # 2010090551


RAIN

2



3/2/18

NW CORNER
SECTION 26.33.6
RAIN TWP PT 113

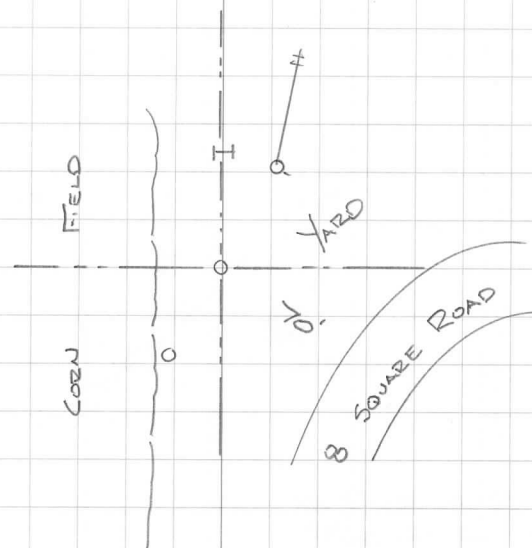

FD 1" x 22" IRON PIPE
NO READING UNDER IT

DESCRIPTION

BEARING DISTANCE

4" SQ CONC MARKER BY IDNR

SW


1.8'

PLAIN

3

W 1/4 CORNER
SECTION 26-33-6
PLAIN TWP PT 122

3/2/18
DEM

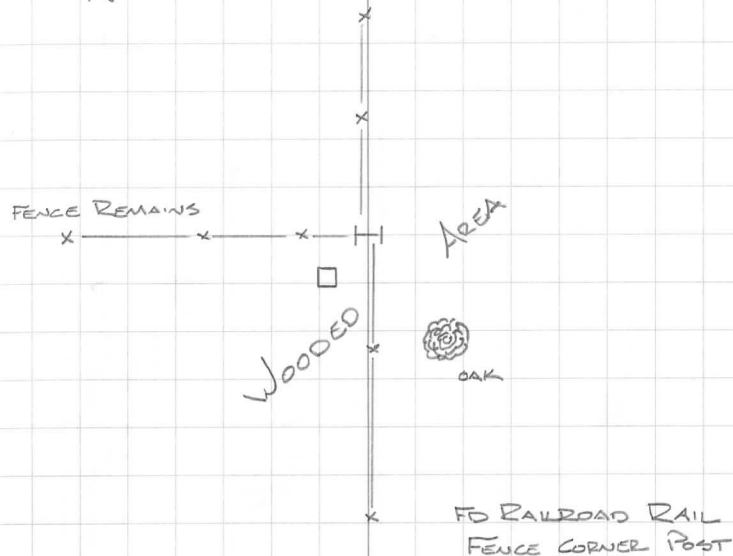


"WALKER" SURVEY OCT 25 2011 # 2012010809

DESCRIPTION	BEARING	DISTANCE
1/2 BRUNER ROAD PAVEMENT	W	33.65'
1" AXLE BESIDE 3" x 5" I-BEAM POST IN TREE STUMP	W	15.4'
3" x 5" I-BEAM FCP	E	15.2'
30" OAK TREE	SE	21'

HARRISON

4

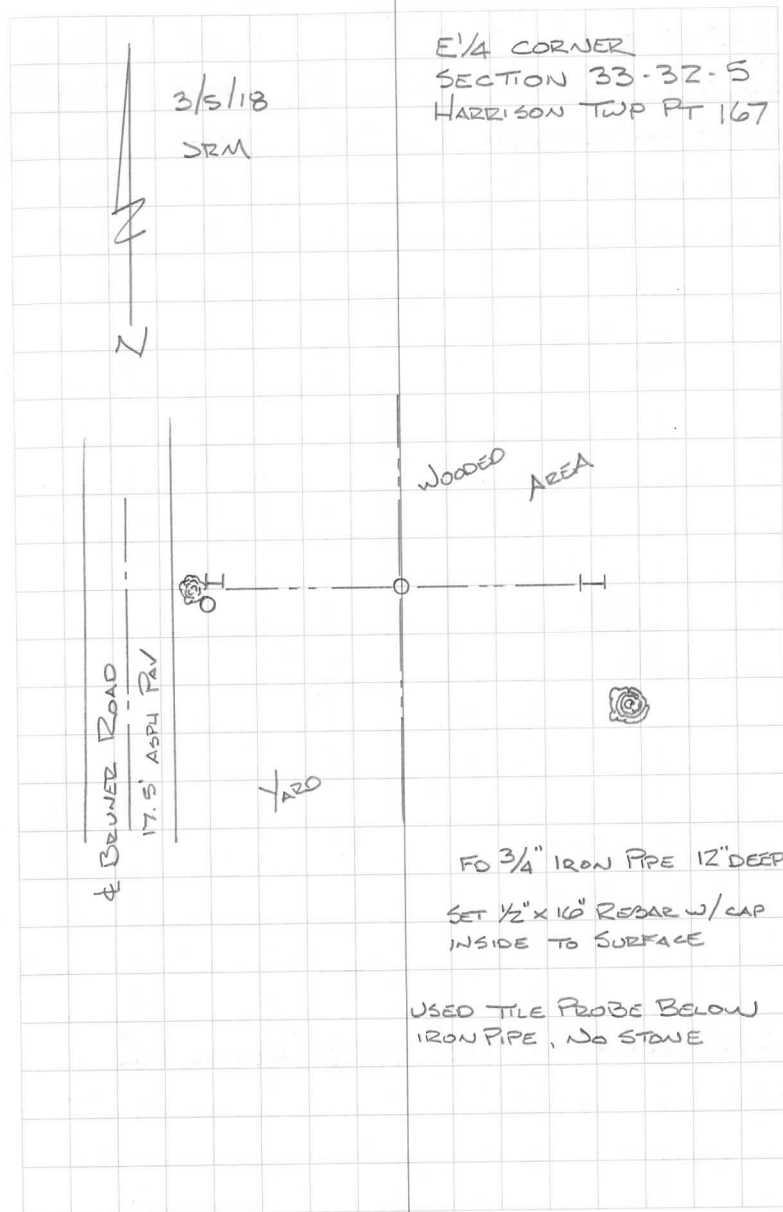


SURVEY FIELD BOOK 2 Pg 20 - FALL 1968


DESCRIPTION	BEARING	DISTANCE
4 3"x5" I-BEAM FCP	W	20.15'
NAIL IN B. CAP NIPSCO P. POLE $\frac{620}{141}$	NW	18.85'
1/2" x 24" REBAR W/CAP 8' TO E/P	NE	29.01'
4 RAILROAD RAIL FCP	E	19.69'
4 24" CMP SURFACE CULVERT	S	11.4'

QSR SUBDIVISION - FEB 7, 1978 "RUSSELL ECK"

HARRISON

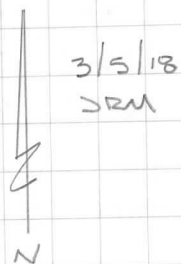

S 1/4 CORNER
SECTION 28-32-5
HARRISON TWP PT 158

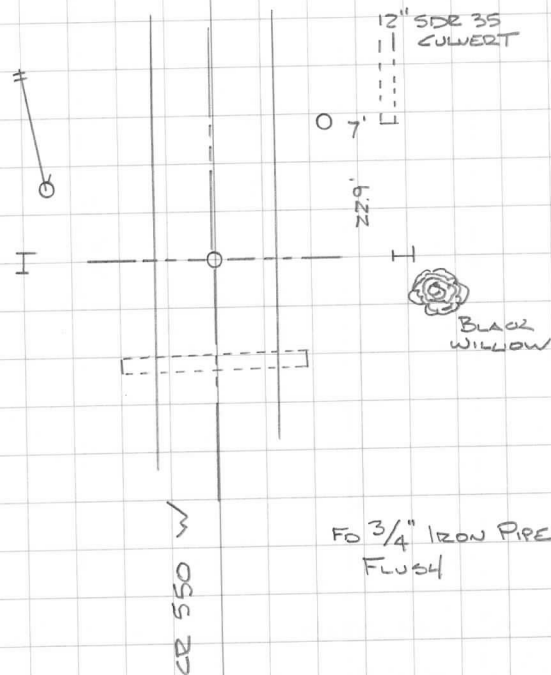


DESCRIPTION	BEARING	DISTANCE
4 5" DIA SOLID IRON BAR FCP	W	21.24'
1/2" x 24" REBAR W/CAP 12.1' TO E/P	NW	30.98'
NAIL IN B. CAP NIPSCO P. POLE 6020/130	NNW	63.35'

OLD TIE - 1960'S STEEL POST 21' WEST

HARRISON

6

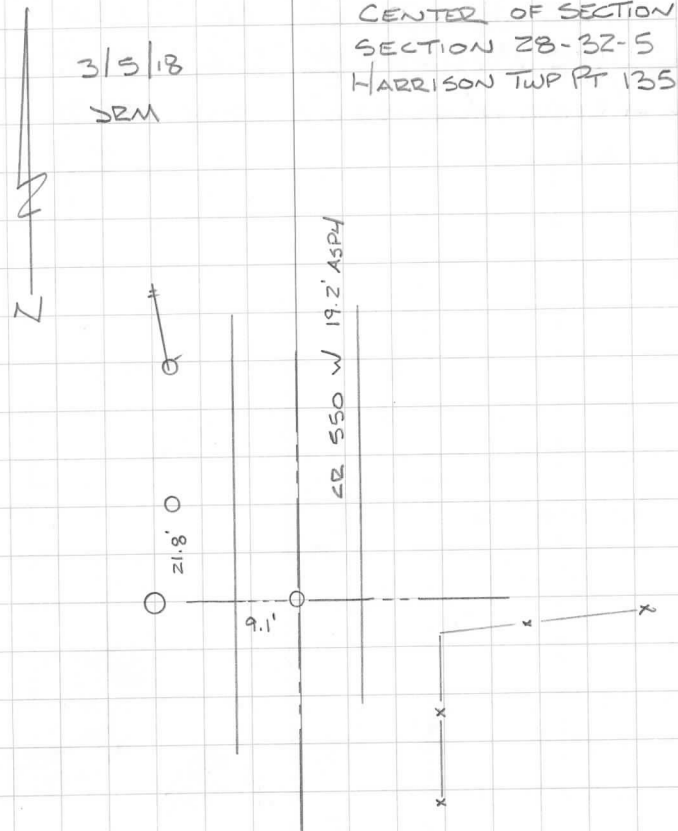

FOR RE SPIKE 4" DEEP
SET MAG NAIL W/TAG
OVER TOP

DE	DESCRIPTION		BEARING	DISTANCE
4	5"Ø NAIL IN B.C. NIPSCO P.P. $\frac{1068}{875}$		NE	32.47'
	1/2" x 24" NAIL IN B.C. NIPSCO P.P. $\frac{631}{700}$		SSE	59.87'
	NAIL IN B. 1/2" x 24" REBAR W/CAP 15.7 TO E/P		SW	45.21'
	4 CR 400 N		N	3'


OLD TIE

SURVEY FIELD BOOK 10 Pg 27 - 2/10/1977 CMB

MEADOW RIDGE SUB PLAT BOOK 8 Pg 67 - 9/5/1985

PLAIN

7

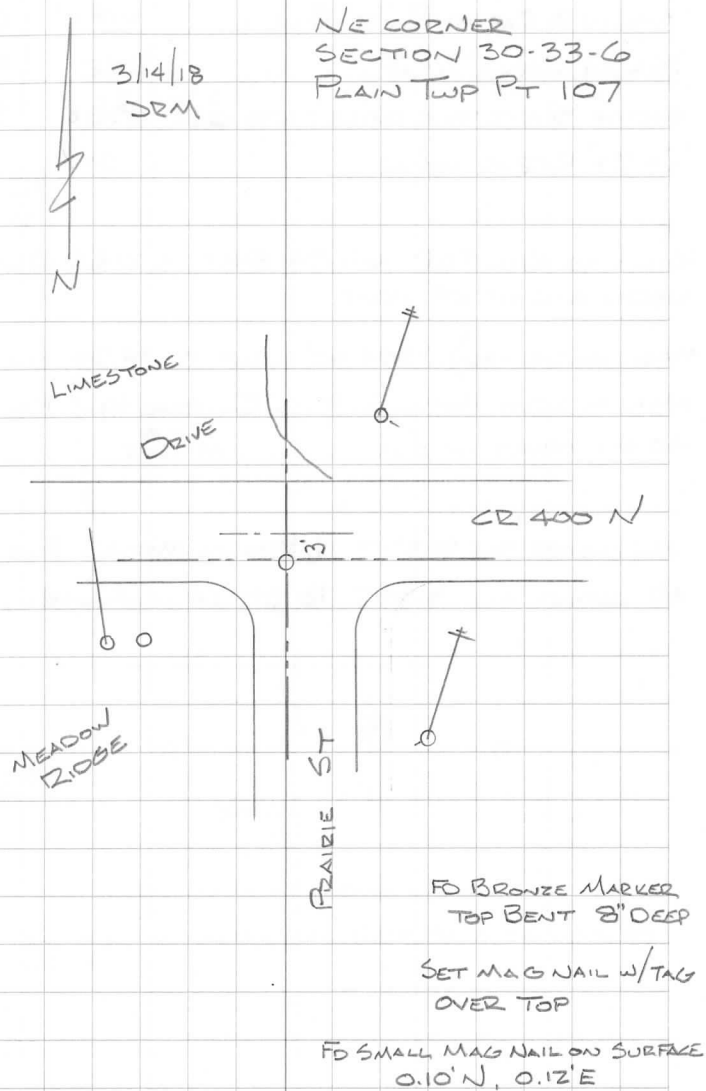


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	WSW	60.70'
1/2" x 24" REBAR w/CAP	SE	52.65'
END OF 8" N12 TILE OUTLET INTO C.B.	SSE	39.8'
1/2" x 24" REBAR w/CAP	SW	59.36'

\$
RAILROAD RAIL FCP 671.34' EAST IS 0.85' N OF LINE
NORTH SIDE OF CR 100N

MAGY NAIL (NO TAG) 1304.42' WEST IS 14.35' S OF LINE
NAIL IS SPLIT BETWEEN TWO RAILROAD RAIL FCLP
40.00' APART

NW CORNER SEC 8-32-7 FD BRONZE MARKER FLUSH

NE CORNER SEC 8.32.7 FD RR SPIKE FLUSH

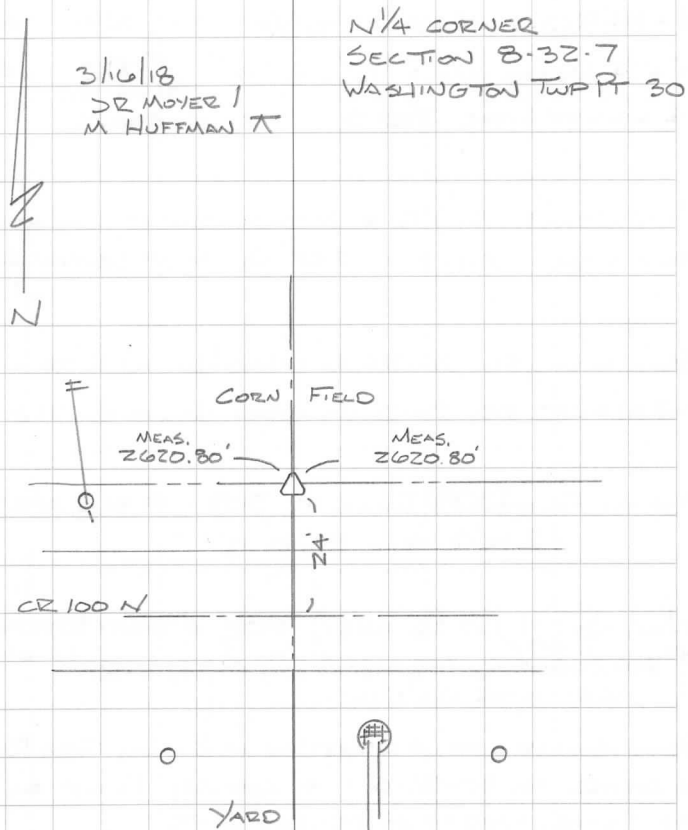

1/2" REBAR AND ALL WITNESSES SET BY MEK 6/6/03
ARE GONE

DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR w/CAP 12' TO E/P	NW	48.07'
1/2" x 24" REBAR w/CAP 12.6' TO E/P	NE	53.20'
4 COUNTRY ROAD 200 S	N	16'

MAG NAIL (NO TAG) FD AT INTERSECTION OF COUNTY
FARM ROAD & 200 S - 17.69' NORTH OF SECTION LINE

SE CORNER SEC 20-32-6 - MAG NAIL IN COTAG

SW CORNER SEC 20-32-6 - MAG NAIL IN CO TAG

ORIGINAL FIELD NOTE BOOK Pg 209 - 79.81 CHN (5267.46)
3/16/18 MEAS 5300.73'

MAG NAIL (1167.26' WEST) POB OF DEED RECORD
#2002050996 FOUND NORTH OF SEC LINE.


FROM MAG NAIL AT INTERSECTION OF COUNTY FARM RD TO
SE CORNER SEC 20-32-6 - 4 CORNERS FOUND ALL ON
THAT LINE, NORTH OF SECTION LINE

BATALIS ACRES PLAT BOOK 6 Pg 103 - 1/16/1974 C. BROWER
NO REFERENCE TO A SECTION CORNER

SET 1/2" x 24" REBAR w/CAP

DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR w/CAP 12.3 TO E/P	NW	27.45'
E RR RAIL FCP	E	22.15'
1/2" x 24" REBAR w/CAP 12.8' TO E/P	SW	42.52'
FACE OF 3" ANGLE IRON FCP LEANING E	W	22.05'

PLAIN

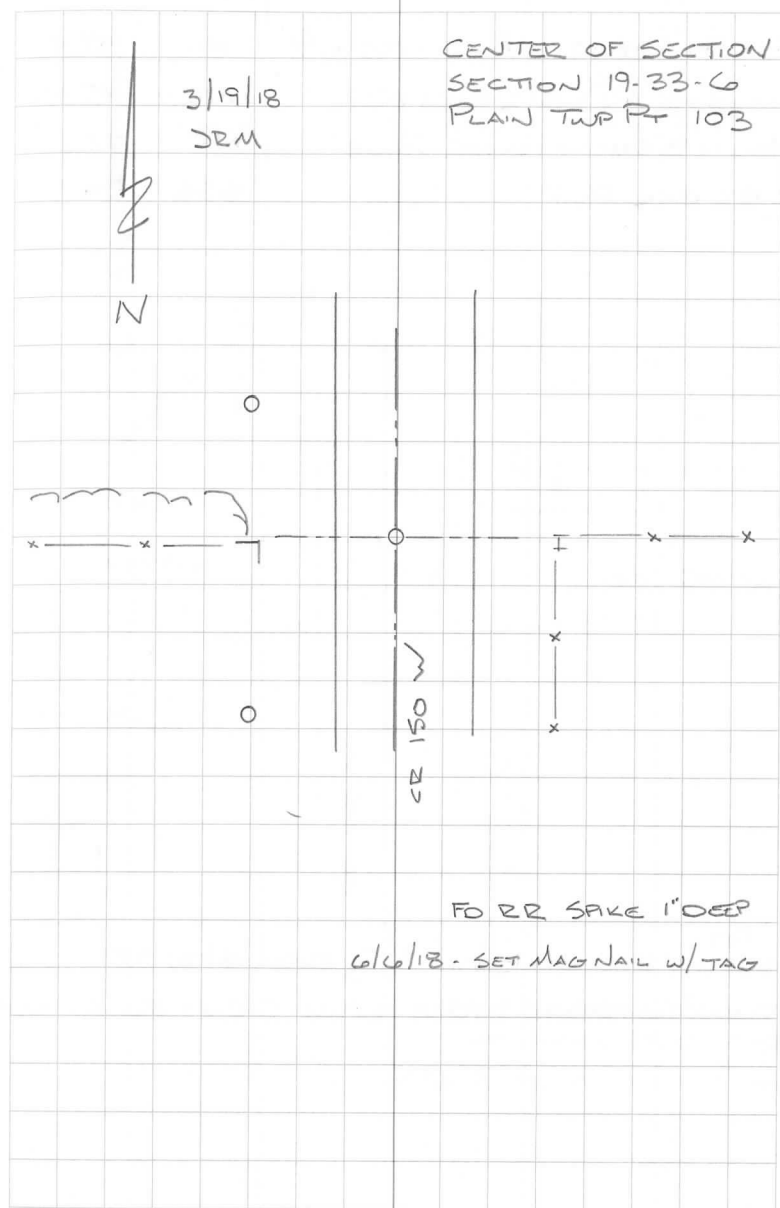


DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR W/CAP 17.5' TO E/P	NW	42.40'
SW CORNER 4 1/2" x 6" I-BEAM FCP	NE	22.67'
NAIL IN B. CAP IN POWER POLE	NE	23.81'
4 RR RAIL FCP	SSE	34.5'

PER
SURVEY RECORD BOOK 3 Pg 266 - 4/13/1929
DUG FOR STONE UNDER SPIKE - DIDN'T FIND ANYTHING

PLAIN

11

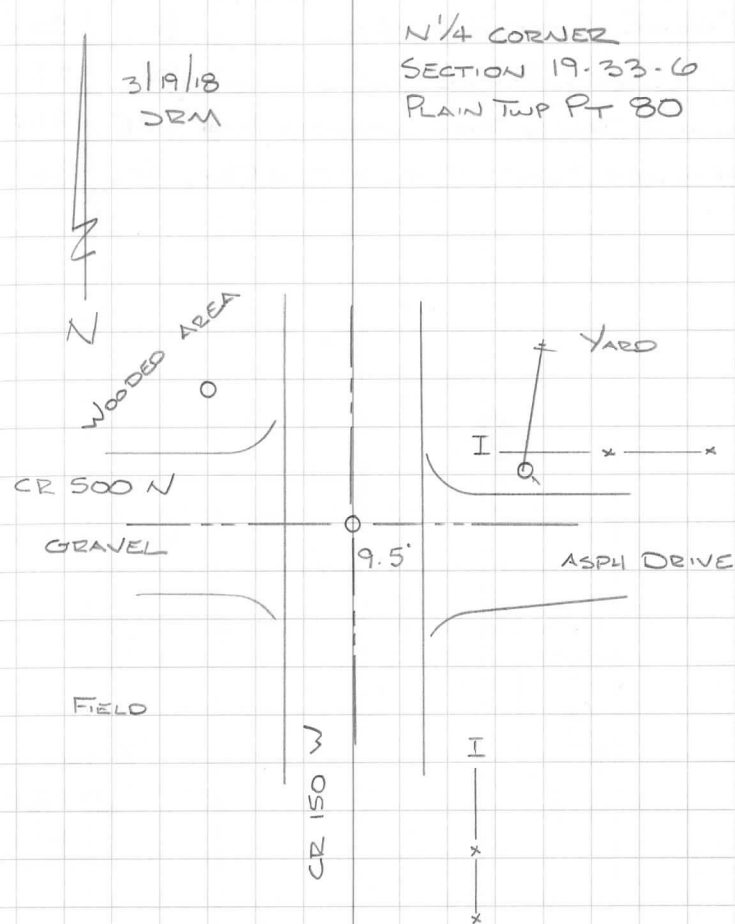

FOR RR SPIKE 2" DEEP
WITH SMALL PK NAIL OVER
6/6/18 - SET MAG NAIL W/TAG

DESCRIPTION


BEARING DISTANCE

DESCRIPTION	BEARING	DISTANCE
FO "WALKER" CAPED IRON 8" TALL	S	50.08'
NAIL IN B. CAP IN POWER POLE	S	23.36'
NAIL IN CO TAG IN TRIPLE COTTONWOOD STUMP	NE	21.19'
EXPANSION JOINT "T" IN CENTER OF DRIVE	SE	36.57'

CAMDENS ADD TO EL NEL PARK - 9/10/1962
 PLAT BOOK 5 Pg 151 - R.R. I. POST

TIPPECANOE

12

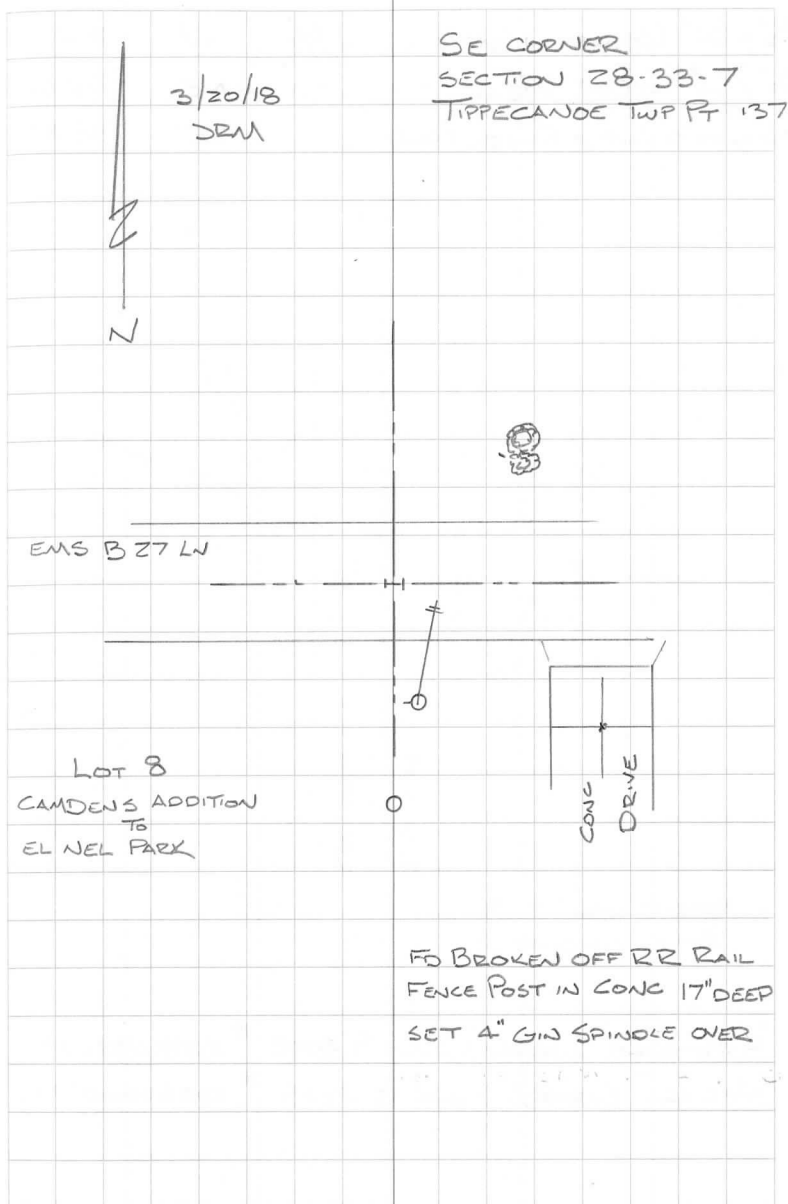

FO BROKEN OFF RR RAIL
 FENCE POST IN CONC 17" DEEP
 SET 4" GIN SPINDLE OVER


DESCRIPTION

BEARING DISTANCE

1/2" x 24" REBAR W/CAP 16.5' TO E/P	W	28.68'
1/2" x 24" REBAR W/CAP 7.5' TO E/P	NE	32.81'
NAIL IN B. CAP IN POWER POLE	SE	59.29'

PRAIRIE

13

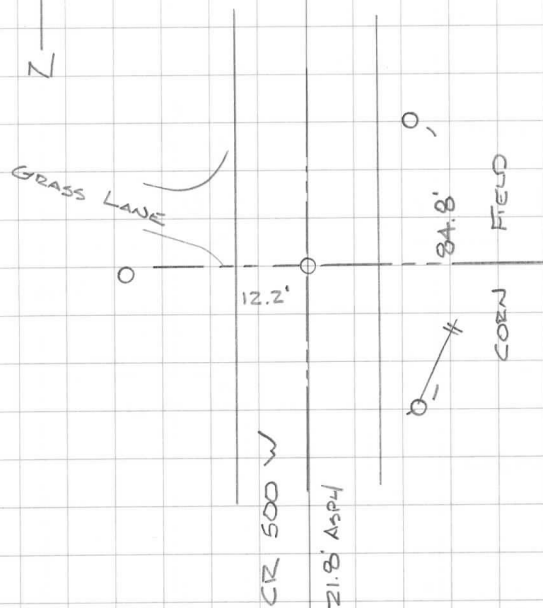3/21/18
JRMW 1/4 CORNER
SECTION 27.33.5
PRAIRIE TWP PT 124FD PK NAIL 2" DEEP
NO READING UNDER

"KISSINGER" SURVEY - JULY 9 2002 # 2002070525
 "MICHEL" SURVEY - JUNE 13 2005 # 200500009794

DESCRIPTION


BEARING

DISTANCE

1/2" x 24" REBAR w/CAP 2' FROM STOP SIGN	SW	36.05'
1/2" x 24" REBAR w/CAP	NW	44.34'
1/2" x 24" REBAR w/CAP 14' FROM E/P 500W	NE	36.91'

PRAIRIE

14

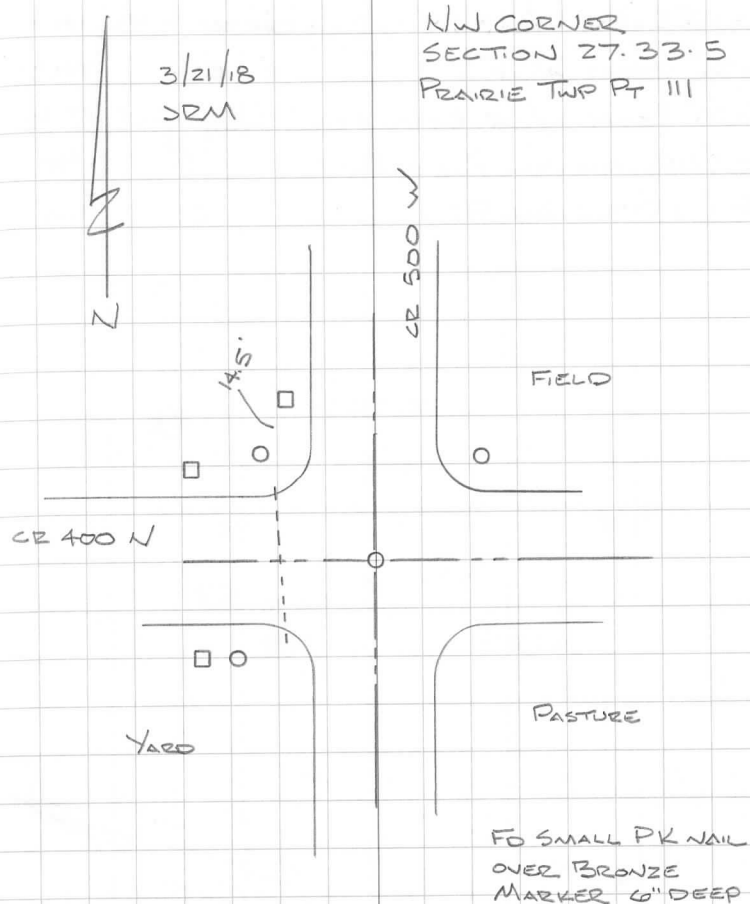

DESCRIPTION

BEARING DISTANCE

1/2" x 24" REBAR w/CAP 1.5' TO BASE OAK TREE	WNW	18.10'
1/2" x 24" REBAR w/CAP	ESE	20.25'
1/2" x 24" REBAR w/CAP BETWEEN OAK & HICKORY	SW	12.38'
FO 1" O.D. THIN WALL PIPE IN FENCE	S	98'
FO 1" O.D. THIN WALL PIPE	E	1.4'


STONE
SURVEY RECORD BOOK 2 (COPY) Pg 198 - JUNE 1861
"MENDENHALL" SURVEY - HANGING CLAMP FILE 9 Pg 4

WAYNE

15

3/23/18
JRM
MH
N

E 1/4 CORNER
SECTION 15-32-6
WAYNE TWP PT 85

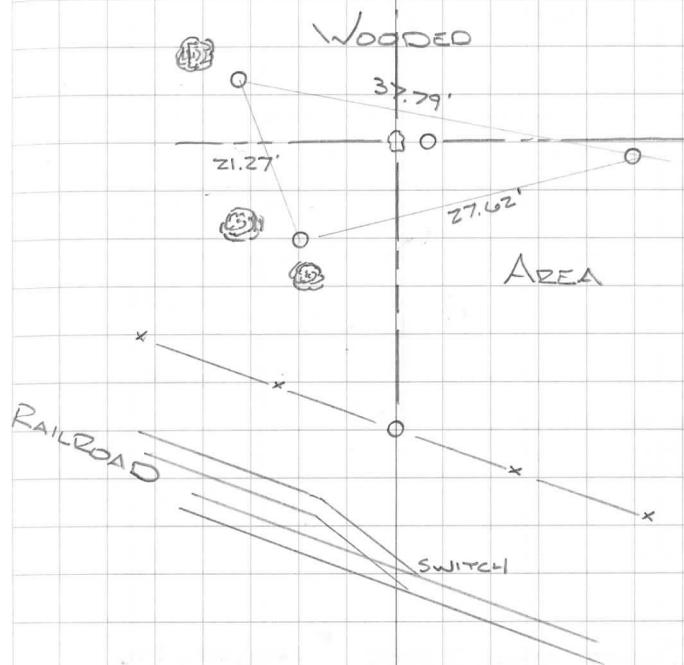

FO SQUARED PEAKED STONE
TOP 12" ABOVE SURFACE

DESCRIPTION


BEARING DISTANCE

1/2" x 24" REBAR w/CAP 1.5' TO BASE OAK TREE	WNW	18.10'
1/2" x 24" REBAR w/CAP	ESE	20.25'
1/2" x 24" REBAR w/CAP BETWEEN OAK & HICKORY	SW	12.38'
FO 1" O.D. THIN WALL PIPE IN FENCE	S	98'
FO 1" O.D. THIN WALL PIPE	E	1.4'

STONE
SURVEY RECORD BOOK 2 (COPY) Pg 198 - JUNE 1861
"MENDENHALL" SURVEY - HANGING CLAMP FILE 9 Pg 4

WAYNE

15

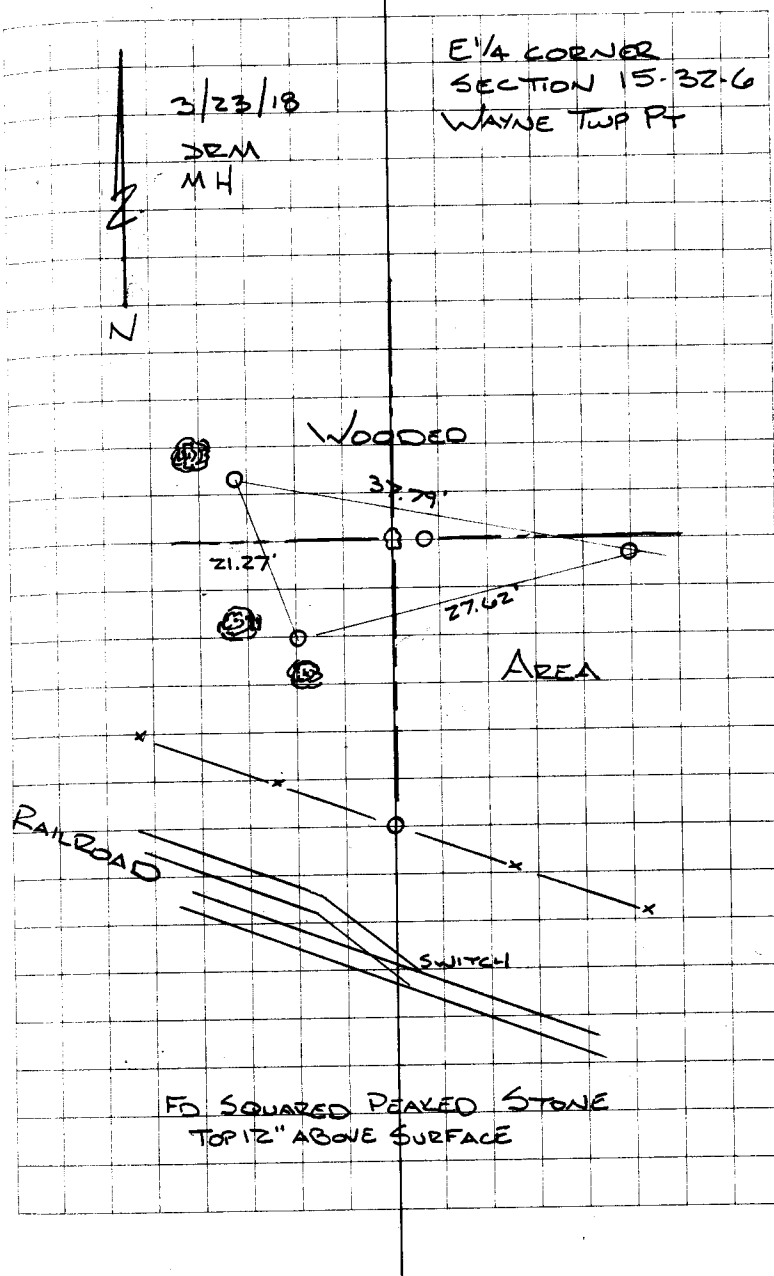


DESCRIPTION		BEARING	DISTANCE
NAIL IN B. CAP NIPSCO P. POLE $\frac{637}{076}$		WNW	65.93'
$\frac{1}{2} \times 16"$ REBAR w/ CAP 1.0' E OF HEADWALL		NW	23.57'
BURIED RR RAIL FCP		N	19.05'
$\frac{1}{2}$ RR RAIL FCP		S	19.15'
USCGS BM G 172 1946		SW	32.50'

"KIMPEL" SURVEY MARCH 7, 2002 # 2002050576

JEFFERSON

16

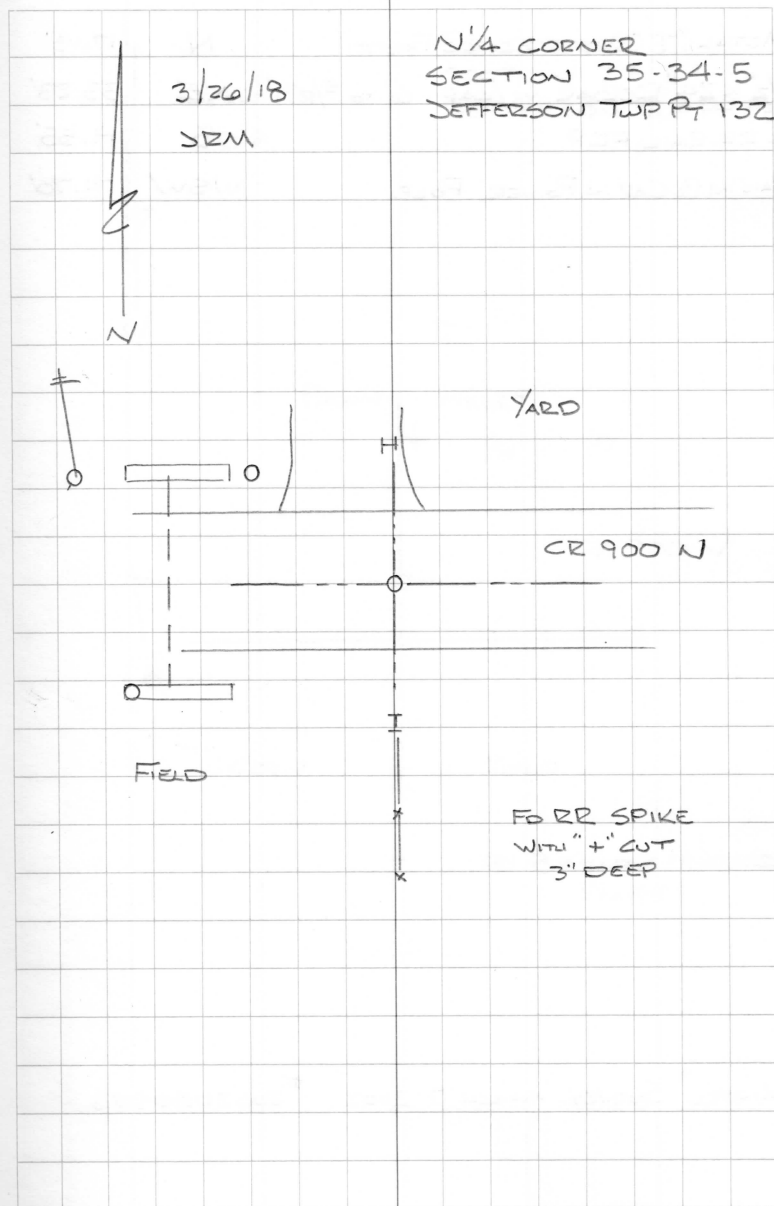


DESCRIPTION	BEARING	DISTANCE
METAL "T" POST FENCE POST	N	17.15'
1/2" x 24" REBAR W/CAP 6' TO E/P	NE	33.23'
4 RR RAIL FCP	S	19.55'
NAIL IN B. CAP IN POWER POLE	WSW	71.70'

"KIMPEL" SURVEY MARCH 7, 2002 # 2002050576


JEFFERSON

17



3/26/18
JRM

SE CORNER
SECTION 27-34-5
JEFFERSON TWP PT 131

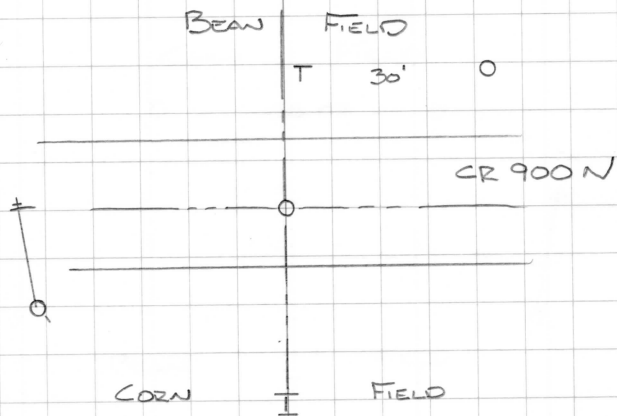

FO BRONZE MARKER
FLUSH

DESCRIPTION

BEARING

DISTANCE

1/2" x 24" REBAR w/CAP 7.4' to E/P	NW	32.91'
1/2" x 24" REBAR w/CAP 7' to E/P	NE	29.15'
NAIL IN B. CAP IN POWER POLE	SE	65.65'
\$ RR RAIL FCP	S	20.15'

"KIMPEL" SURVEY JUNE 12, 2004 #200500000767


JEFFERSON

18



3/26/18
JRM

S 1/4 CORNER
SECTION 27-34-5
JEFFERSON TWP R 130

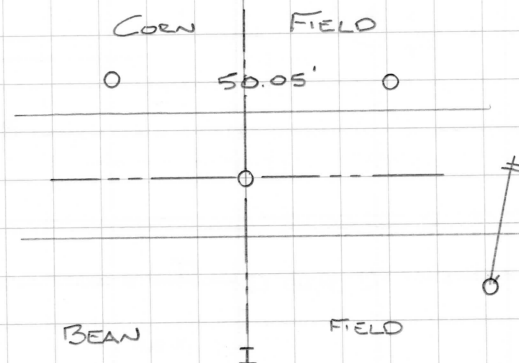


FO RR SPIKE 2" DEEP

DESCRIPTION	BEARING	DISTANCE
1/2" x 1/6" REBAR w/CAP 1.0' TO E/P	NW	33.78'
1/2" x 1/6" REBAR w/CAP 1.0' TO E/P	NE	40.17'
REBAR TO REBAR		59.60'
NAIL IN B. CAP NIPSCO POWER POLE $\frac{638}{102}$	ESE	87.85'
NAIL IN B. CAP RR TIE FENCE POST	SW	21.42'

SURVEY FIELD BOOK 7 Pg 41 10/22/73 SPIKE CMB
 "WALKER SURVEY FEB 9 2006 #200600006083
 "MICHEL" SURVEY OCT 13 2010 #2010120035

WAYNE

19

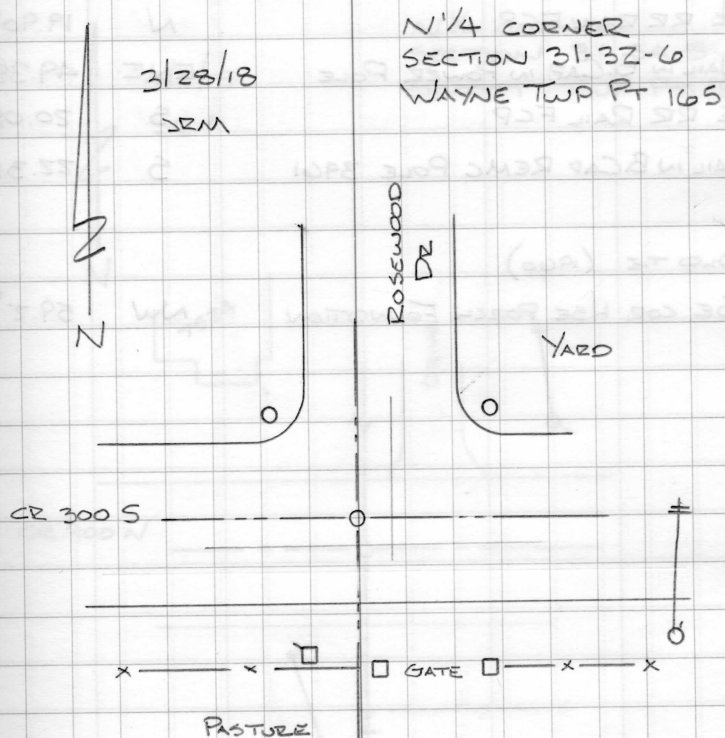


FO RAILROAD SPIKE 4" DEEP
 SET MAG NAIL w/ CO TAG OVER

DESCRIPTION	BEARING	DISTANCE
¢ RR RAIL FCP	N	19.90'
NAIL IN B. CAP IN POWER POLE	ENE	49.35'
¢ RR RAIL FCP	S	20.08'
NAIL IN B. CAP REMC POLE 3961	S	22.31'
OLD TIE (1960)		
SE COR HSE PORCH FOUNDATION	NW	59.2' ✓✓

"KIMPEL" SURVEY MAY 17 2010 # 2010060473

SCOTT


20

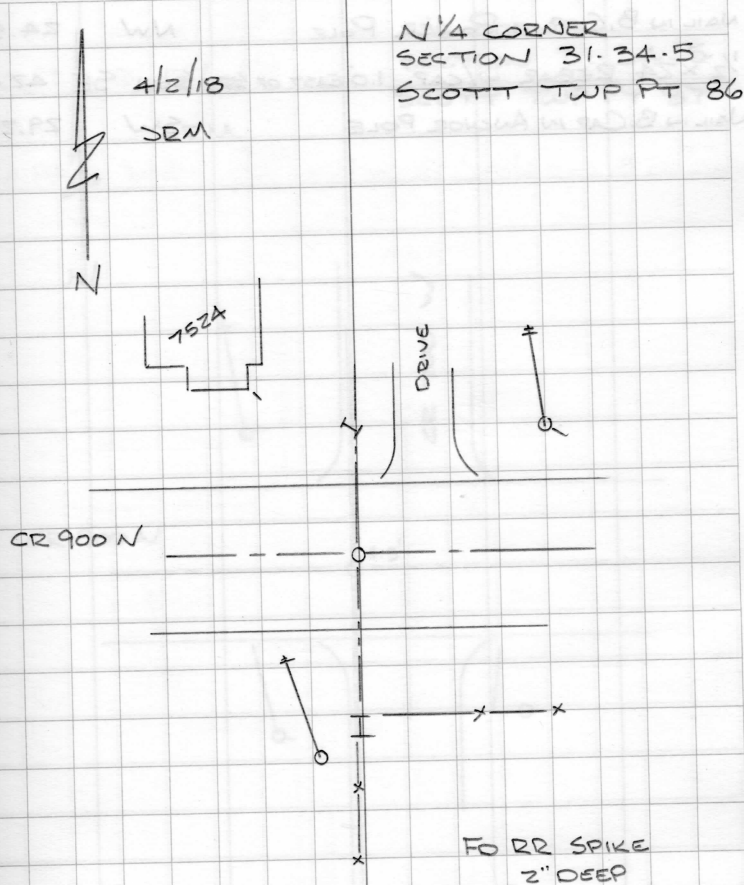

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	NW	24.56'
1/2" x 24" REBAR w/CAP 1.0' EAST OF STOP SIGN	SE	42.45'
NAIL IN B. CAP IN ANCHOR POLE	SW	29.29'

SCOTT


21



4/2/18

DEM

NE CORNER
SECTION 31-34-5
SCOTT TWP PT 87

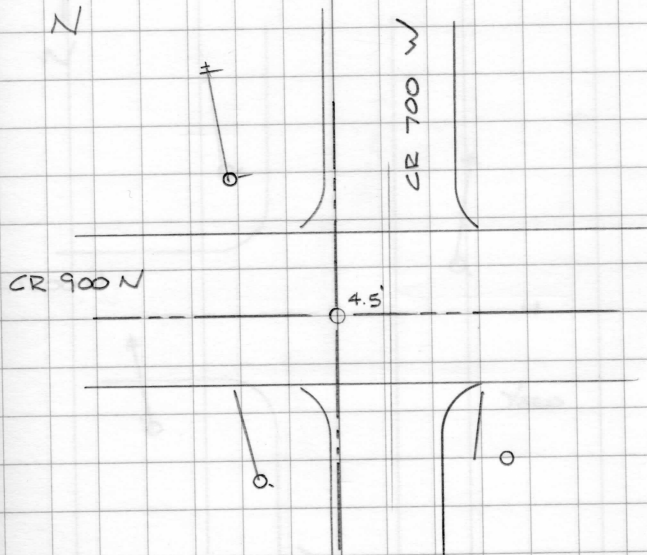

FO BRONZE MONUMENT
FLUSH


DESCRIPTION

BEARING DISTANCE

NAIL IN B. CAP NIPSCO POWER POLE	⁶⁷⁸ 175	NNW	53.00'
NAIL IN B. CAP NIPSCO POWER POLE	⁶⁷⁸ 566	ENE	29.26'
4 RR RAIL FCP		E	20.08'
NAIL IN B. CAP NIPSCO POWER POLE	⁶⁷⁸ 542	SW	59.05'

JEFFERSON

22

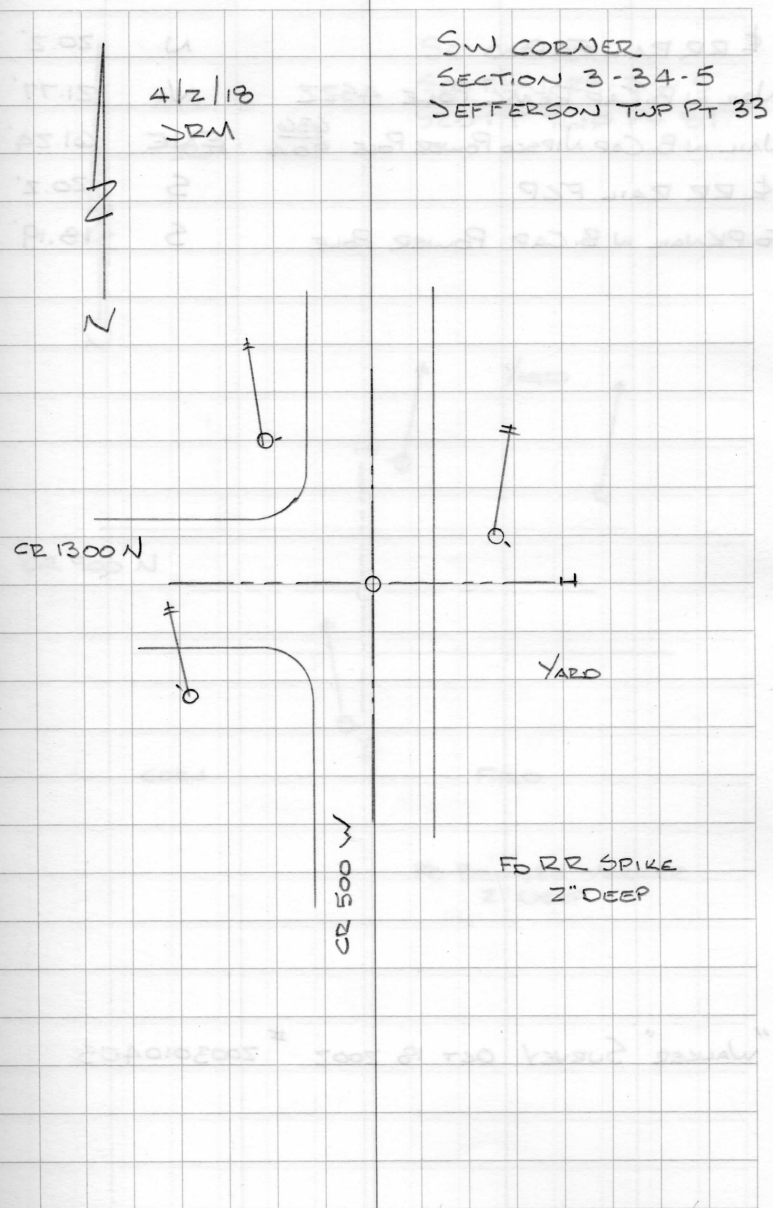


DESCRIPTION	BEARING	DISTANCE
± RR RAIL FCP	N	20.2'
NAIL IN B. CAP REMC POLE 4522	N	21.77'
NAIL IN B. CAP NIPSCO POWER POLE ⁶³⁶ 904	ENE	61.24'
± RR RAIL FCP	S	20.2'
FO PK NAIL W B. CAP POWER POLE	S	18.19'

"WALKER" SURVEY OCT 18 2002 # 2003010405

SCOTT


23

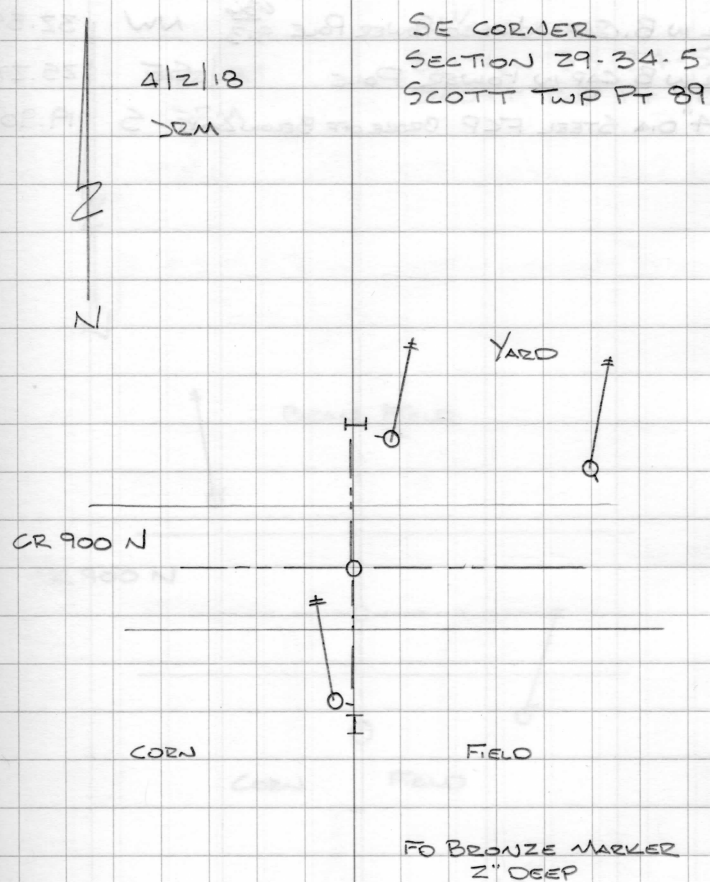

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP NIPSCO POWER POLE ⁶³⁶ 913	NW	32.55'
NAIL IN B. CAP IN POWER POLE	SE	25.27'
FO 4" DIA STEEL FCP BROKE OFF BELOW GROUND	S	19.90'

SCOTT

24

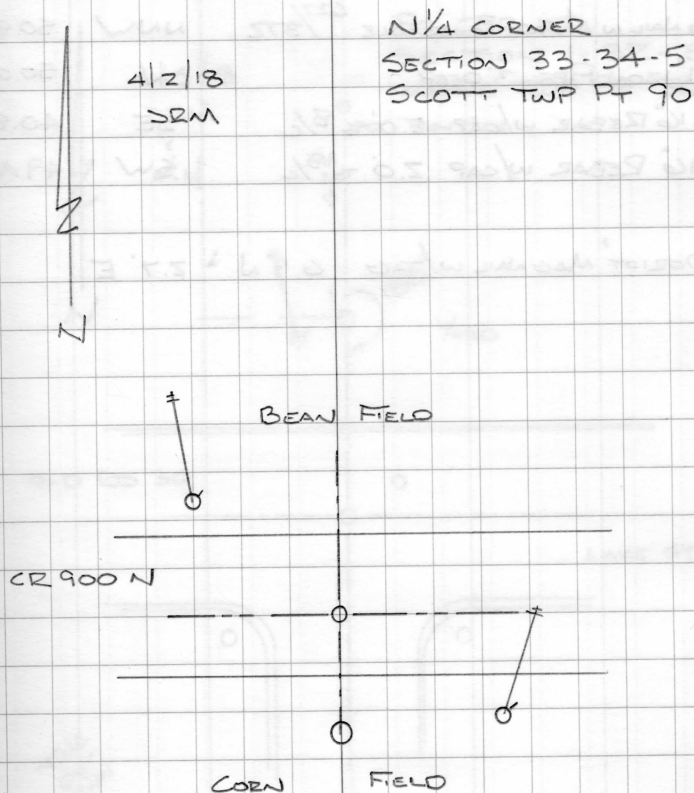

FO 1/2" REBAR
2" DEEP


DESCRIPTION	BEARING	DISTANCE
MAG NAIL IN NIPSCO POWER POLE 427/372	NNW	50.83'
FO 1" IRON PIPE 3" DEEP	N	50.00'
1/2" X 16" REBAR W/CAP 2.0' TO B/C	SE	40.86'
1/2" X 16" REBAR W/CAP 2.0' TO B/C	SW	49.49'
FO "DORIOT" MAG NAIL W/TAG 6.9' N & 2.7' E		

"WALKER" SURVEY 7/14/1992 DOC # 93-02-0165

"WALKER" SURVEY 5/4/1995 DOC # 95-08-0538

WAYNE

25

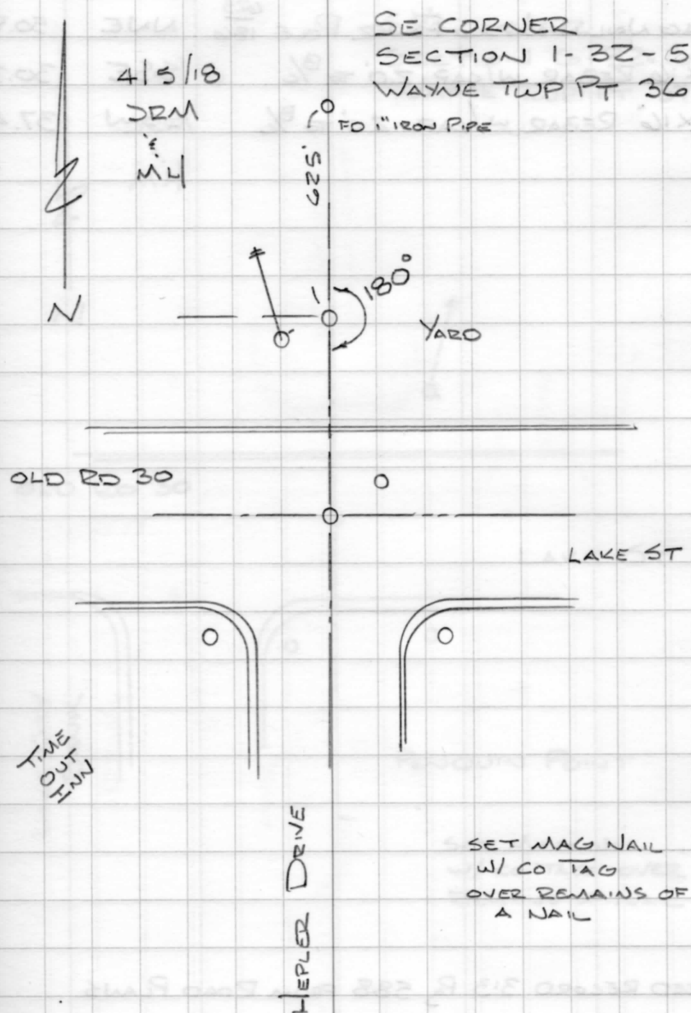

DESCRIPTION


BEARING DISTANCE

MAG NAIL IN NIPSCO POWER POLE ⁶²⁵ 186	NNE	50.84'
1/2" X 16" REBAR W/CAP 2.0' TO B/C	SSE	30.35'
1/2" X 16" REBAR W/CAP 2.0' TO B/C	SSW	37.43'

DEED RECORD 313 Pg 588 FROM ROAD PLANS

WAYNE


26

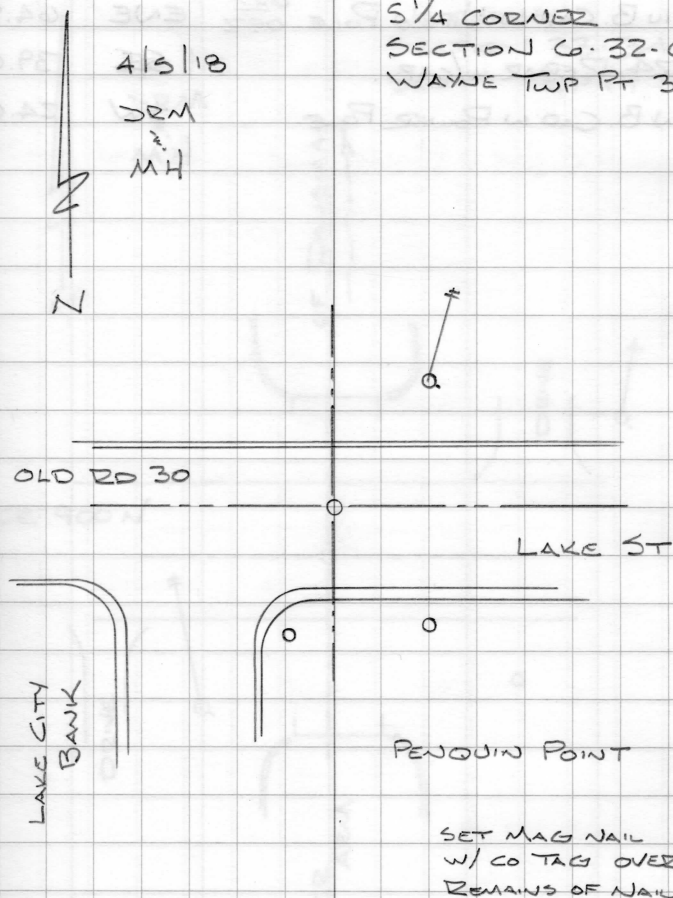

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN NIPSCO POLE $\frac{637}{052}$	ENE	64.83'
1/2" x 24" REBAR w/CAP	SE	39.06'
NAIL IN B. CAP IN POWER POLE	SW	24.63'

SCOTT

27

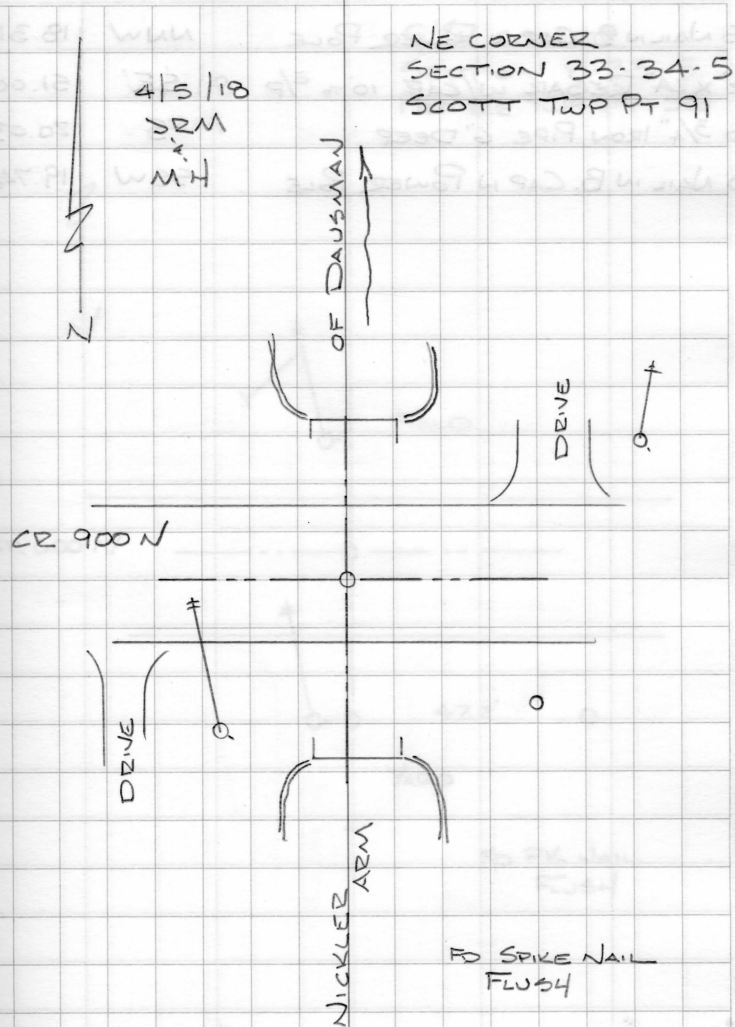


DESCRIPTION	BEARING	DISTANCE
FO NAIL IN B. CAP IN POWER POLE	NNW	18.31'
1/2" x 24" REBAR W/CAP 10' to E/P	SE'	51.00'
FO 3/4" IRON PIPE 6" DEEP	S	20.03'
FO NAIL IN B. CAP IN POWER POLE	SSW	19.74'

"MICHEL" SURVEY JUNE 14 2005 DOC # 200500009791

"KIMPEL" SURVEY JULY 15 2005 DOC # 200500013441

PRAIRIE

28

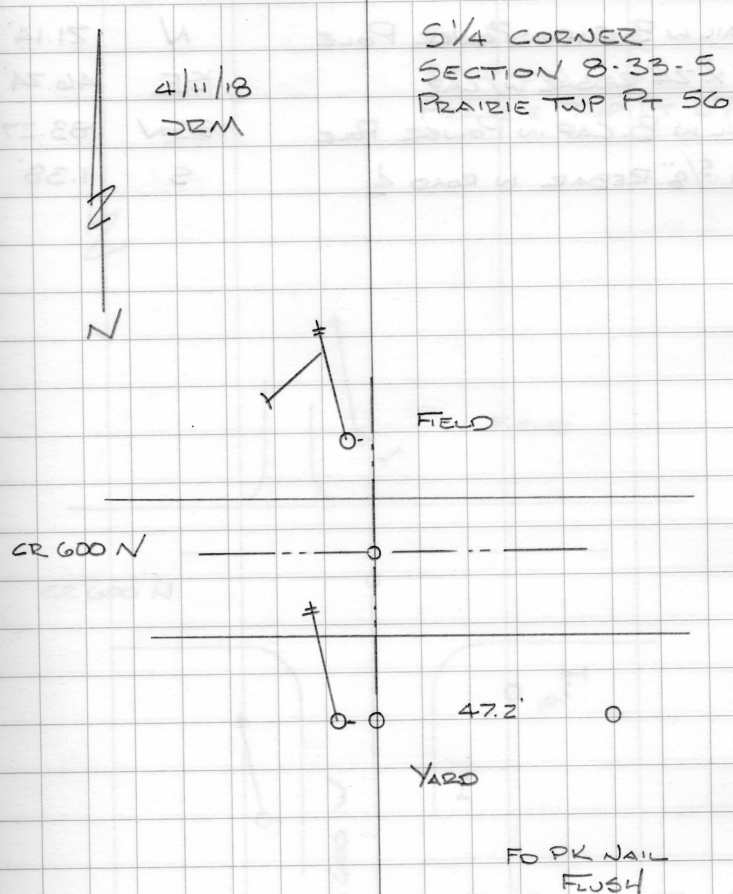

DESCRIPTION

BEARING DISTANCE


NAIL IN B. CAP IN POWER POLE	N	21.14'
1/2" X 24" REBAR W/ CAP	SE	46.24'
NAIL IN B. CAP IN POWER POLE	SSW	83.27'
FO 5/8" REBAR IN ROAD	S	1.38'

"MICHEL" SURVEY 6/14/2005 Doc # 200500009791

"MICHEL" SURVEY 4/19/2013 Doc # 2013110306

PRAIRIE

29

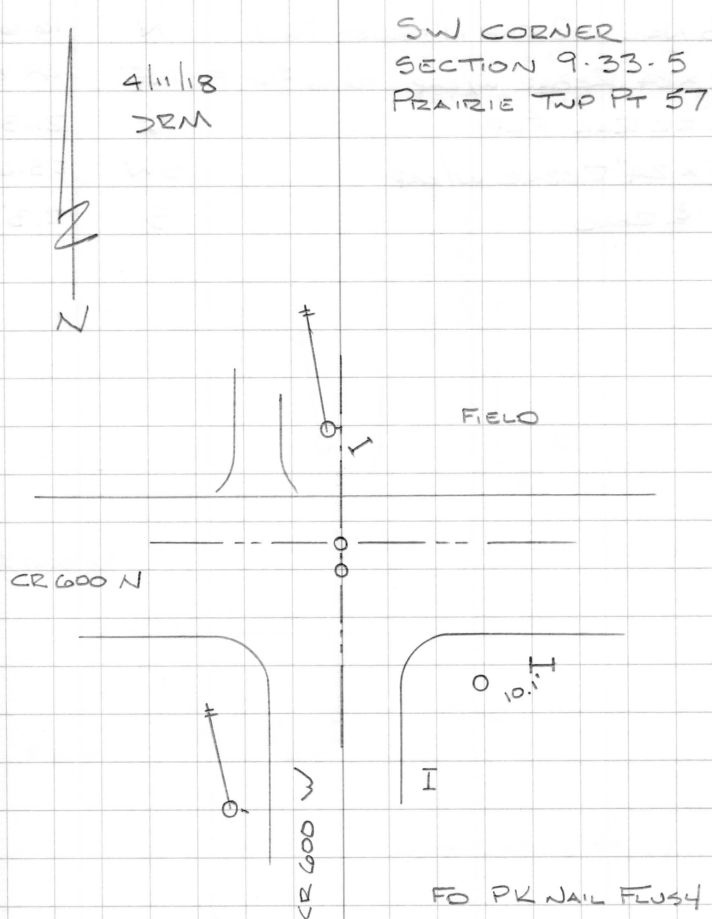


DESCRIPTION	BEARING	DISTANCE
FO NAIL IN B. CAP IN POWER POLE	N	16.61'
1/2" x 24" REBAR W/CAP 16' TO E/P	NE	49.87'
± RR RAIL FCP	S	21.8'
1/2" x 24" REBAR W/CAP	SW	23.68'
± ROAD	S	2.3'

"MICHEL" SURVEY/ DEC 6, 2010 DOC # 20110110ZZ
 "MICHEL" SURVEY/ APRIL 18, 2013 DOC # 2013091075

PRAIRIE


30

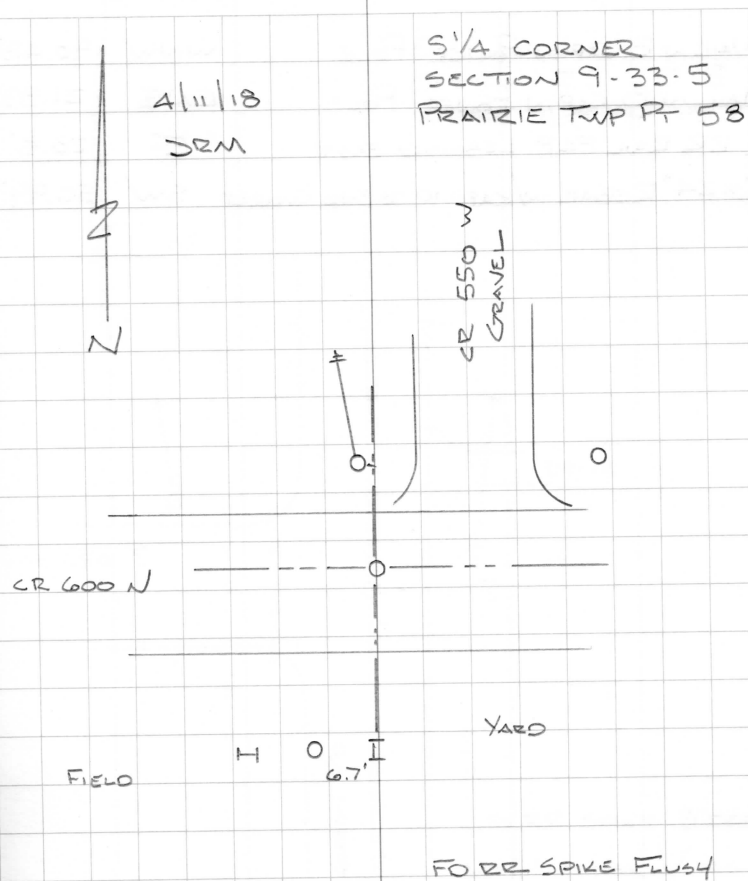

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	WNW	90.48'
NAIL IN B. CAP IN POWER POLE	ENE	21.33'
⊥ RR RAIL FCP LEANING EAST	E	20.5'
1/2" x 24" REBAR W/ CAP 10' TO END CULVERT	SW	50.99'

WAYNE


31

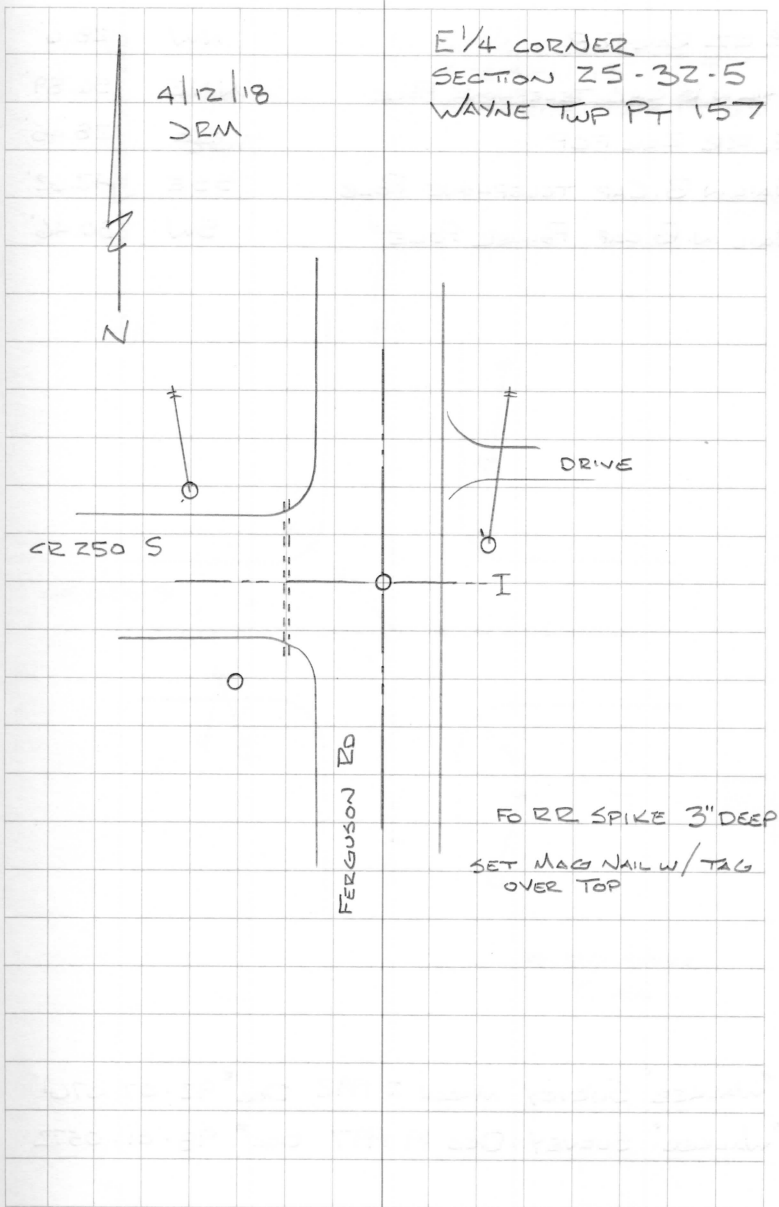

DESCRIPTION	BEARING	DISTANCE
E RR RAIL FCP	NW	28.6'
NAIL IN B. CAP TELEPHONE POLE	NNE	56.89'
E RR RAIL FCP	SE	28.45'
NAIL IN B. CAP TELEPHONE POLE	SSE	42.62'
NAIL IN B. CAP POWER POLE	SW	30.46'

MONROE

32

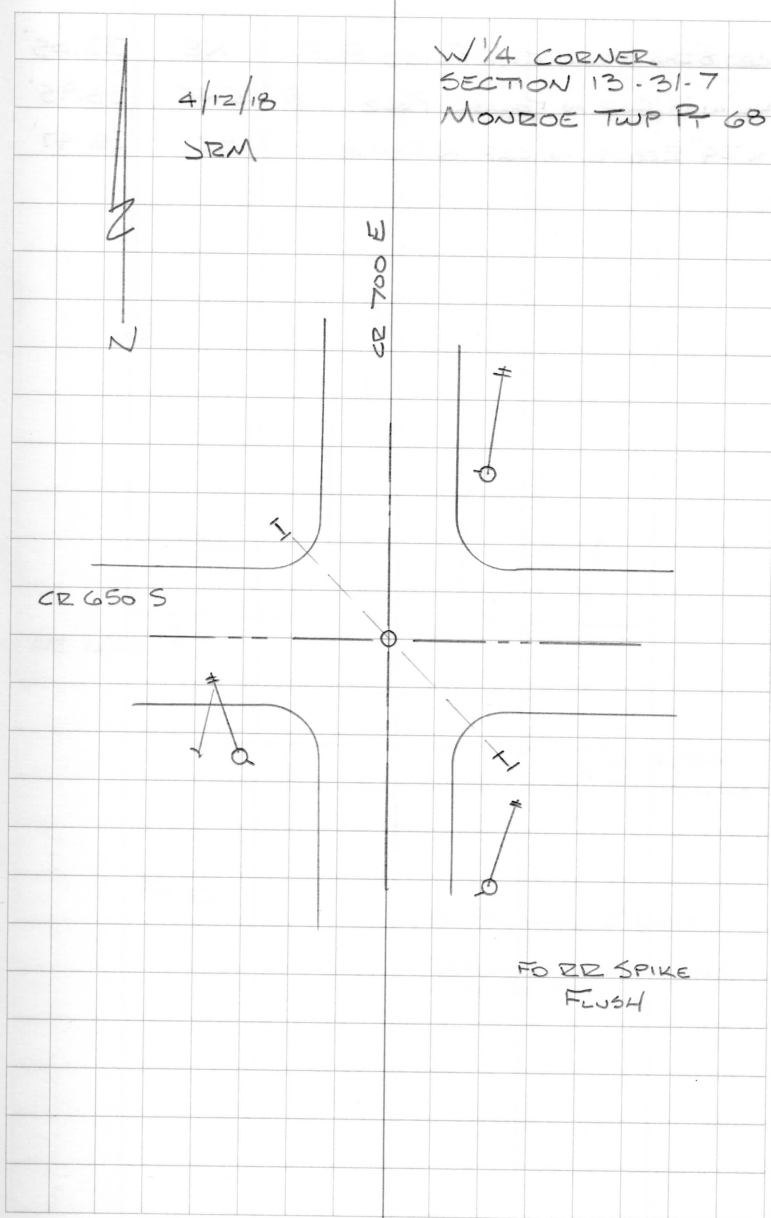

"WALKER" SURVEY MARCH 2 1992 Doc # 92-07-0761

"WALKER" SURVEY DEC 19 1997 Doc # 98-01-0572

DESCRIPTION

BEARING

DISTANCE

FACE 8" DIA STEEL CONC FILLED FCP

NE

33.05'

NAIL IN B. CAP IN POWER POLE

ENE

38.95'


1/2" x 24" REBAR W/ CAP IN FENCE

SE

38.47'

MONROE


33

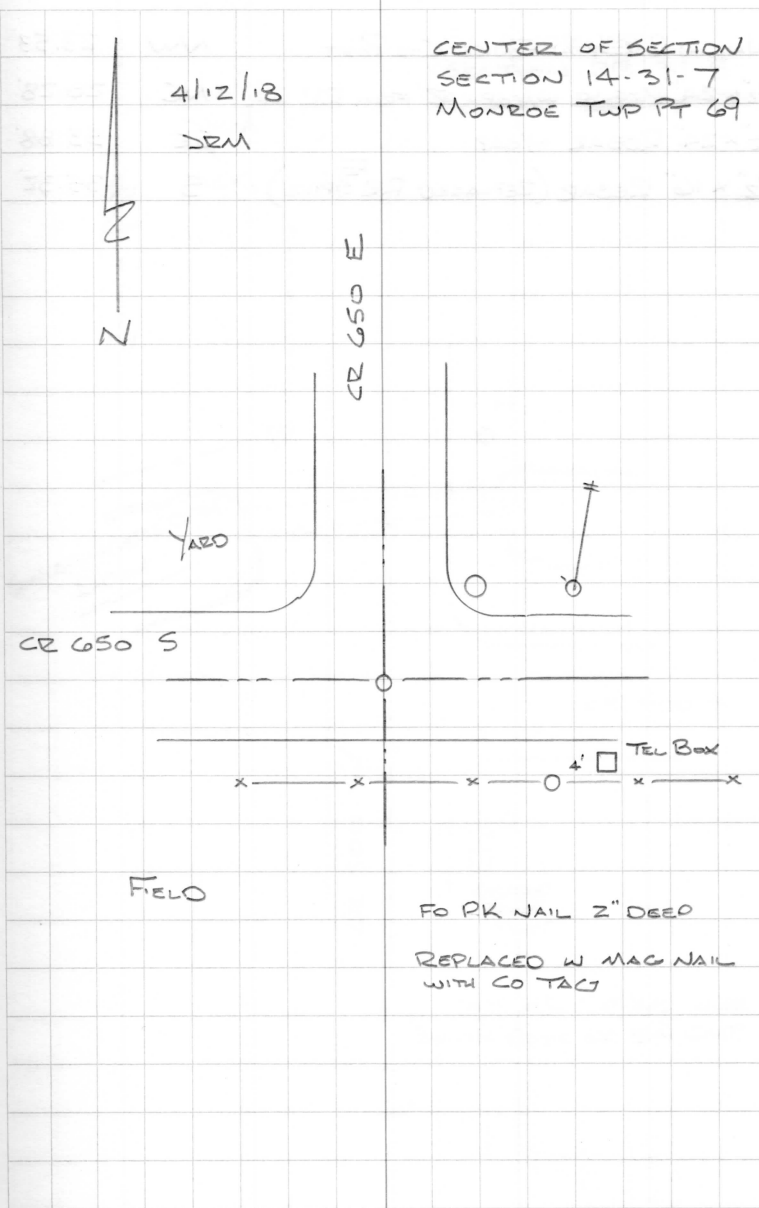

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN FENCE COR POST	NW	23.53'
1/2" x 24" REBAR W/CAP 2' FROM RR RAIL	NE	28.28'
1/2" x 24" REBAR W/CAP	SE	53.88'
1/2" x 16" REBAR (REPLACED RR SPIKE) ^{FO}	S	35.32'

SEWARD

34

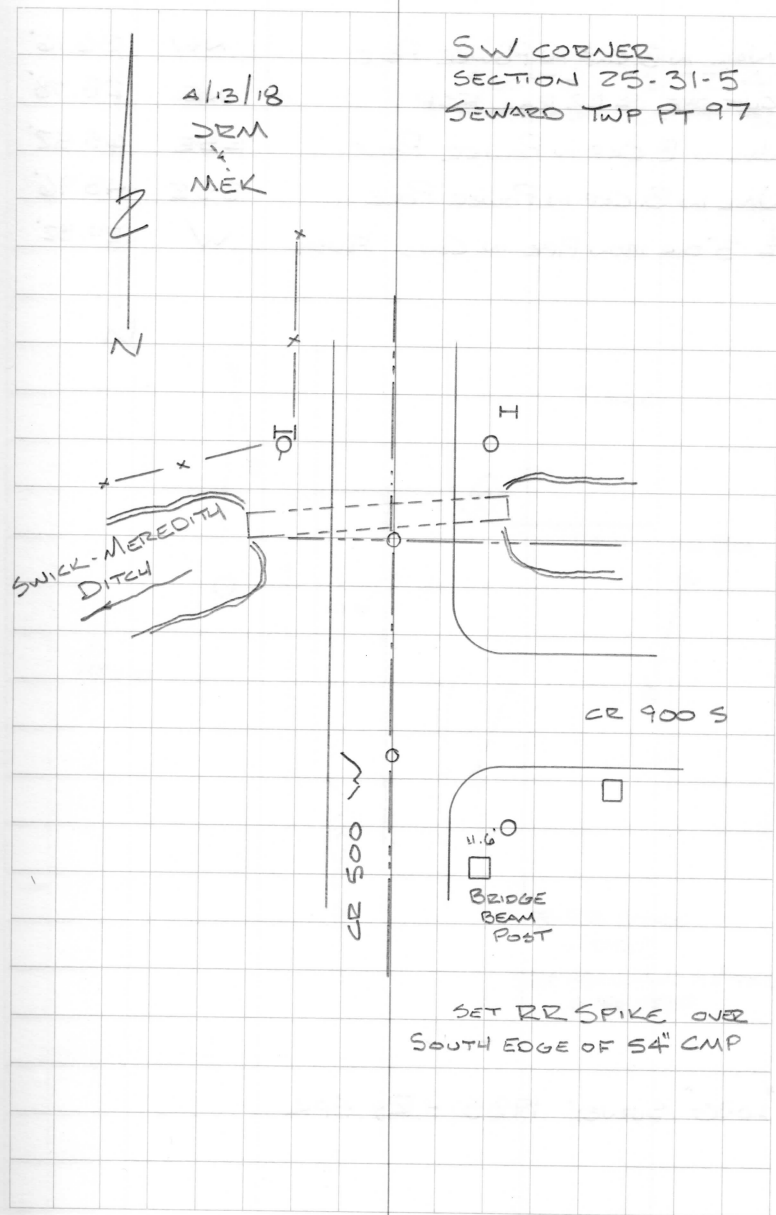

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	NW	36.16'
CUT OFF & RR RAIL FCP	NE	28.78'
NAIL IN B. CAP IN POWER POLE	ESE	65.52'
NAIL IN B. CAP IN POWER POLE	SSE	48.96'
& 3" DIA IRON PIPE IN CONC FLUSH	W	20.82'

"LONG" SURVEY 1985 - Ry SPK


HARRISON

35



4/16/18
JRM

S 1/4 CORNER
SECTION 26-32-4
HARRISON TWP T 150

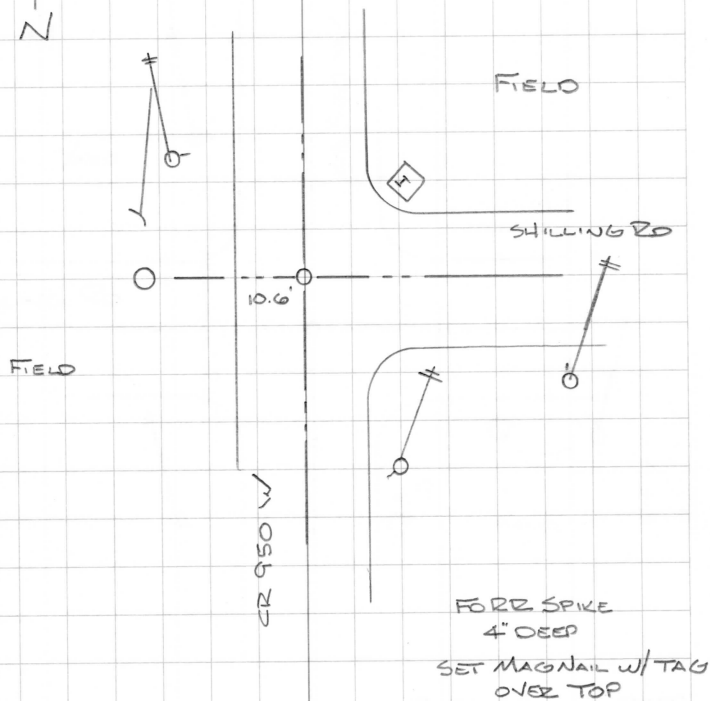


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	NNW	55.37'
NAIL IN B. CAP IN POWER POLE	ESE	70.23'
1/2" x 24" REBAR W/CAP	SE	43.40'
NAIL IN B. CAP IN POWER POLE	SSW	41.42'

"RETZ" SURVEY - AUG 31, 1976 SURVEY RECORD BOOK
29 Pg 83 - RR SPIKE

HARRISON

36

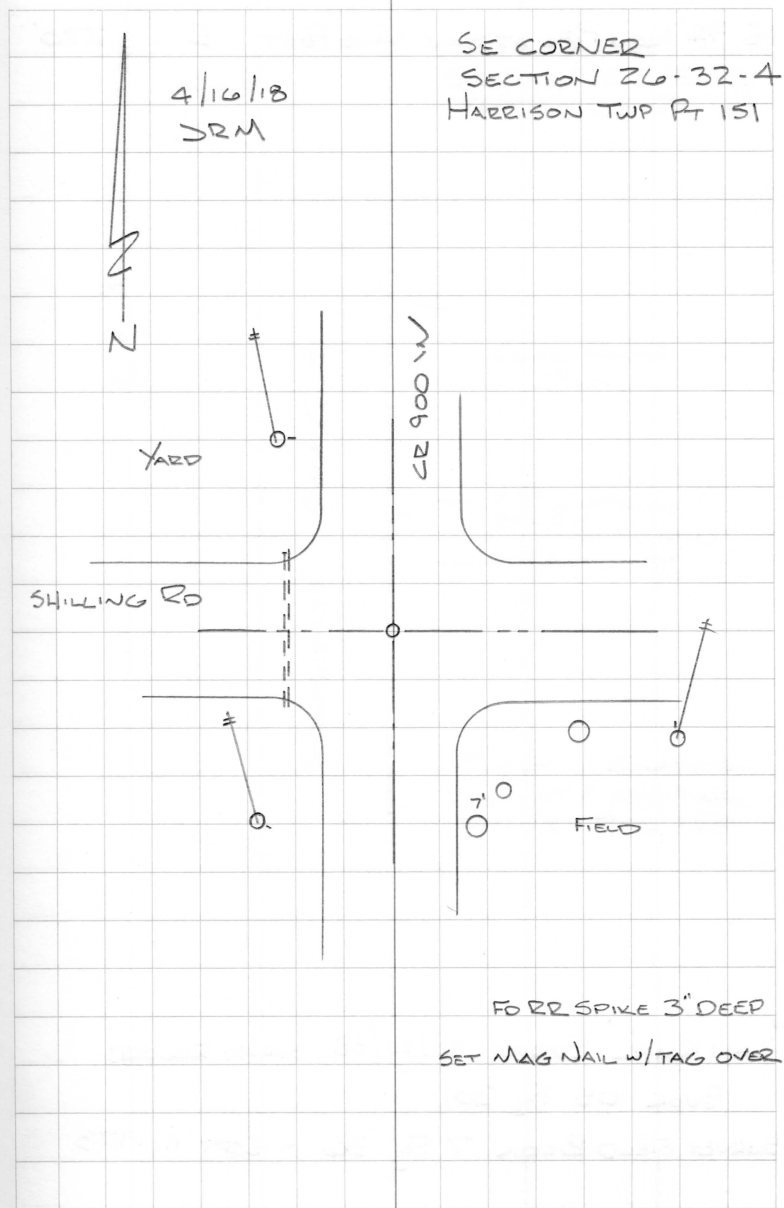


DESCRIPTION	BEARING	DISTANCE
TO 3/4" IRON PIPE AT BASE WOOD POST	E	220'

"JOHN KIMPEL" SURVEY 10/22/88 SURVEY RECORD
 BOOK 105 Pg 30
 SURVEY FIELD BOOK 7 Pg 36 - SEPT 11, 1973

WAYNE

37

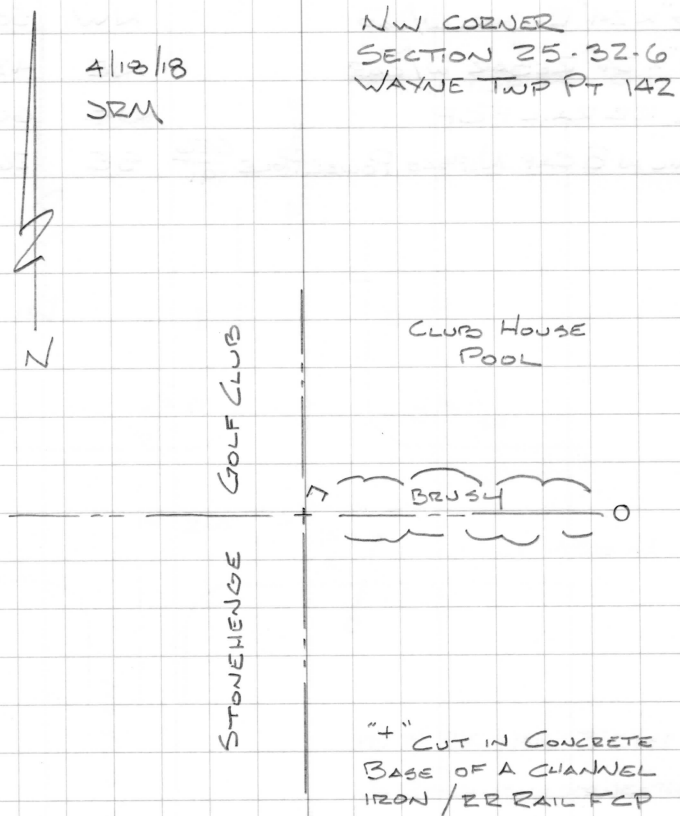


DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR W/CAP	NW	50.43'
1/2" x 24" REBAR W/CAP	NE	43.20'
4 RR RAIL FCP	NNE	60.65'
NAIL IN B. CAP NIPSCO POWER POLE ⁶²⁶ / ₁₉₁	SE	26.00'

"WALKER" SURVEY - SEPT 25 1995 DOC # 96-04-0608

"KIMPEL" SURVEY - JAN 11 2005 DOC # 2005 00000783

PLAIN

38

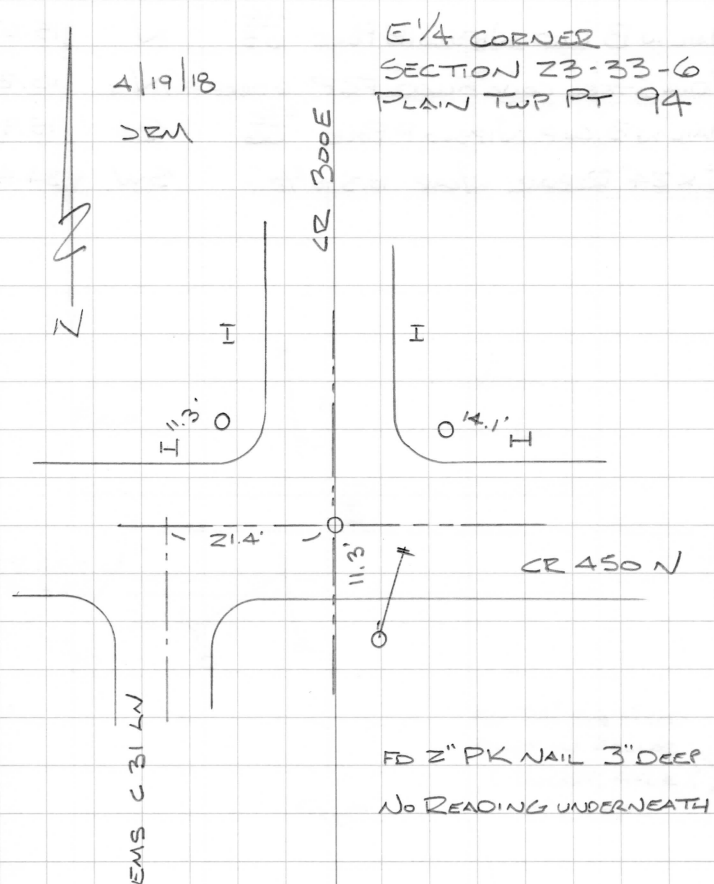

DESCRIPTION	BEARING	DISTANCE
NAIL W B CAP NIPSCO P. POLE $\frac{626}{165}$	N	15.63'
4" DIA STEEL CONC FILLED FCP 6" DEEP	N	16.8'
NAIL W B CAP NIPSCO P. POLE $\frac{626}{166}$	S	15.95'
1/2" X 24" REBAR W/CAP 10.35 TO E/P	SW	34.40'

BEARING DISTANCE

NAIL IN B CAP NIPSCO P. POLE	$\frac{626}{165}$	N	15.63'
------------------------------	-------------------	---	--------

15.63

4" DIA STEEL CONC FILLED FCP	6" DEEP	N	16.8'
------------------------------	---------	---	-------

16.8'


NAIL WB. CAP NIPSCO P POLE	$\frac{626}{166}$	S	15.95
----------------------------	-------------------	---	-------

15.95

1/2" x 24" REBAR w/CAP 10.3 TO E/P	SW	34.40'
------------------------------------	----	--------

34.40

PLAIN

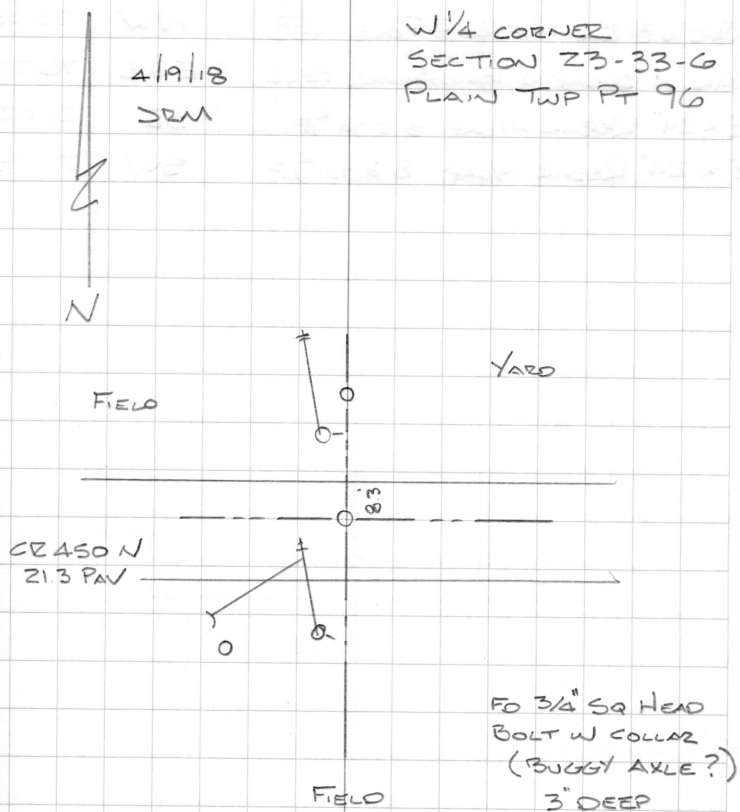

SDM

W 1/4 CORNER
SECTION 23-33-6
PLAIN TWP PT 96

FIELD

Yaro

CE 450 N
21.3 PAV


FO 3/4" SQ HEAD
BOLT W COLLAR
(BUGGY AXLE?)
3" DEEP

DESCRIPTION		BEARING	DISTANCE
NAIL IN B. CAP NIPSCO P. POLE	⁶²⁶ 153	NW	33.00'
NAIL IN B. CAP IN TRANSFORMER POLE		ENE	76.77'
1/2" x 24" REBAR w/CAP 8.2' TO E/P		SE	21.02'
1/2" x 24" REBAR w/CAP 8.3' TO E/P		SW	27.75'

"NORTH WINDS" PLAT BOOK 10 Pg 43
 "WALKER" SURVEY SEPT 22 2005 DOC # 200500015437

PLAIN

40

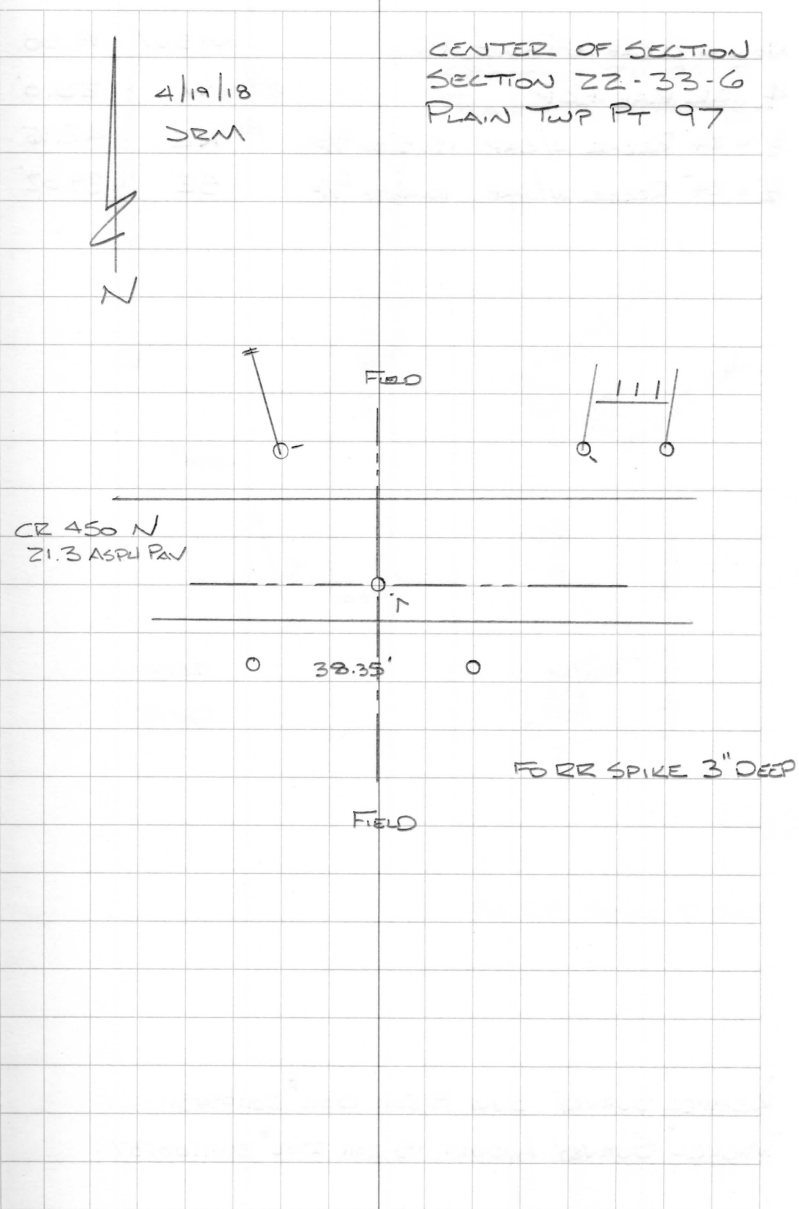

DESCRIPTION

BEARING

DISTANCE

NAIL IN B. CAP IN POWER POLE

WSW

19.60'

4 RR RAIL FCP

W

20.0'

 $\frac{1}{2}$ " x 24" REBAR W/CAP 15.5' TO E/P

NE

42.16'

 $\frac{1}{2}$ " x 24" REBAR W/CAP 10.4' TO E/P

SE


39.02'

"KEMPER" SURVEY/ JULY 19 2011 DOC # 2011090311

"MICHEL" SURVEY/ AUGUST 15 2011 DOC # 2011100137

PRAIRIE

41

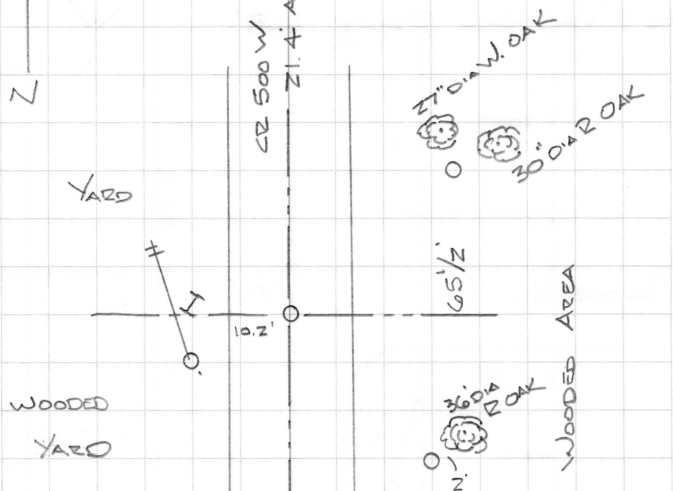4/20/18
JRMCR 500 W
21.4' ASPH PAV.E 1/4 CORNER
SECTION 21-33-5
PRAIRIE TWP PT 98

FD RR SPIKE 2" DEEP


DESCRIPTION	BEARING	DISTANCE
E RR RAIL FCP	W	20.25'
1/2" x 24" REBAR w/CAP 9.7' to E/P	NW	34.25'
1/2" x 24" REBAR w/CAP 15.5' to E/P	NE	53.37'
NAIL IN B. CAP IN POWER POLE	SSE	57.91'
FO 2" MAG NAIL 3" DEEP 1.67'	✓	

"KEMPER" SURVEY JULY 19 2011 DOC # 2011090311

"MICHEL" SURVEY AUG 16 2011 DOC # 201100141

PRAIRIE

42

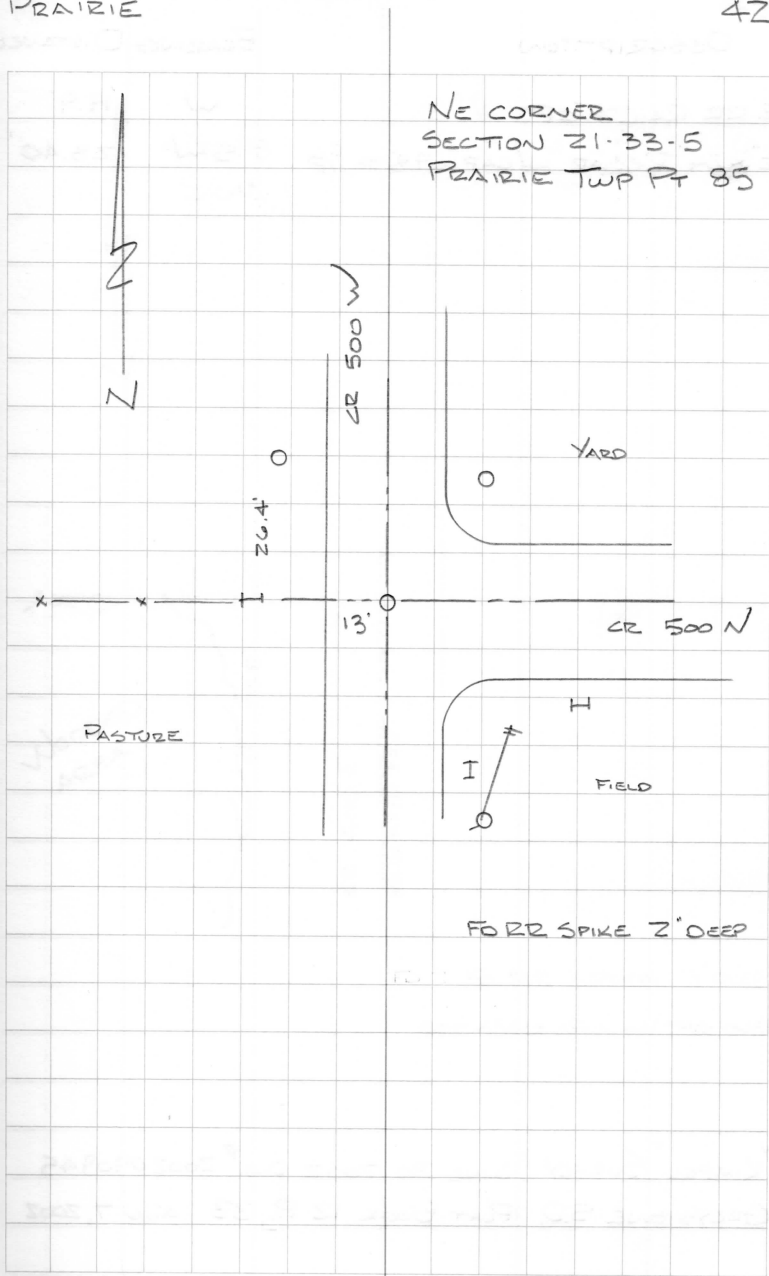


DESCRIPTION	BEARING	DISTANCE
ERR RAIL FCP	W	19.9'
1/2" x 24" ZESAR W/CAP 9.8' TO E/P	SW	28.40'

"KIMPEL" SURVEY JUNE 20 2002 Doc # Z002090945
 GREYSTONE S.D. PLAT BOOK 12 Pg 33 AUG 7, 2002

PLAIN

43

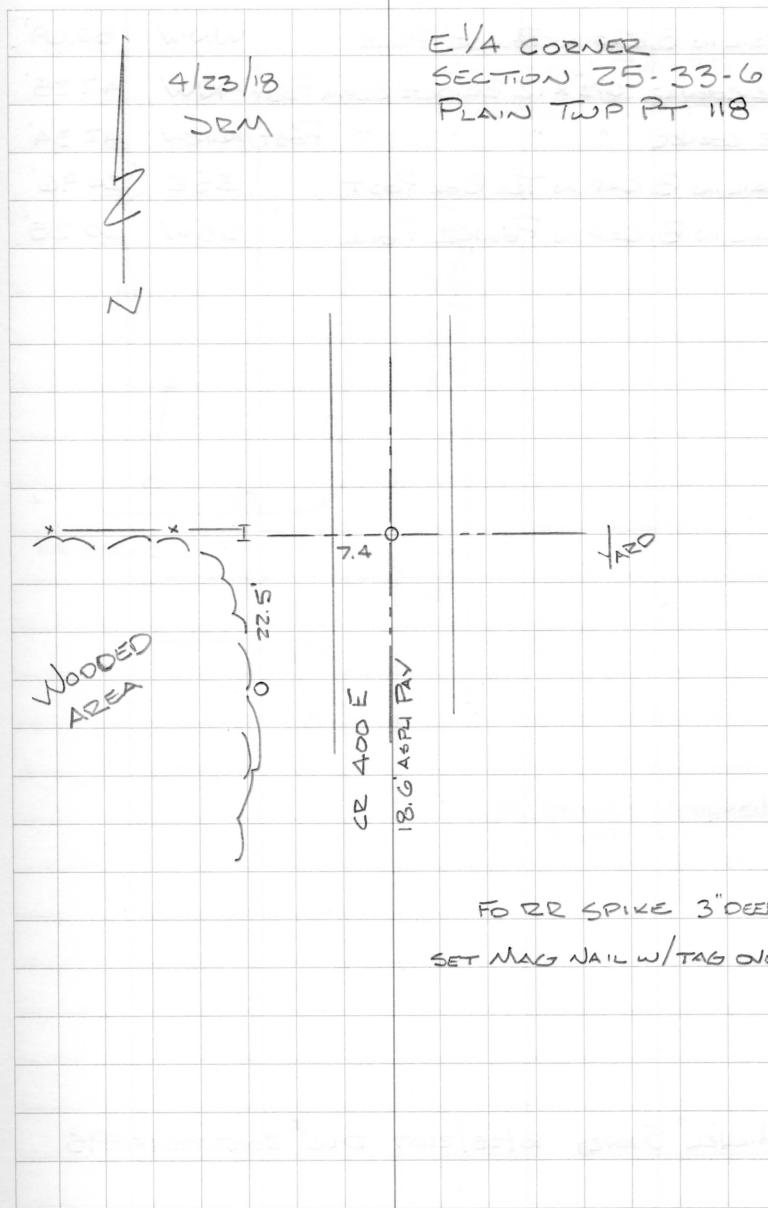


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	WNW	80.69'
SE CORNER 6 1/2" x 12" BRIDGE BEAM POST	NW	42.25'
SE CORNER " " " " POST	NNW	42.34'
NAIL IN B. CAP IN TEL BOX POST	ESE	24.96'
NAIL IN B. CAP IN POWER POLE	SSW	60.35'

"MICHEL" SURVEY 10/25/2007 Doc # 200700014895

FRANKLIN

44

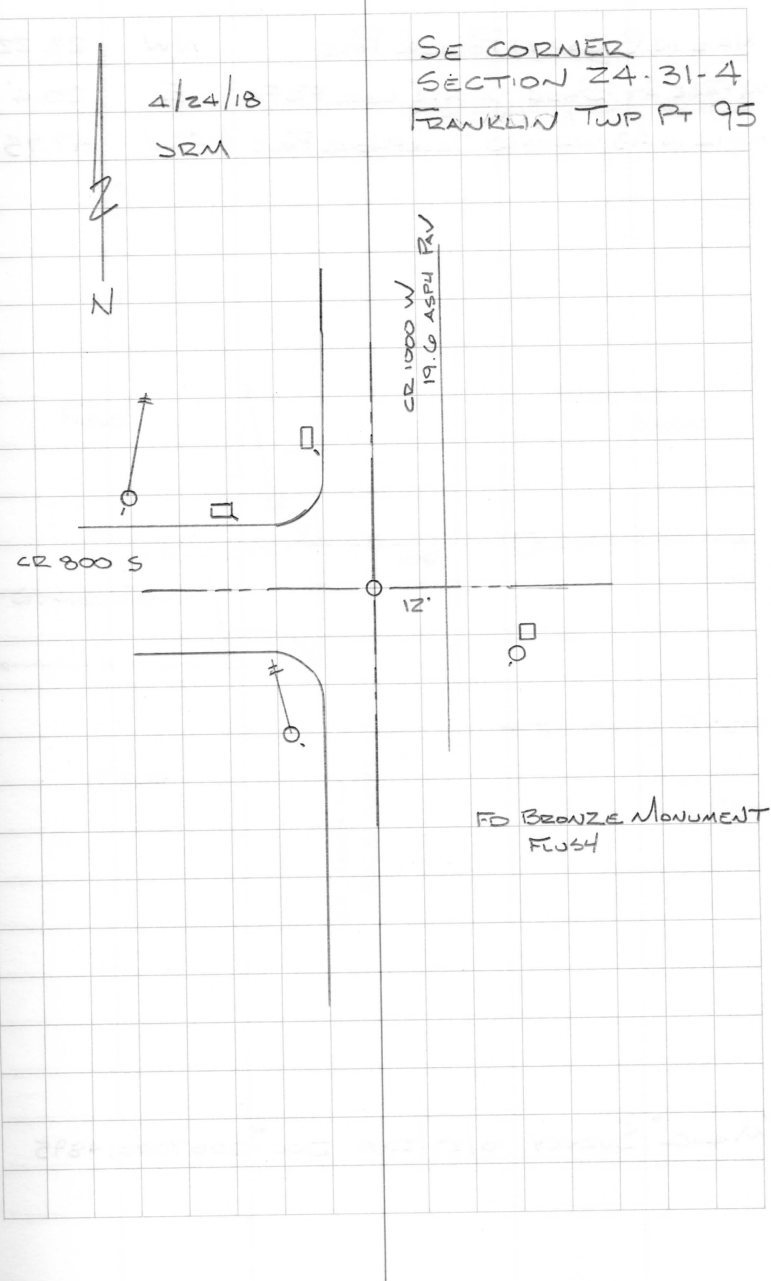


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	NW	23.22'
W. FACE AT BASE 10" X 12" CONC FCP	E	20.4'
NAIL IN ABANDONED TELEPHONE POLE	SW	47.75'

"MICHEL" SURVEY 10/27/2007 DOC # 200700014895

FRANKLIN

45

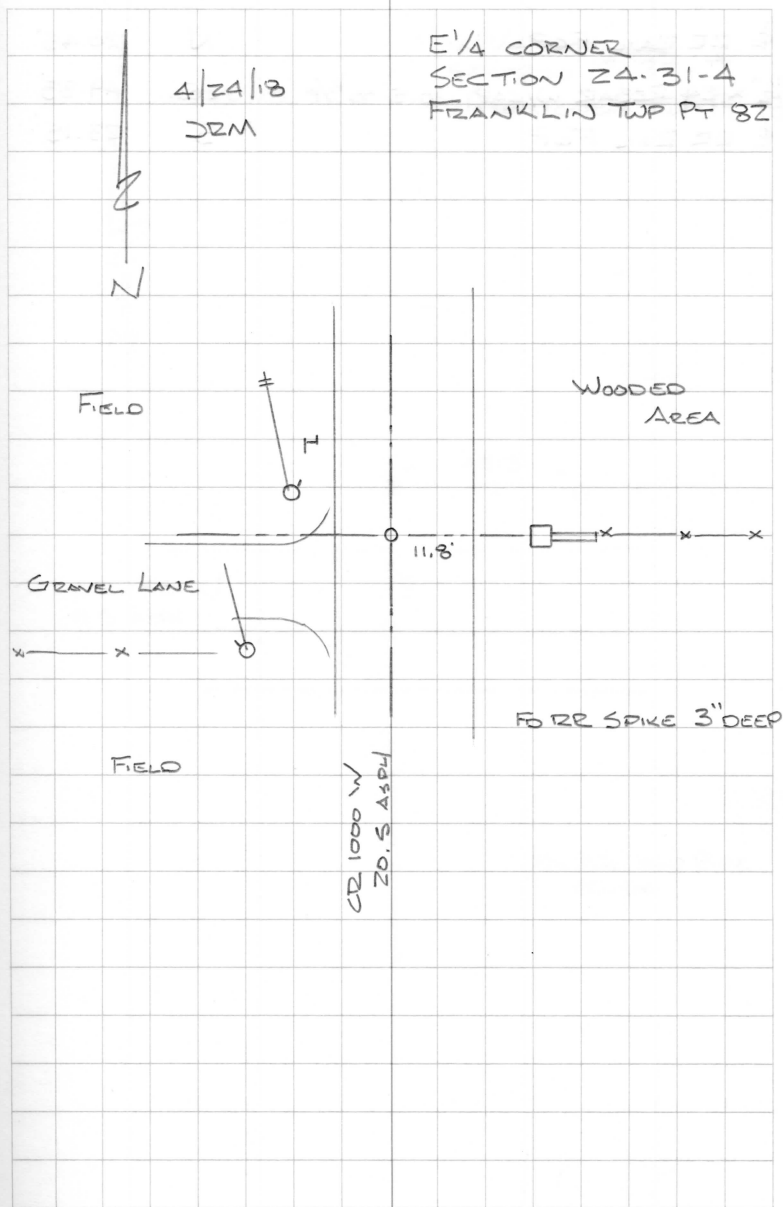

4/25/18
JRM

CENTER OF SECTION
SECTION 25-33-6
PLAIN TWP PT 119



YARD

STONERURNER

AUTUMN TRAIL



YARD

FIELD


RAILROAD RAIL FGP
LEANING SOUTH

"GREYSTONE" S.D. PLAT BOOK 12 Pg 33

DESCRIPTION	BEARING	DISTANCE
1/2" RR RAIL FCP	N	19.95'
1/2" x 24" REBAR w/CAP 10' TO E/P	NE	24.53'

PLAIN

48

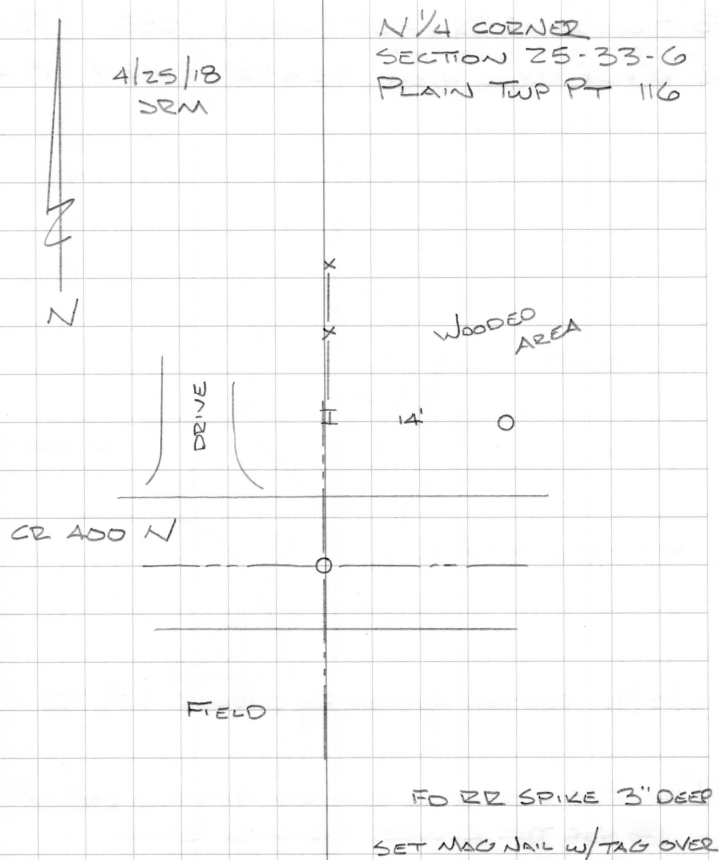

"KEMPER" SURVEY OCT 17, 2000 Doc # 2000101356
 "MICHEL" SURVEY MARCH 6, 2013 Doc # 2013060040

DESCRIPTION	BEARING	DISTANCE
FO " CUT IN RR RAIL FCP (6/13/91)	SSE	23.86'
SET 1/2" x 24" REBAR W/CAP 9.5' TO E/P	WNW	15.65'

6/13/91 SECTION CORNER FIELD BOOK 1 P. 22

1" IRON PIPE DESTROYED DURING CONSTRUCTION OF
18" N 12 TILE CULVERT AND CATCH BASINS

"WALKER" SURVEY AUGUST 10, 1995 DOC # 95-08-0658

"MICHEL" SURVEY MARCH 6, 2013 DOC # 2013060040


"BROWER" SURVEY DEC 4, 1987 RECORD BOOK 102 P. 27

"KIMPEL" SURVEY NOV 22, 2000 DOC # 2001030857

"UNDERWOOD" SURVEY APRIL 23, 1974 RECORD BOOK 42 P. 67

PLAIN

49

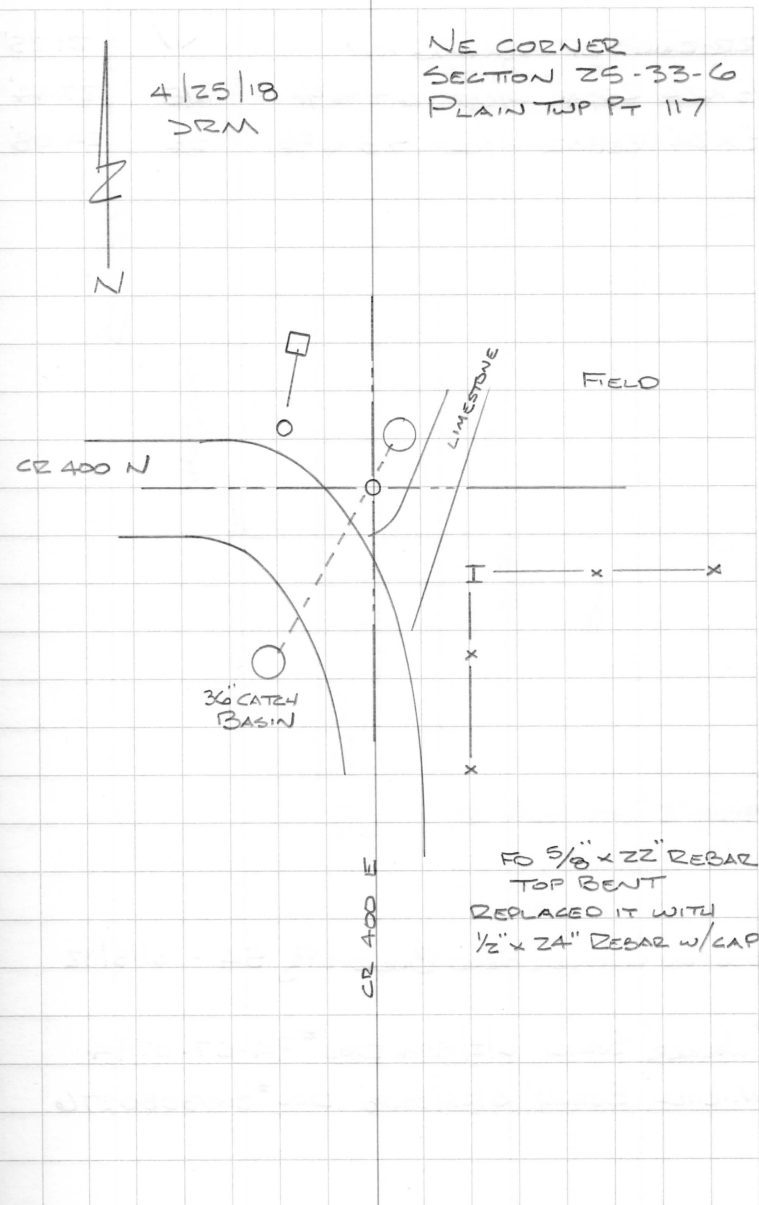

DESCRIPTION	BEARING	DISTANCE
RR RAIL FCP LEAVING NW	W	21.25'
1/2" x 24" REBAR w/CAP 6.7' TO E/P	NE	27.44'
1/2" x 24" REBAR w/CAP 7.0' TO E/P	SE	24.08'


SECTION CORNER FIELD BOOK 1 Pg 54 - 6/18/92

"WALKER" SURVEY 6/2/1994 DOC # 94-07-0794

"MICHEL" SURVEY 6/25/2008 DOC # 2008080376

PLAIN

50

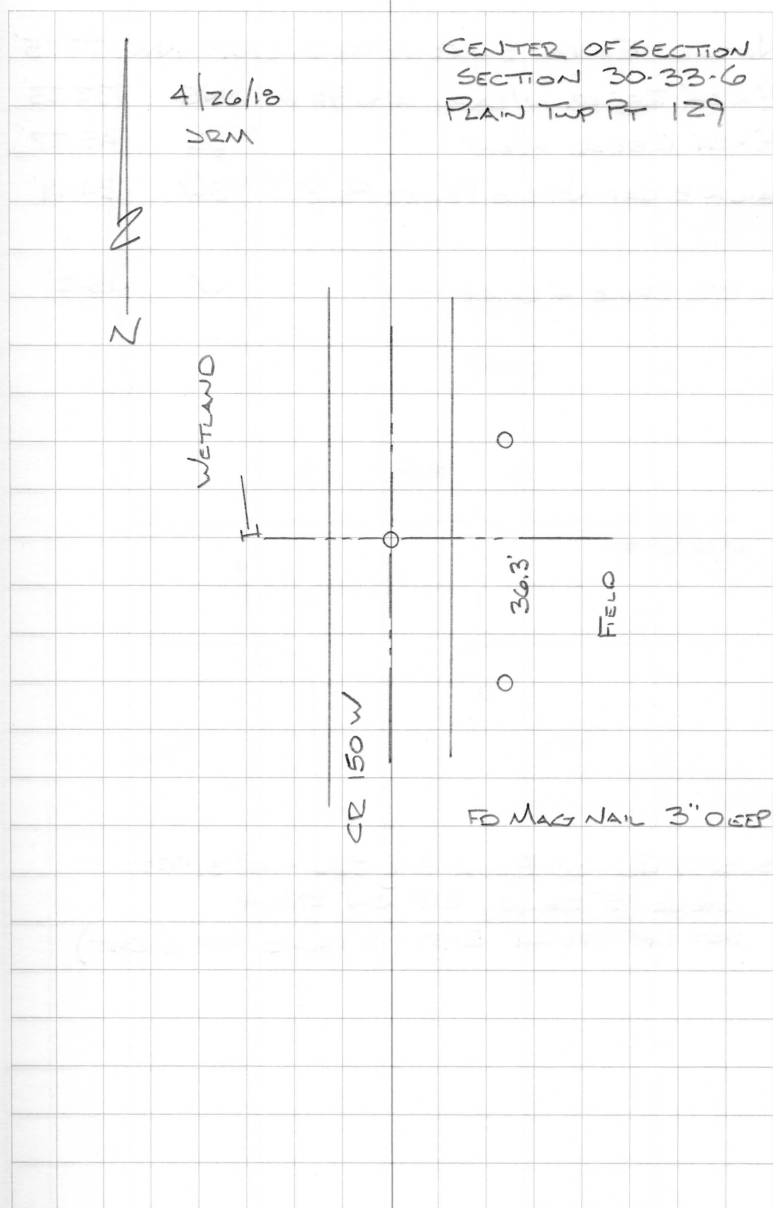

DESCRIPTION	BEARING	DISTANCE
NOTCHED FLANGE SW EDGE RR RAIL FCP NW		27.75'
1/2" x 24" REBAR W/CAP 14' TO E/P	NE	32.23'
1/2" x 24" REBAR W/CAP	SE	45.27'
NAIL IN B. CAP NIPSCO POWER POLE	SW	34.19'
FORD SPIKE 4" DEEP	W	15.2'


SURVEY RECORD BOOK 3 P. 266 - 4/13/1929

STONE 15" DOWN, RIP NW 27 1/2 FT

SET I.P. 979.44' EAST (I.P. FOUND 979.6' EAST)

PLAIN

51

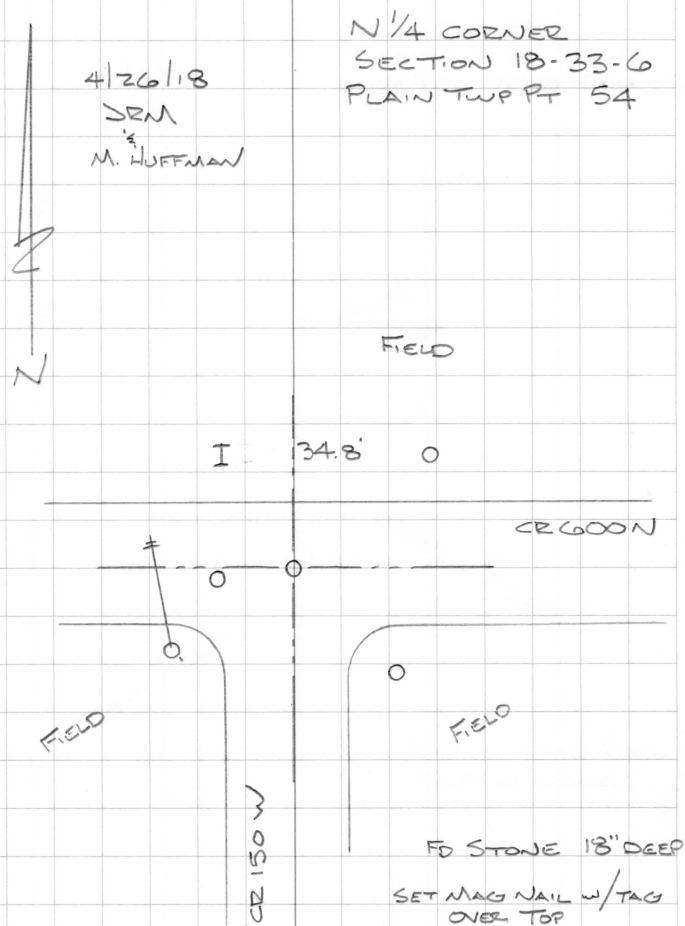

5/1/18
JRM

N 1/4 CORNER
SECTION 2-32-6
WAYNE TWP PT 13



WOODED
AREA

CORN FIELD

BEAN
FIELD


FD RAILROAD RAIL
FCP IN CONC

DESCRIPTION	BEARING	DISTANCE
FO 1 1/2" MAG NAIL NO TAG FLUSH	W	69.84'
1/2" x 24" REBAR W/CAP 8.2' TO E/P	SW	33.17'
E RR RAIL FCP	S	16.05'
FO 5/8" x 12" REBAR NO CAP IN FENCE	S	29.63'

"THE COUNTY" PLAT BOOK 11 P. 14 AUGUST 20, 1996


WAYNE

53

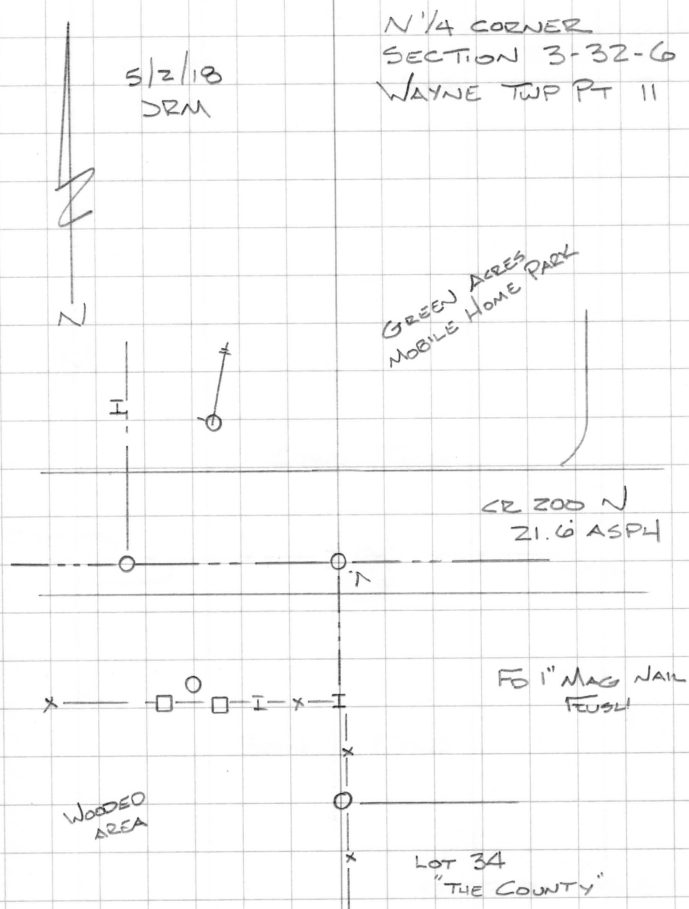

NORTH BETWEEN SECTIONS 2 & 3-32-6
 ORIGINAL FIELD NOTE BOOK Pg 201 1833
 "INTERSECTED 1581KS EAST OF POST"
 (104.28')

5/2/18
 DEM



NW CORNER
 SECTION 2-32-6
 WAYNE TWP PT 12

CORN FIELD




BEAN FIELD

FOUR RAIL FCP
 @ BASE OF 26" DIA
 CHERRY TREE

DESCRIPTION	BEARING	DISTANCE
£ RR RAIL FCP	N	24.02'
NAIL W B. CAP IN POWER POLE	NE	26.67'
FO MAG NAIL NO TAG FLUSH	E	69.84'
1/2" x 24" REBAR W/CAP	SE	43.00'

PLAIN

55

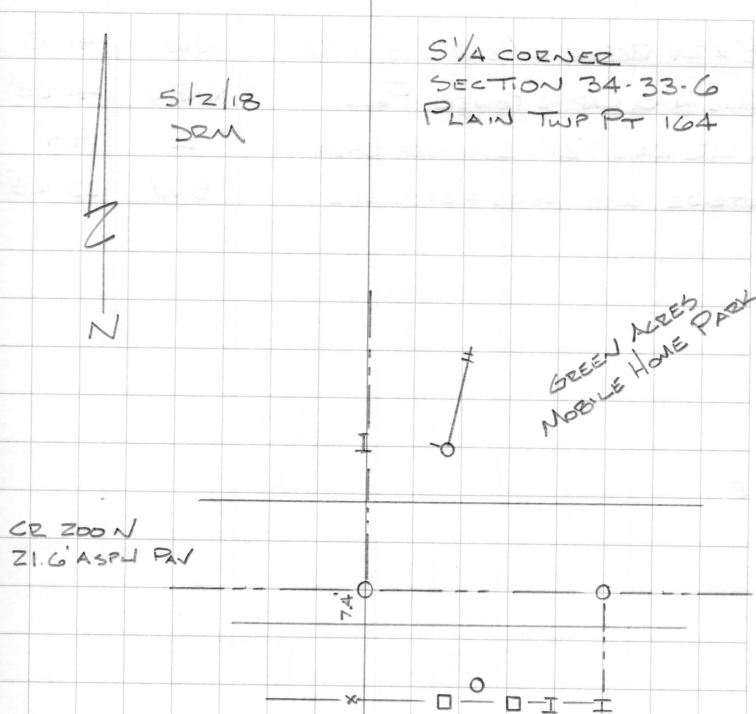


DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR W/ CAP 10' TO E/P	NW	41.05
NAIL IN B CAP IN POWER POLE	NNW	41.30'
E RR RAIL FCP LEANING EAST	E	19.9'
OUTSIDE COR CONC HEADWALL	SW	23.68'

WABASH CO REFERENCES MARCH 28 2014
 FEB 1995 FO PK NAIL & REPLACED WITH "WCSM"

JACKSON

56

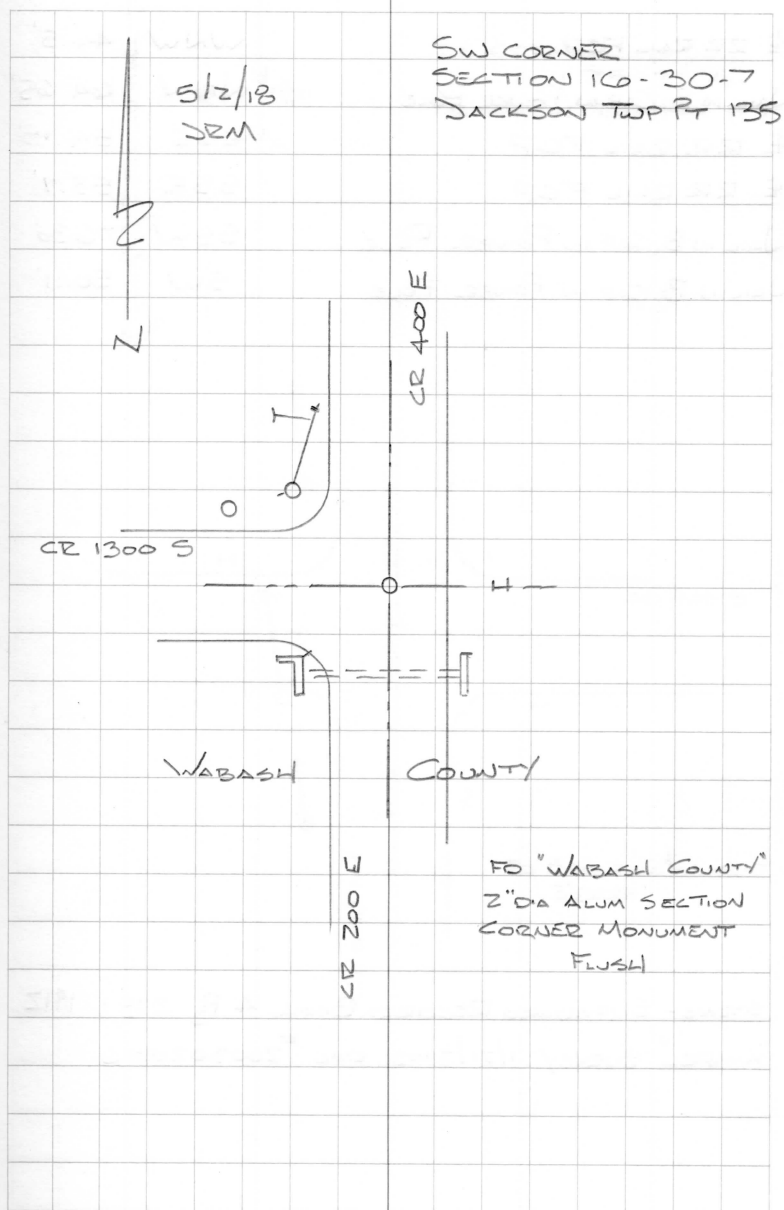


DESCRIPTION	BEARING	DISTANCE
£ RR RAIL FCP	WNW	44.5'
NAIL IN B. CAP IN POWER POLE	NNW	64.65'
£ RR RAIL FCP	ESE	54.15'
£ RR RAIL FCP	SSE	53.7'
NAIL IN B. CAP IN POWER POLE	SSW	76.30'
NAIL IN B. CAP IN POWER POLE	SW	50.11'

STONE - SURVEYORS RECORD BOOK 4 Pg 275 - 1912

"KIMPEL" SURVEY 1/21/2003 OOL # 2003020016


FRANKLIN

57



5/7/18
JEM

SE CORNER
SECTION 25-31-4
FRANKLIN TWP PT 117

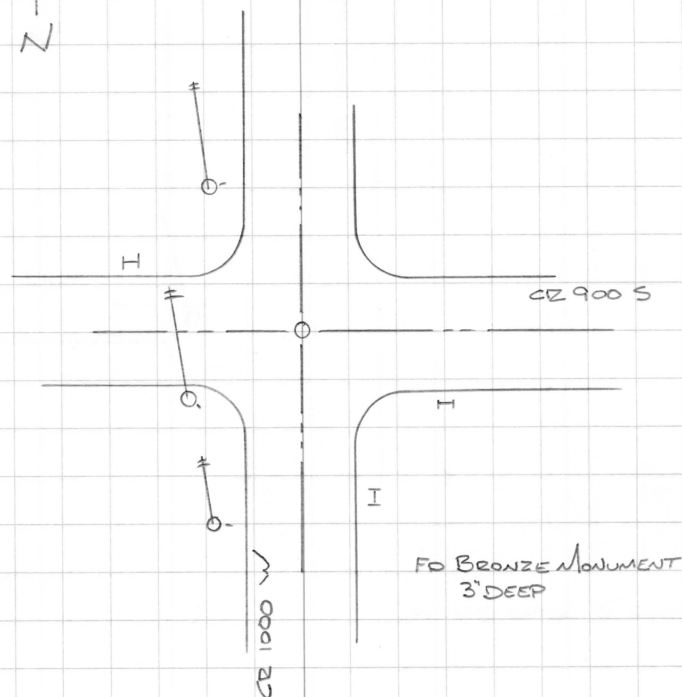


DESCRIPTION	BEARING	DISTANCE
4 RR RAIL FCP	W	21.05'
NAIL IN B. CAP REMC POLE 3434	W	18.89'
4 RR RAIL FCP IN CONC 4/3/1996	NW	32.1'
1/2" x 24" REBAR W/CAP 2.9' TO E/P	SE	34.98'

BEARING	DISTANCE
N 10° E	100
S 80° E	100
S 10° E	100
N 80° W	100
N 10° W	100

21.05'

FRANKLIN

58

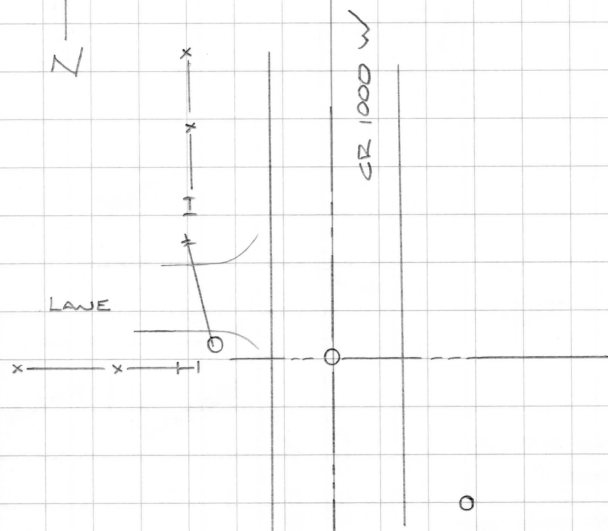

FOR SPIKE 5" DEEP


DESCRIPTION

BEARING DISTANCE

NAIL IN B. CAP IN POWER POLE	NNE	68.72'
1/2" x 24" REBAR W/CAP 7.3' TO E/P	NE	19.17'

HARRISON

59

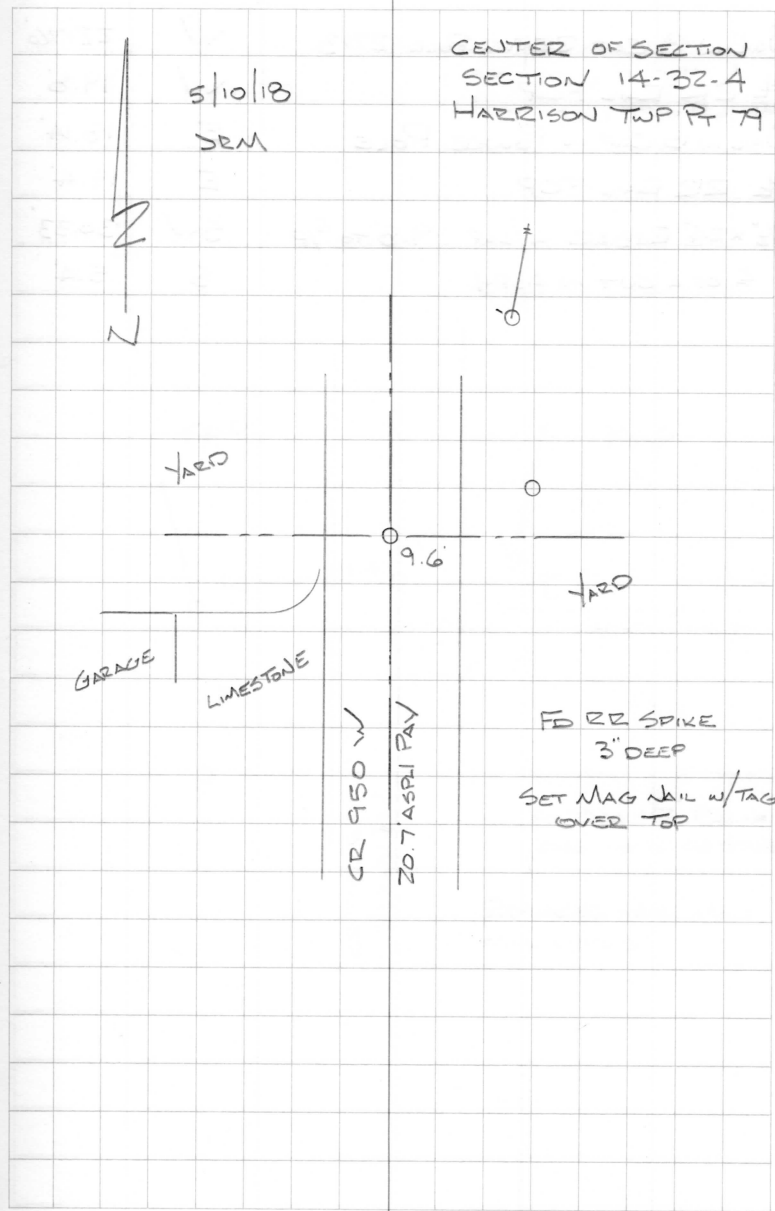

DESCRIPTION

BEARING DISTANCE

NAIL IN B. CAP REMC POLE 2713	W	22.76'
& RR RAIL FCP	W	19.8'
NAIL IN B. CAP IN POWER POLE	E	18.14'
& RR RAIL FCP	E	19.4'
1/2" x 24" REBAR W/CAP 9.8' TO E/P	SW	30.33'
& OF A CUT IN ASPH	S	5.4'

HARRISON

60



5/10/18

JRM

CENTER OF SECTION
SECTION 11-32-4
HARRISON TWP PT 48

FIELD

FIELD

12.4'

GRAVEL LANE

CR 950 W
21' ASPH PAV

FD TWO 1 1/2" PK NAILS
ONE ABOVE THE OTHER

REPLACED WITH MAG
NAIL W/TAG

DESCRIPTION

BEARING DISTANCE

E 2" DIA STEEL FCP BESIDE WOOD POST	E	19.65'
FD MAG NAIL (NO TAG) 2" DEEP	N	32.83'

HARRISON

61

5/10/18
JRM

W 1/4 CORNER
SECTION 18-32-5
HARRISON TWP PT 76



x x

PASTURE

x

x

x

CR 800 W

x

x

FIELD

x

FD 2" PK NAIL
FLUSH


x

x

DESCRIPTION	BEARING	DISTANCE
SE CORNER 6 1/2" x 10" BRIDGE BEAM POST	NW	43.25'
FACE / BASE 6" DIA STEEL CONC FILLED POST	NE	56.4'
NAIL IN B. CAP IN ANCHOR POLE	ESE	59.66'
NAIL IN B. CAP IN POWER POLE	SSE	60.85'

LAKE

62

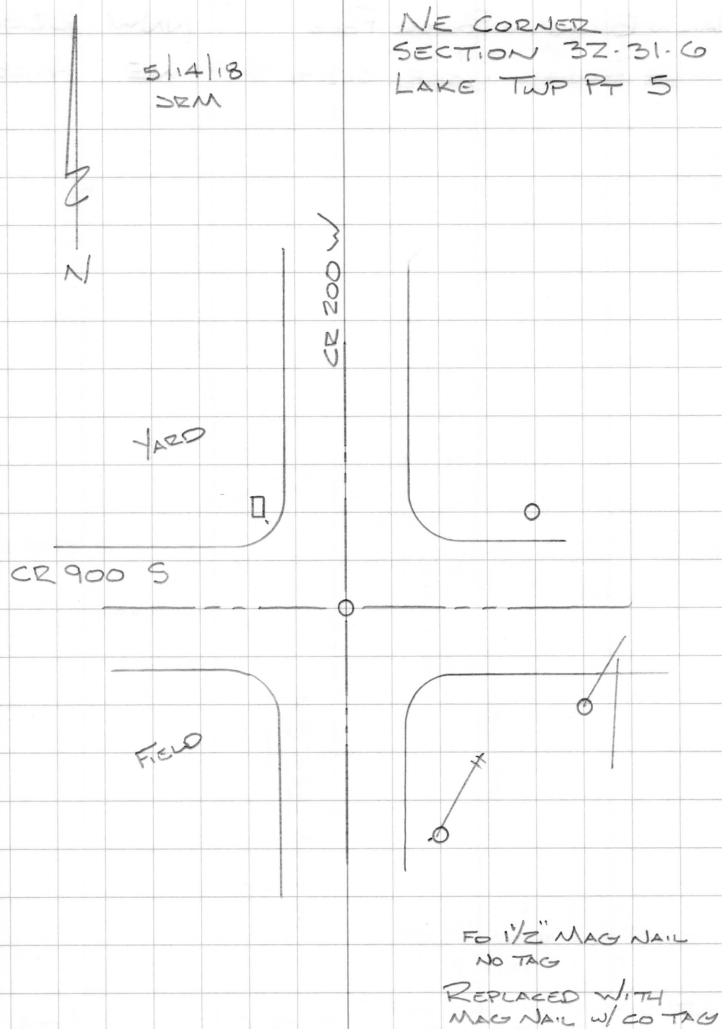


LAKE

DESCRIPTION	BEARING	DISTANCE
NAIL IN B CAP IN POWER POLE	NNW	62.06'
1/2" x 24" REBAR W/CAP 63' TO E/P	NE	41.00'

5/14/18
SRM

E 1/4 CORNER
SECTION 3-30-6
LAKE TWP PT 44

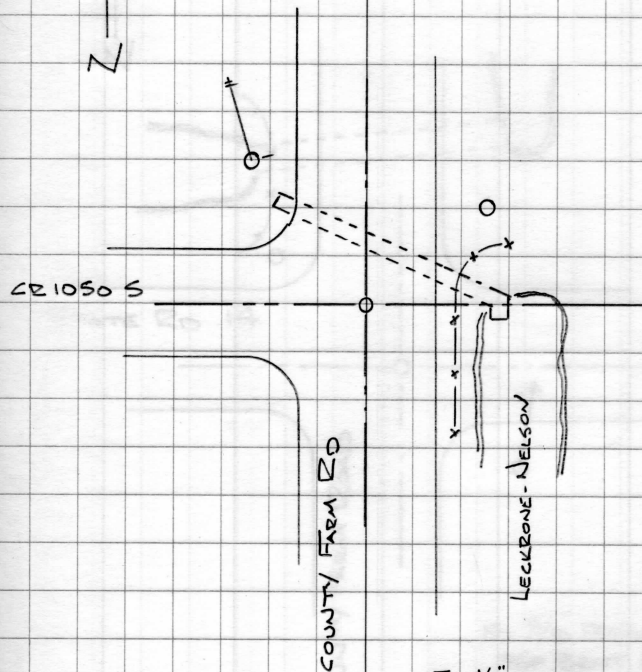


FD 1/2" CARRIAGE BOLT
5" DEEP

SET MAG NAIL W/CO TAG
OVER TOP

OLD SURVEY FIELD BOOK 8 P. 9 CB 9/6/1973

DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR w/CAP	NW	39.30'
NAIL IN B. CAP IN POWER POLE	SE	35.98'
PHYSICAL & INTERSECTION	2.3' W & 1.5' N	

64

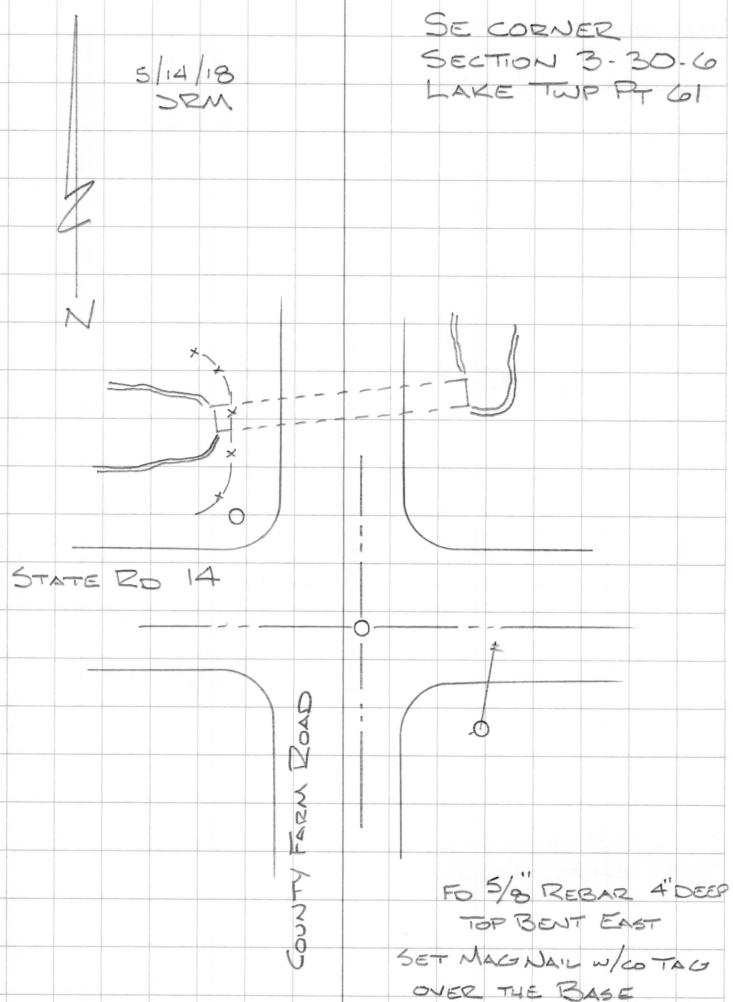

WAYNE

65

5/15/18

DEM

2

N

CENTER OF SECTION
SECTION 24-32-6
WAYNE TWP PT 114

YARD

FIELD


RAILROAD RAIL
FENCE CORNER POST

"WALKER" SURVEY 7/16/2001 DOC # 2001121251

DESCRIPTION	BEARING	DISTANCE
15" CHERRY TREE	NW	4.2'
WIRE FENCE W/ELECTRIC WIRE	W	3.6'

5/10/18
DEM

CENTER OF SECTION
SECTION 19-32-7
WASHINGTON TWP. PT 103

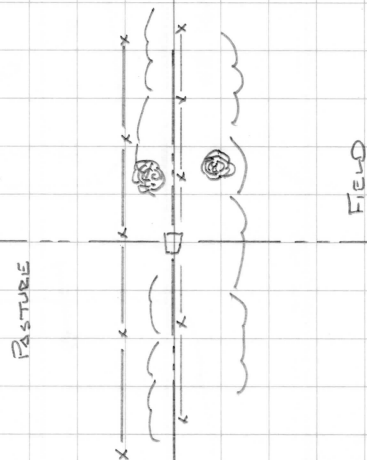


FD PEAKED STONE
12" ABOVE GROUND
IN OLD WIRE FENCE ROW

SURVEY RECORD BOOK 2 (COPY) Pg 174 "STONE" 12/30/1859

"WALKER" SURVEY NOV 4 1999 DOC # 2000-03-0174

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP NIPSCO POLE 1070/715	WNW	68.08'
SE CORNER 4" SQ STEEL FENCE POST	NW	33.78'
MAG NAIL W/ CO TAG	E	36.42'
FD NAIL IN B. CAP NIPSCO POLE $\frac{626}{078}$	SW	27.97'

PLAIN

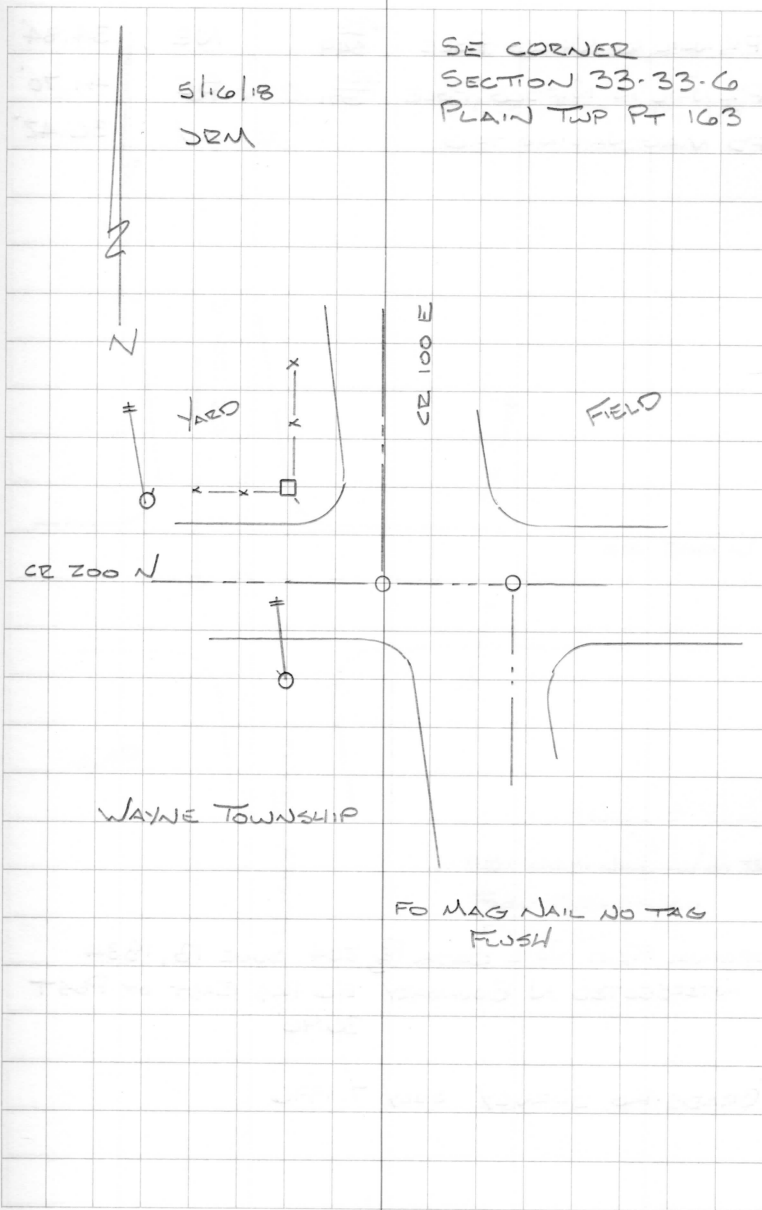


DESCRIPTION		BEARING	DISTANCE
PK NAIL IN NIPSCO POLE	$\frac{636}{549}$	NE	34.84'
PK NAIL IN NIPSCO POLE	$\frac{626}{571}$	SE	41.70'
FD MAG NAIL NO TAG		W	36.42'

ORIGINAL FIELD NOTE BOOK Pg 204 JUNE 18, 1834
 INTERSECTED N BOUNDARY 561KS EAST OF POST
 36.96'

"BRADS-KO SURVEY JULY 7, 1996

WAYNE

68

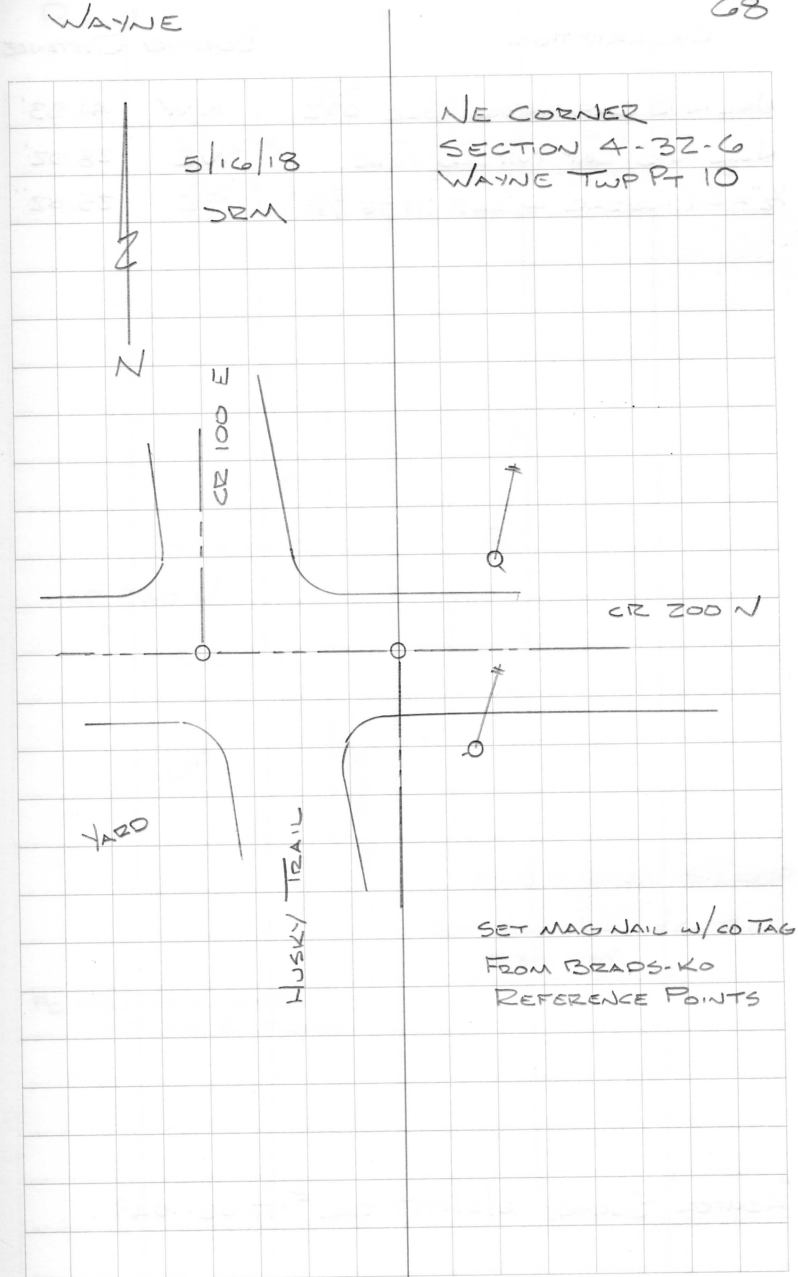


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP NIPSCO POLE ⁶²⁶ 69Z	NW	41.83'
NAIL IN B. CAP NIPSCO POLE	NE	28.02'
1/2" x 24" REBAR W/CAP 11 TO E/P	SE	25.02'

"KEMPER" SURVEY 6/2/1997 DOC # 97-06-1049

PLAIN

69

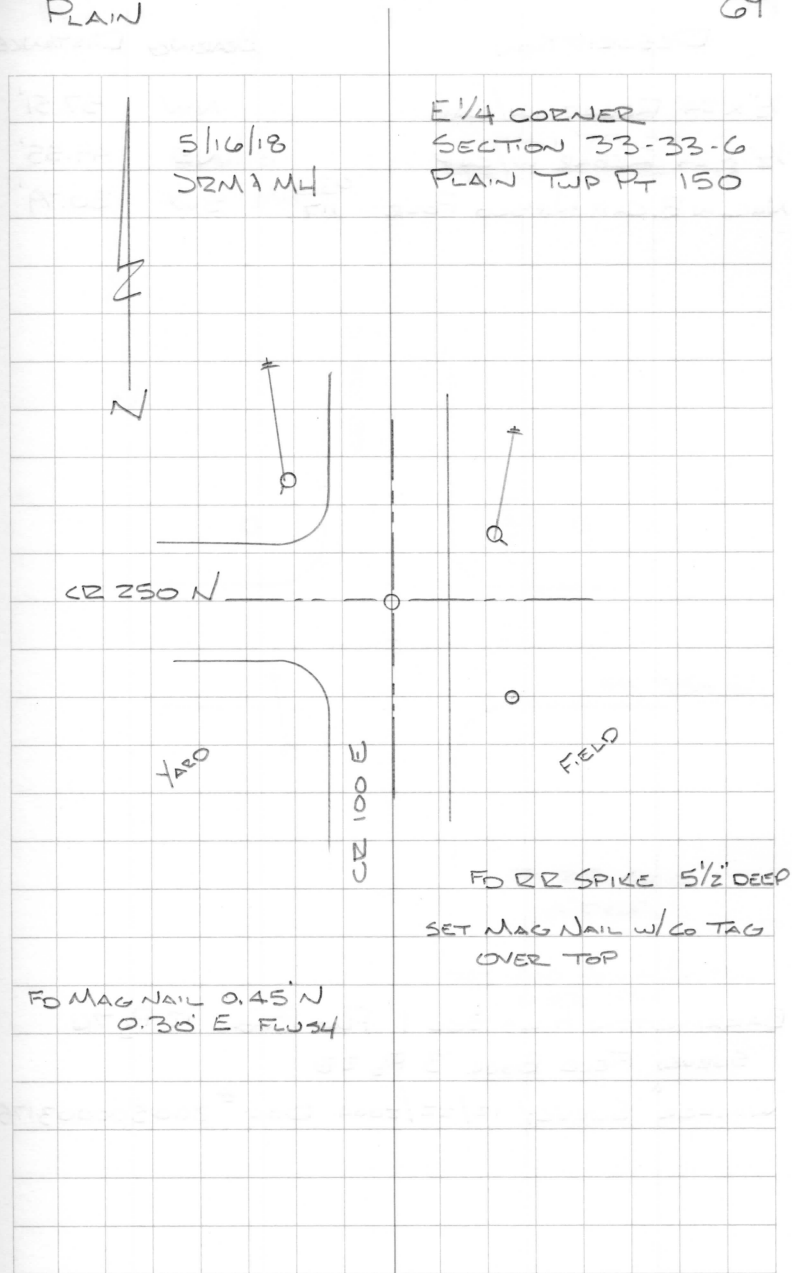

DESCRIPTION		BEARING	DISTANCE
1/2" x 24" REBAR w/CAP		NW	57.51'
1/2" x 24" REBAR w/CAP		NE	49.55'
NAIL IN B. CAP NIPSCO POLE	0.26 117	SW	30.79'


BARRINGTON HILLS SEC 1 PLAT BOOK 12 P. 76

SURVEY FIELD BOOK 3 P. 28

"WALKER" SURVEY 12/22/2004 DOC # 200500003175

PLAIN

70

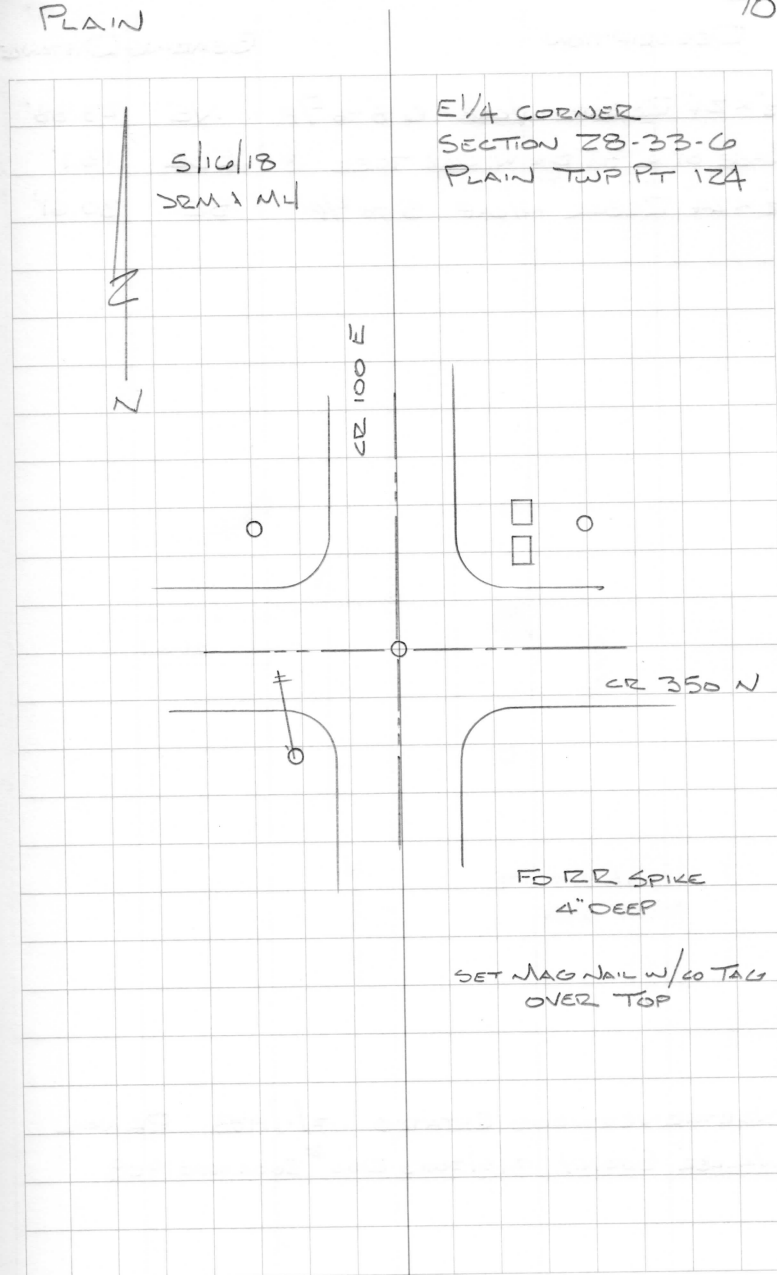

DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR W/CAP 6.8 TO E/P	NE	23.88'
BASE OF A 32" DIA W. OAK TREE	ESE	18.1'
1/2" x 24" REBAR W/CAP 5 TO E/P	SE	30.61'


PLAIN

71



5/16/18
DEM & MH

NE CORNER
SECTION 28-33-6
PLAIN TWP PT III

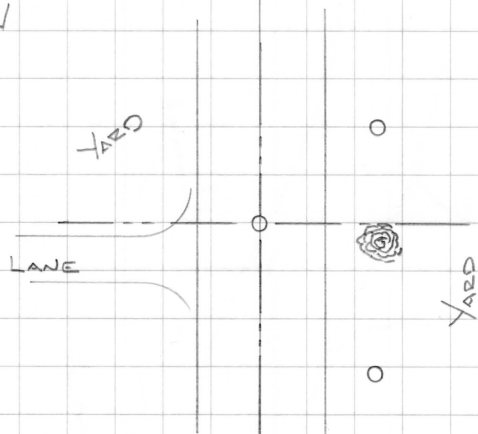

FO PK NAIL
4 1/2" DEEP

NORTHERWOOD ESTATES 2/1/1988 PK NAIL
"WALKER" SURVEY 12/5/2003 DOC # 2004 00001909


DESCRIPTION		BEARING	DISTANCE
NAIL IN B. CAP IN NIPSCO POLE	783/481	SSW	52.30'
NAIL IN B. CAP IN NIPSCO POLE	783/482	NW	19.87'
FO 4" DIA ALUMINUM DISK 3" DEEP		E	25.15'

SEE SECTION CORNER FIELD BOOK 1 Pg 70
ORIGINAL FIELD NOTES BOOK Pg 476 JCG 25.08'

ORIGINAL FIELD NOTES BOOK Pg 476 206 25.08'

ETNA

72



NW CORNER
SECTION 3-33-4
ETNA TWP PT 1

SECTION 3-33-4

ETNA TWP PT 1

MARSHALL COUNTY

300123

CD 800 N
GRAVEL

TRAVEL

FO HARRISON
MONUMENT
FLUSH

MONUMENT

Fluss


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP POWER POLE	SSE	67.47'
NAIL IN B. CAP POWER POLE	ESE	91.92'

ETNA

73

S/22/18
DEM


CENTER OF SECTION
SECTION 10-33-4
ETNA TWP PT 27

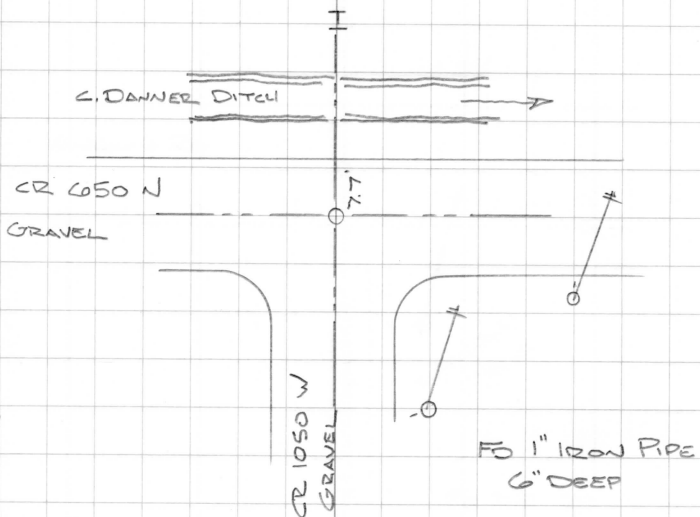

DESCRIPTION	BEARING	DISTANCE
1/2 RR RAIL FCP	S	23.0'
1/2 3" DIA STEEL FCP	N	21.2'
NAIL IN B. CAP IN POWER POLE	SSE	27.35'

ETNA

74

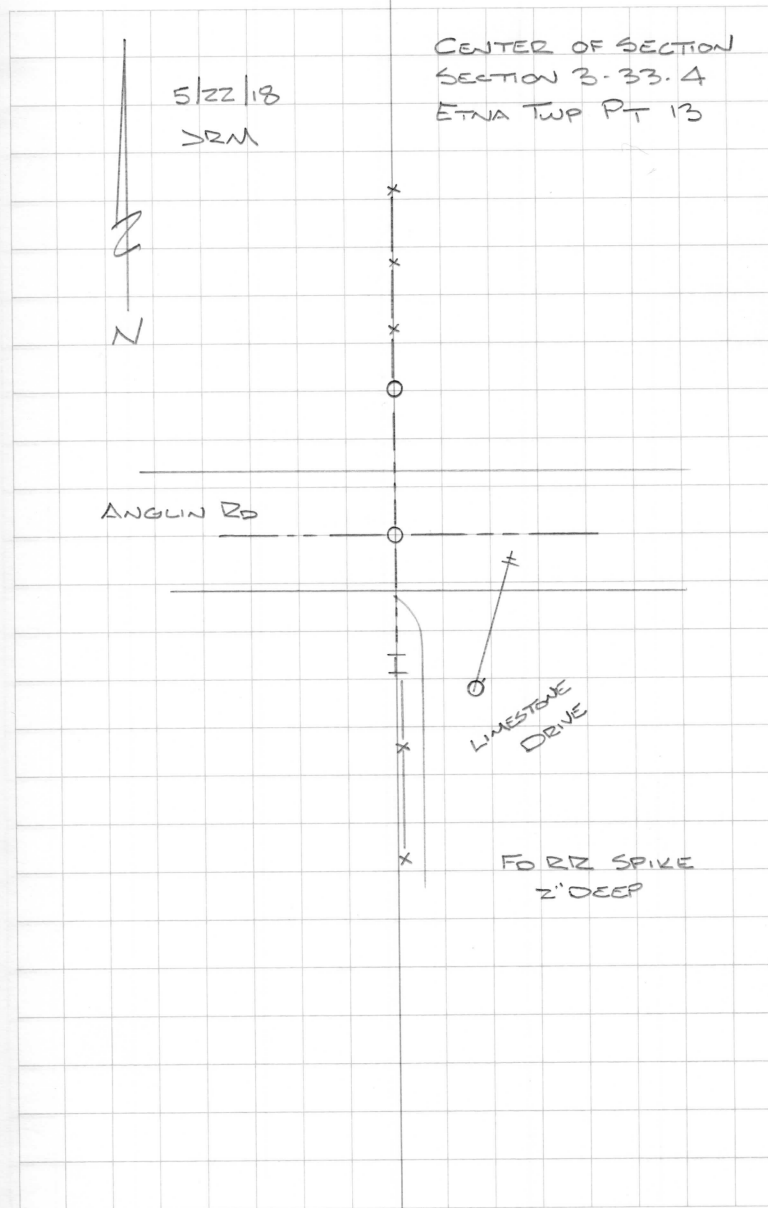

DESCRIPTION

BEARING DISTANCE

1/2" x 24" REBAR W/CAP	NE	41.59'
1/2" x 24" REBAR W/CAP	SE	52.97'
NAIL IN B. CAP NIPSCO P. Pole 626/104	SW	40.53'

"WALKER" SURVEY	12/22/2004	Doc #	200500003175
"KIMPEL" SURVEY	7/6/2009	Doc #	2009090894
"HUFFMAN" SURVEY	4/18/2012	Doc #	2012071043

PLAIN 269

75

N

6/4/18
DEMSE CORNER
SECTION 28-33-6
PLAIN TWP PT 137

CR 100E

CR 300 N

O 5.5

O 1.2

FO 1" MAG NAIL NO TAG
NO READING UNDERREPLACED WITH MAG
NAIL W/ CO TAG

DESCRIPTION


BEARING DISTANCE

FD 1/2" CAPPED IRON "WALKER"
 NAIL IN B. CAP IN POWER POLE

W 20.0'
 NNW 93.86'

HARRISON 107

76

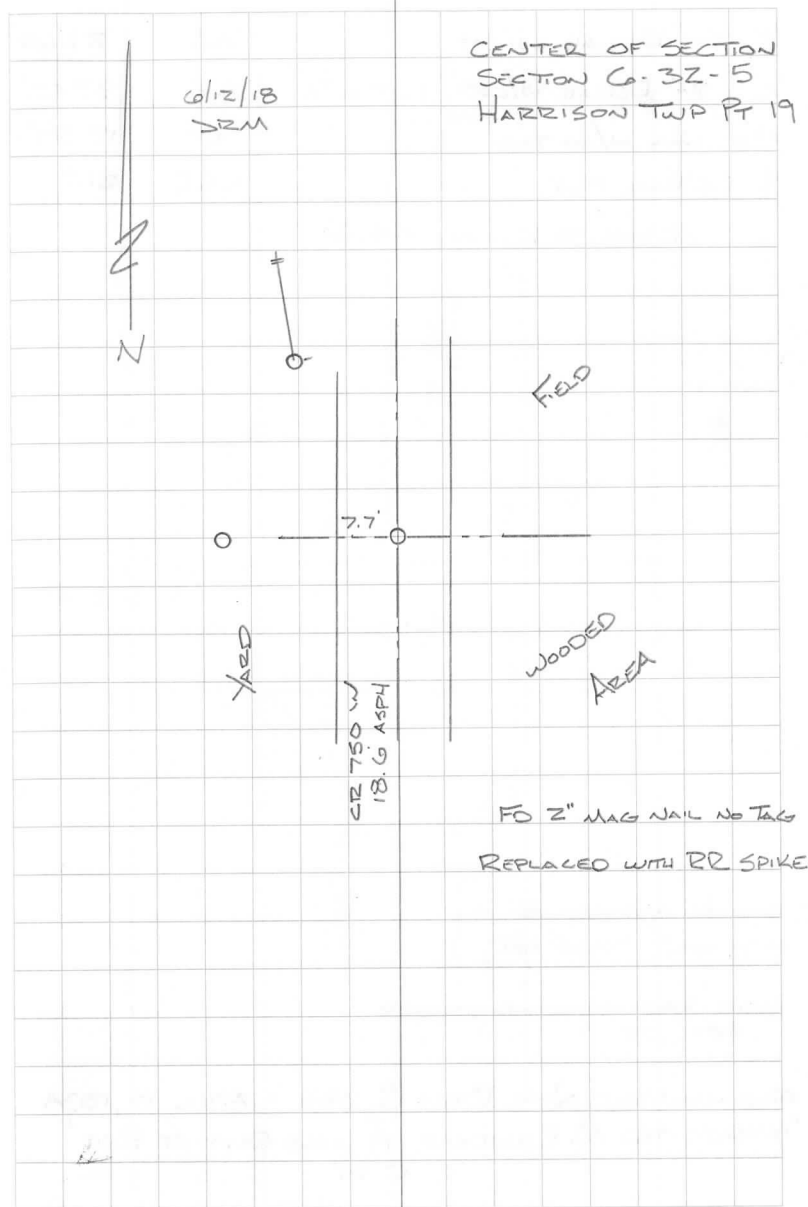

DESCRIPTION


BEARING DISTANCE

1/2" x 24" REBAR W/CAP	NW	29.60'
1/2" x 24" REBAR W/CAP 16.2' TO E/P	NE	37.52'
MASS NAIL W/CO TAG	E	12.54'
1/2" REBAR FCP	SSE	21.2'
REBAR TO REBAR		44.12'

ORIGINAL FIELD NOTE BOOK Pg 384 - APRIL 17, 1834
 "INTERSECTED N. BOUNDARY 19 LINKS EAST OF POST"
 12.54'

SCOTT 334-

77

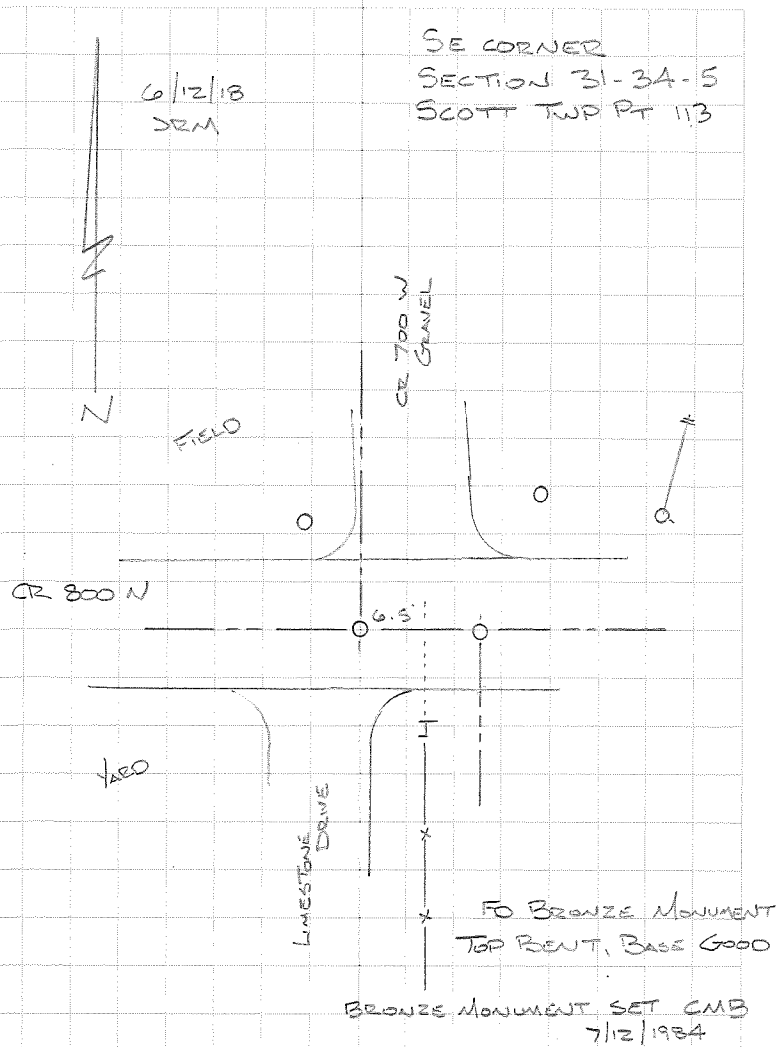

DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR W/CAP	NW	38.28'
1/2" x 24" REBAR W/CAP	NE	29.34'
REBAR TO REBAR		44.12'
NAIL IN B. CAP NIPSCO POWER POLE ⁶³⁶ / ₇₅₂	ENE	49.99'
⊥ RR RAIL FCP	SSW	21.1'
BRONZE MONUMENT	W	12.54'

ORIGINAL FIELD NOTE BOOK P 384 - APRIL 17, 1834
 "INTERSECTED N. BOUNDARY 19 LINKS EAST OF POST"

PRAIRIE 282

78

