


DESCRIPTION	BEARING	DISTANCE
± RR RAIL FCP	N	16.77'
½" x 24" REBAR w/CAP 7.5' TO E/P	SE	30.85'
± RR RAIL FCP	S	16.75'

"VONORA" SURVEY APRIL 11 1997 #97.05-0835

ETNA 32

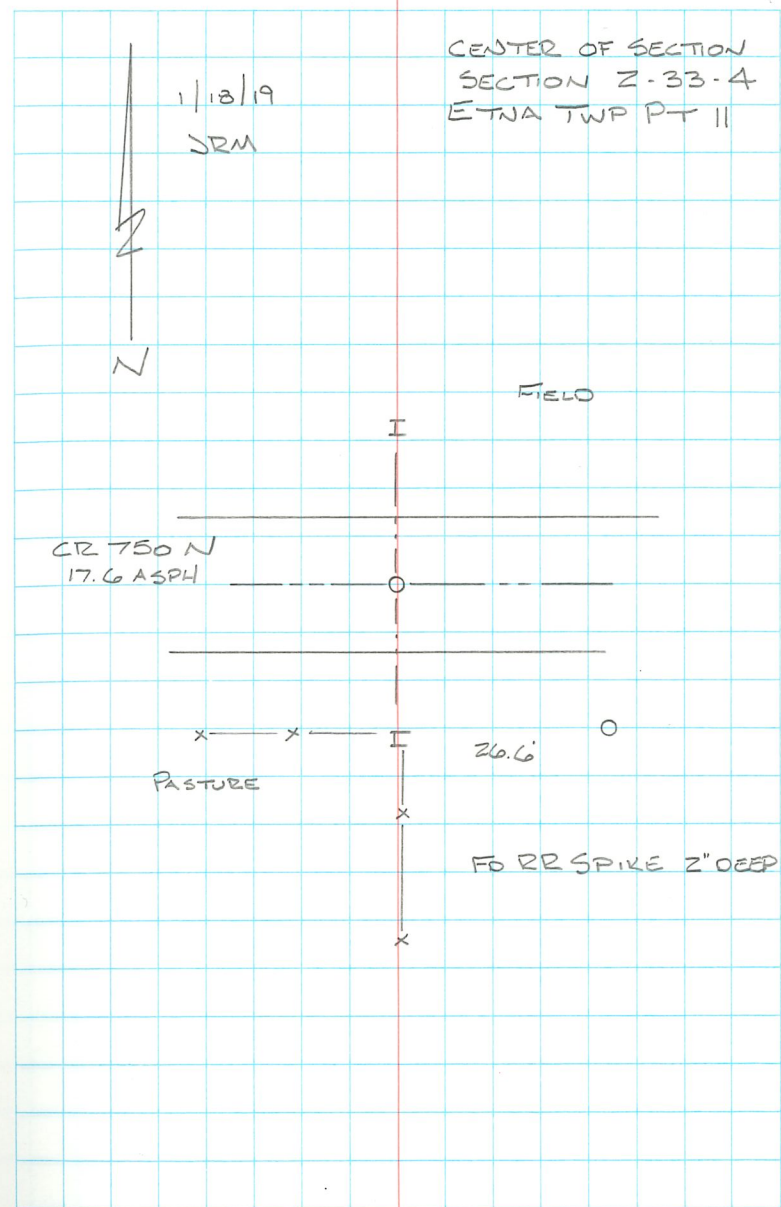


DESCRIPTION	BEARING	DISTANCE
FD STONE	NNE	10.5'

ORIGINAL FIELD NOTE BOOK Pg 337 SET POST 1834
 SURVEY RECORD BOOK 4 Pg 6 FEB 1886 - B. OAK STAKE
 UNDER STONE SURROUNDED BY SMALLER STONES
 WITNESS STONE N4°E 16 1/2 LINKS (10.89)

HARRISON 132

2

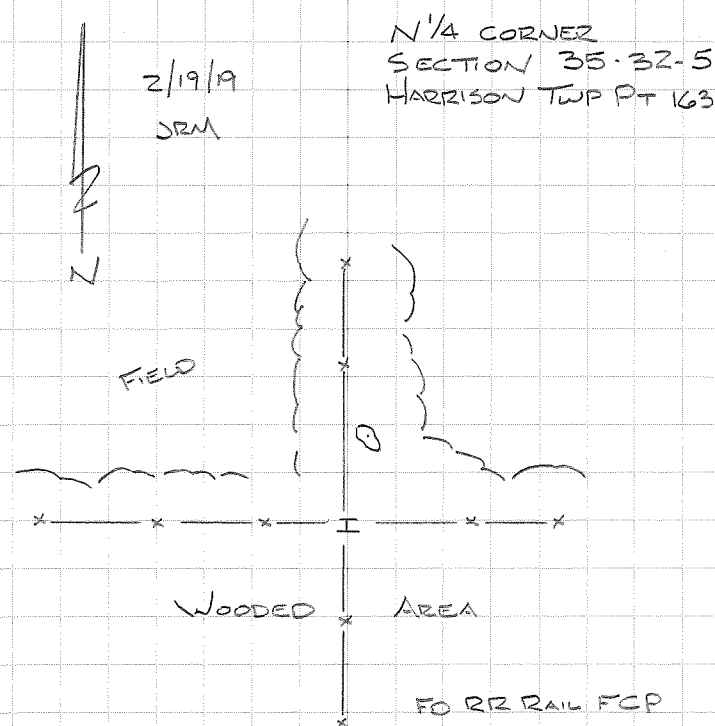


DESCRIPTION	BEARING	DISTANCE
⊥ RR RAIL FCP	N	20.5'
1/2" x 24" REBAR W/CAP	NE	41.80'

"BOWER" SURVEY MAY 5 1972 SURVEY FIELD BOOK 5 Pg 44
 SURVEY RECORD BOOK 2 (COPY) Pg 291 NOV 27, 1967

FRANKLIN 56

3

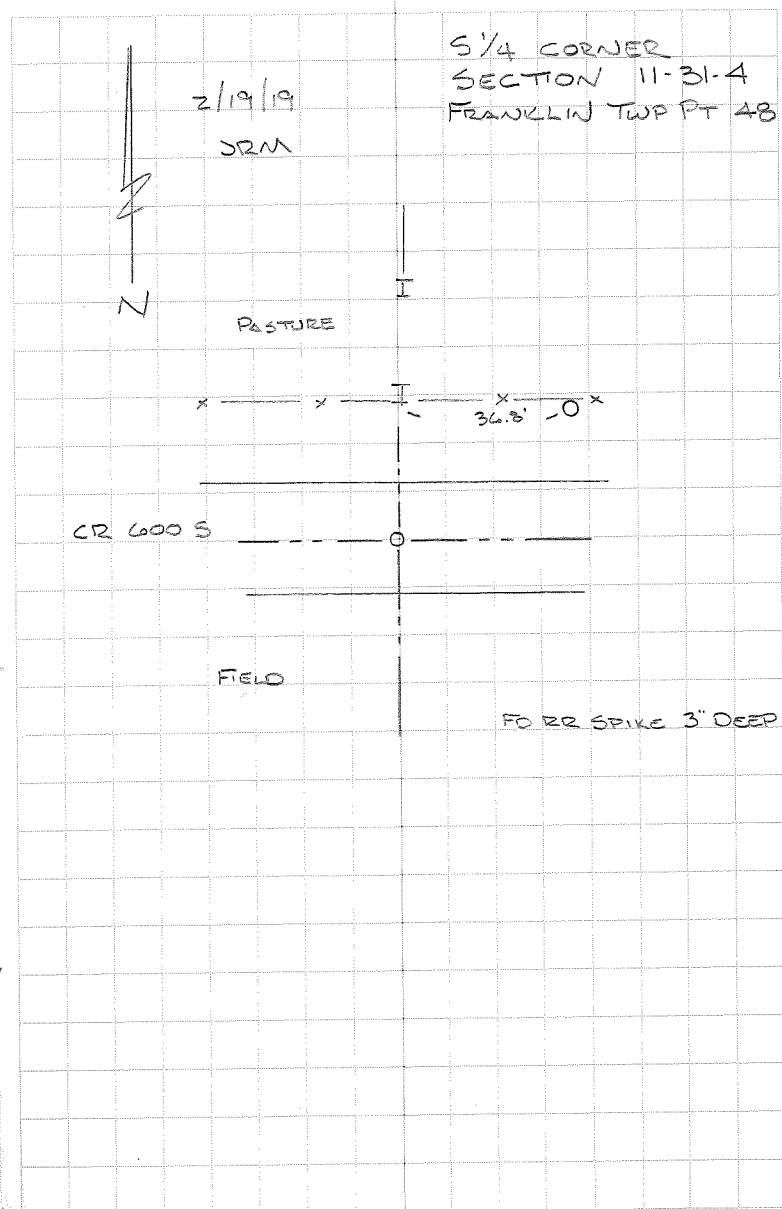

DESCRIPTION

BEARING DISTANCE

1/2" x 24" REBAR W/CAP	S. 3' TO E/P	NW	25.52'
E. FACE CONC FCP		W	16.35'
1/2" x 24" REBAR W/CAP	6.4' TO E/P	SW	28.31'

"WEISS" SURVEY JULY 14 1995 # 96-01-0671


FRANKLIN 55

4

2/19/19

JRM

W 1/4 CORNER
SECTION 10-31-4
FRANKLIN TWP PT 44

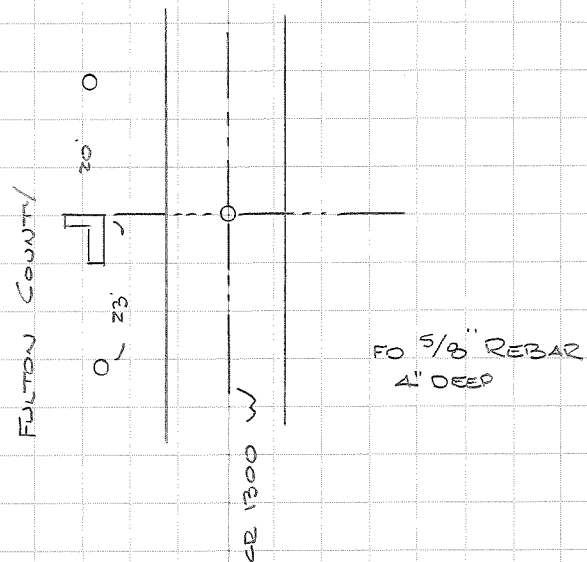


DESCRIPTION

BEARING DISTANCE

FD 1/2" x 18" IRON PIPE

ENE 31.99'

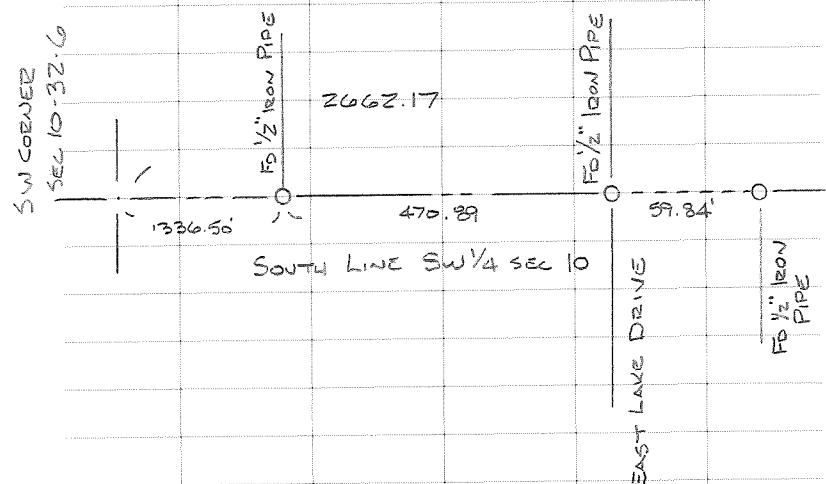

ORIGINAL FIELD NOTE BOOK Pg 203 JUNE 1834

"SET QUARTER POST @ 40.37 1/2" 2664.75'


"WARD" SURVEY/ MAY 26 2011 #2013060173

"KEMPER" SURVEY/ JULY 7 1992

"KIMBEL" SURVEY/ MARCH 13 1997 #97-03-0739

WAYNE 532

6

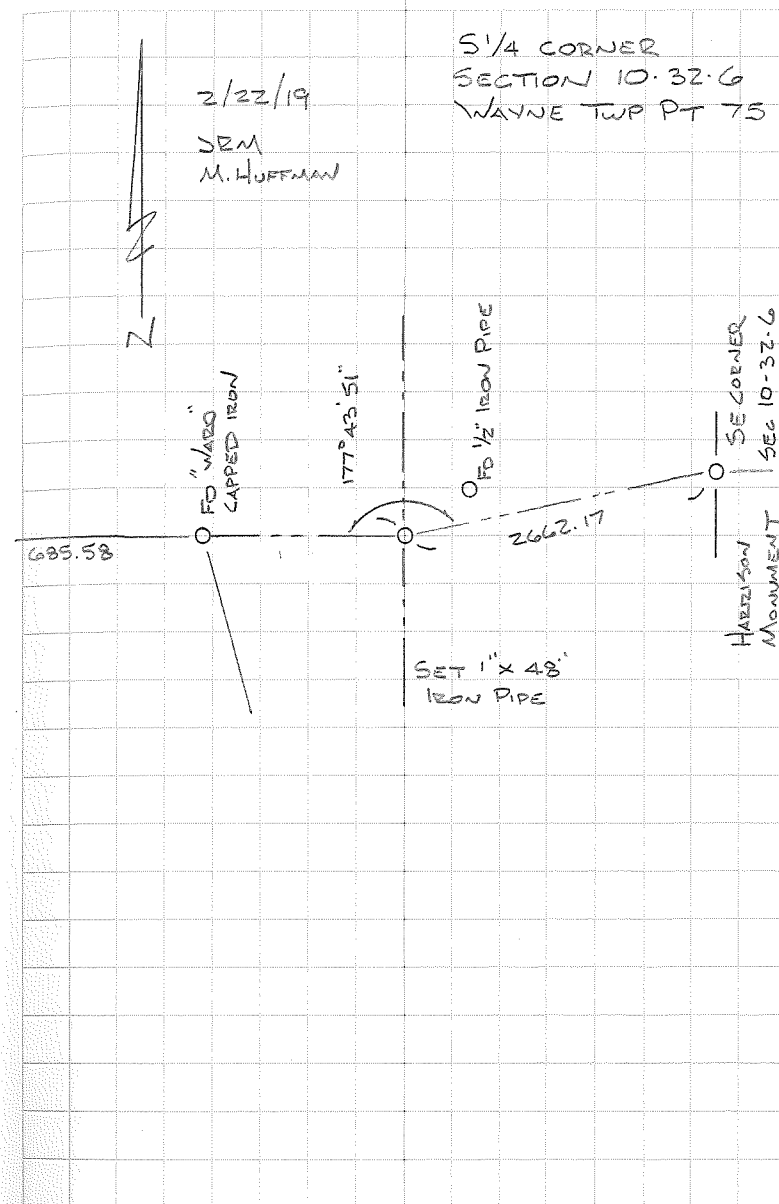

DESCRIPTION

BEARING DISTANCE


FRANKLIN 83

7

DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR W/CAP 9.8' TO E/P	S	20.15'
	SE	27.63

SW CORNER

SURVEY FIELD BOOK 8 Pg 13 CB 1973

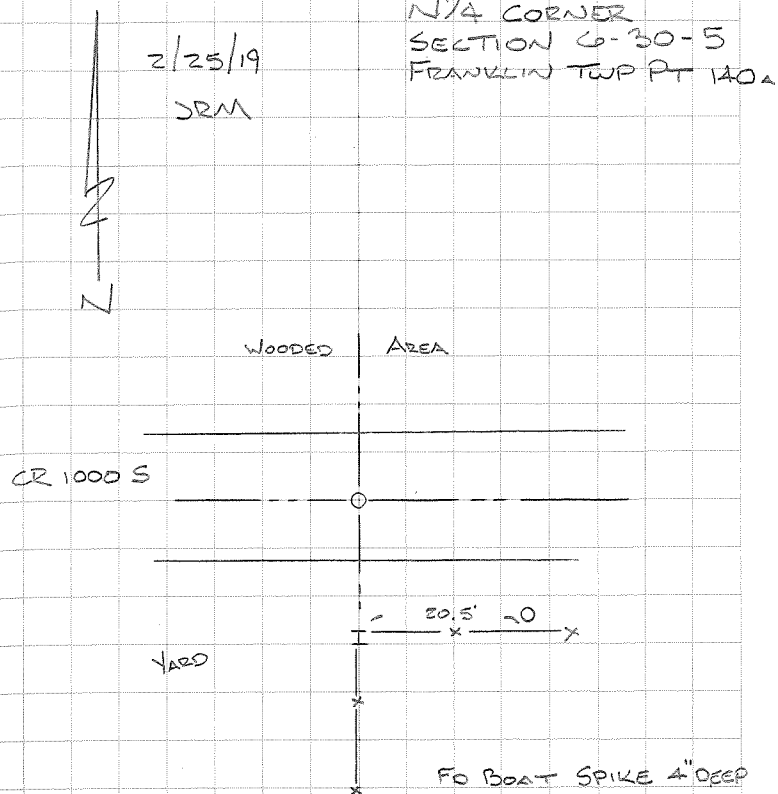


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP POWER POLE	WSW	46.83'
N FACE AT BASE 8" SQ CONC FCP	S	19.88'
IRON PIN AT INTERSECTION	W	200.2'

ORIGINAL FIELD NOTE BOOK Pg 298 JULY 7 1834
 SURVEY FIELD BOOK G Pg 46 1971
 DEED # 2009080365
 DEED RECORD 283 Pg 329


FRANKLIN 83

8



2/25/19
 SRM

NE CORNER
 SECTION 6-30-5
 FRANKLIN TWP PT 141A

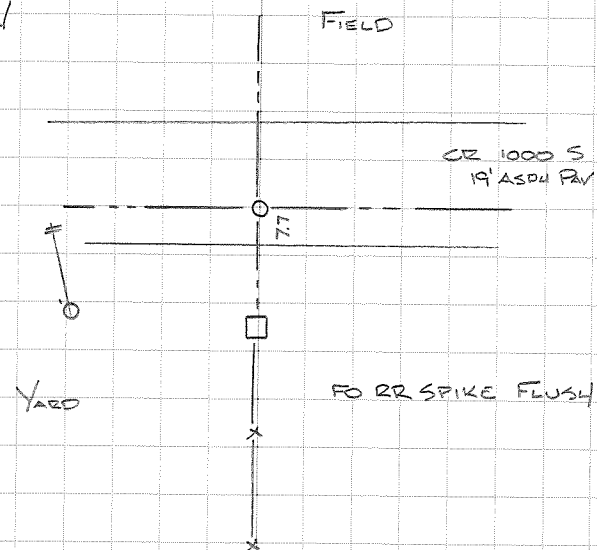



DESCRIPTION	BEARING	DISTANCE
⊥ RR RAIL FCP	W	31.34'
NAIL IN B. CAP TELEPHONE POLE	WNW	28.55'
⊥ 4" DIA STEEL AXLE	E	30.17'
NAIL IN B. CAP NIPSCO POLE 621/572	ESE	29.06'

"BUNNELL" SURVEY MARCH 9 2018 # 2018080633

WAYNE 552

9

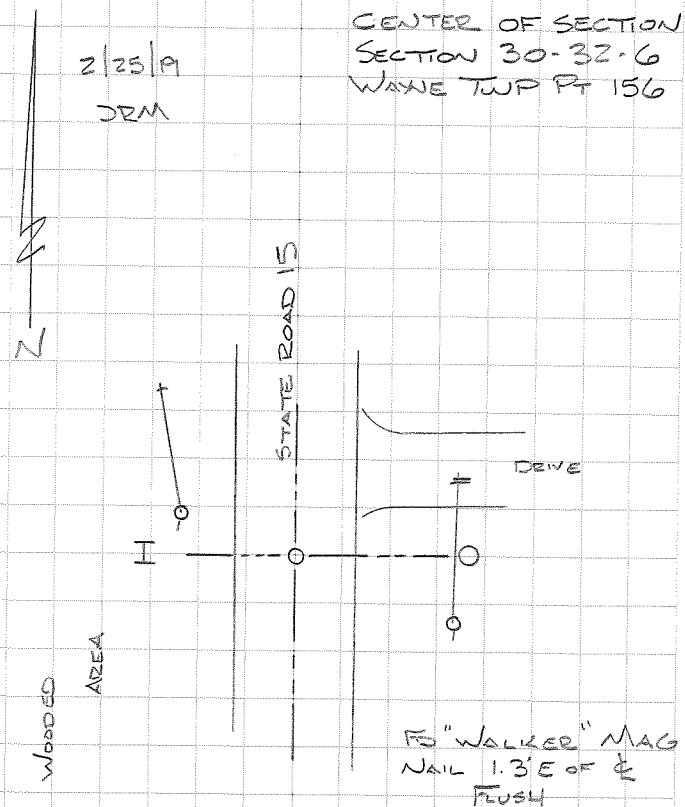

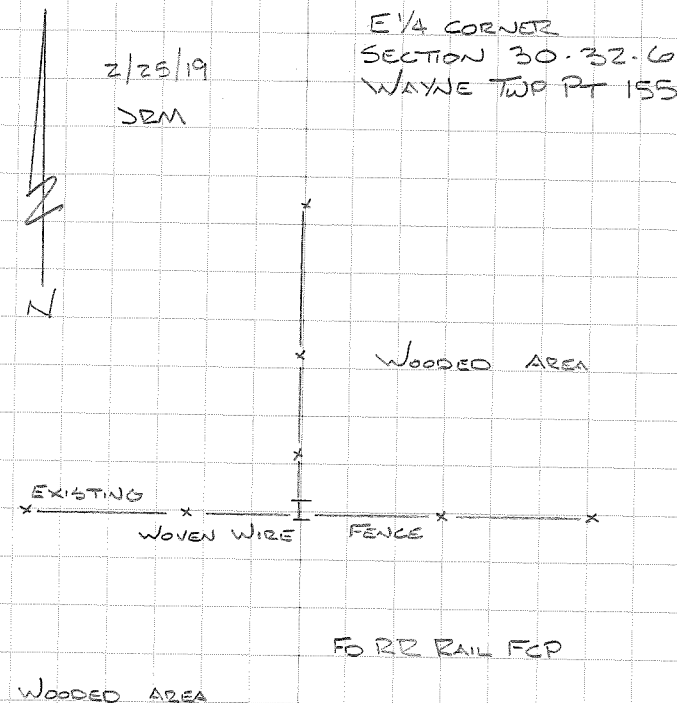

DEED # 2010110535 KIPKER

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP TEL POLE	WNW	49.74'
FO 1/2" REBAR W/CAP 3" DEEP	NW	27.78'
FO 1/2" REBAR W/CAP 5' TO E/P	SE	24.55'
NAIL IN B. CAP POWER POLE	WSW	52.49'
EAST END CONC BRIDGE DECK	W	93.1'


JUNE 2001 MEK FO RR SPIKE & WITNESSED

FRANKLIN 74

11

2/27/19
JRM

SE CORNER
SECTION 17-31-5
FRANKLIN TWP RT 77

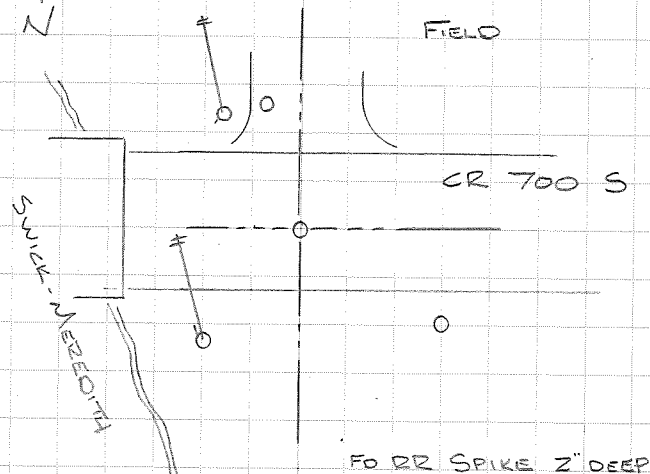

DESCRIPTION


BEARING DISTANCE

NAIL IN B. CAP POWER POLE	ESE	80.07'
1/2" x 24" REBAR W/CAP 8.2' TO E/P	NE	28.65'
¢ RR RAIL FCP	S	23.36'

SECTION CORNER FIELD BOOK 2 Pg 63 1992
 SURVEY FIELD BOOK 10 Pg 35 1975

FRANKLIN 81

12

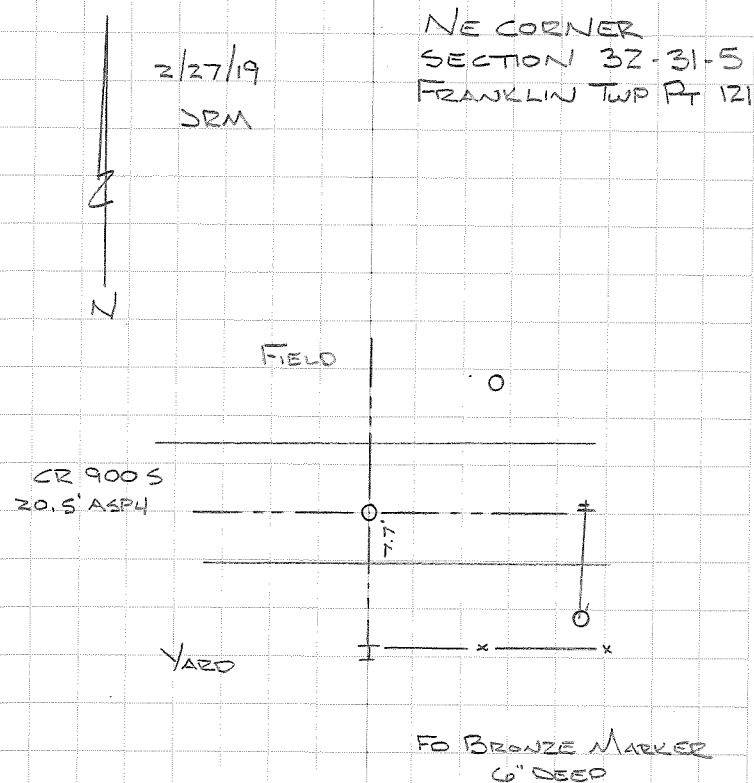


DESCRIPTION

BEARING DISTANCE

NAIL IN B. CAP POWER POLE	WNW	43.97'
NAIL IN B. CAP POWER POLE	NNW	72.68'
IRON PIN (FULTON CO CORNER)	E	23.15'

FRANKLIN 67

13

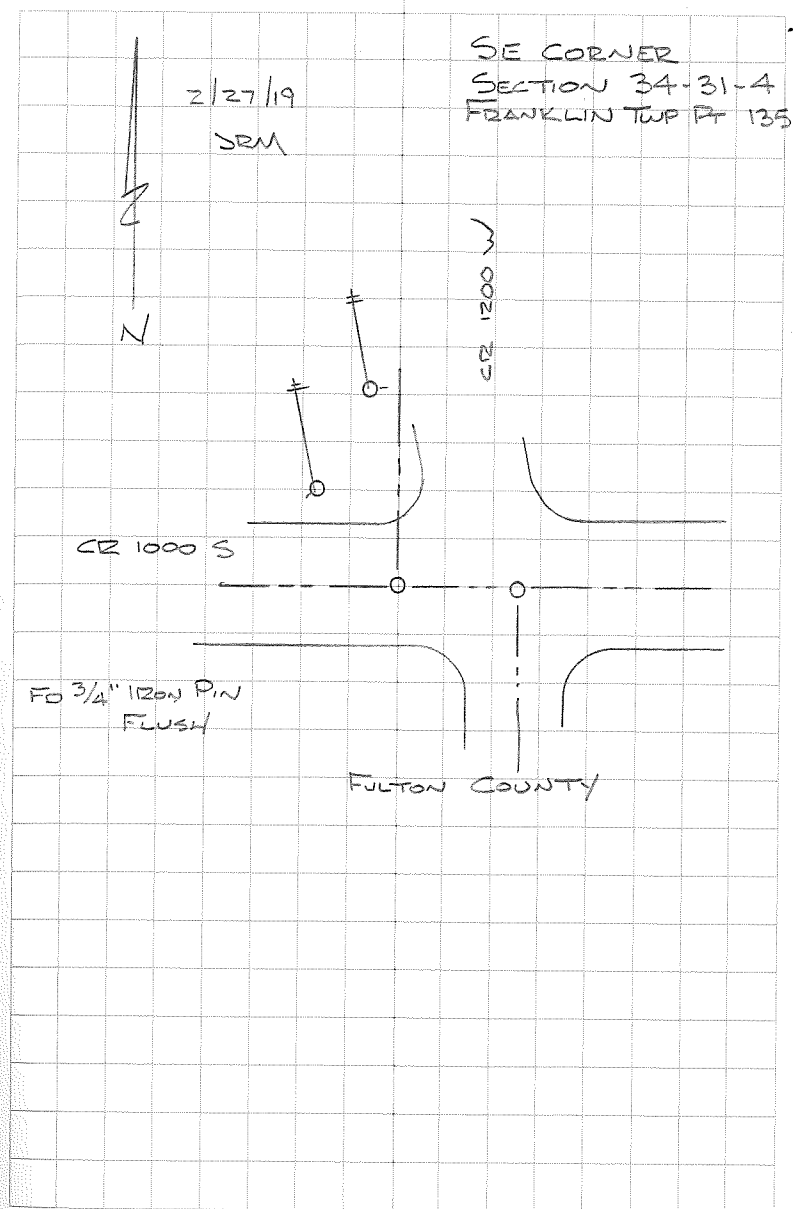

DESCRIPTION


BEARING DISTANCE

FO MAG NAIL IN POWER POLE	WNW	92.6'
1/2" x 24" REBAR W/CAP 12.6' TO E/P	ENE	47.02'
1/2" x 24" REBAR W/CAP 10.2' TO E/P	ESE	45.53'
3/4" REBAR (FULTON COUNTY CORNER)	E	10.15'

QUIT CLAIM # 2018020394

FRANKLIN 67

14

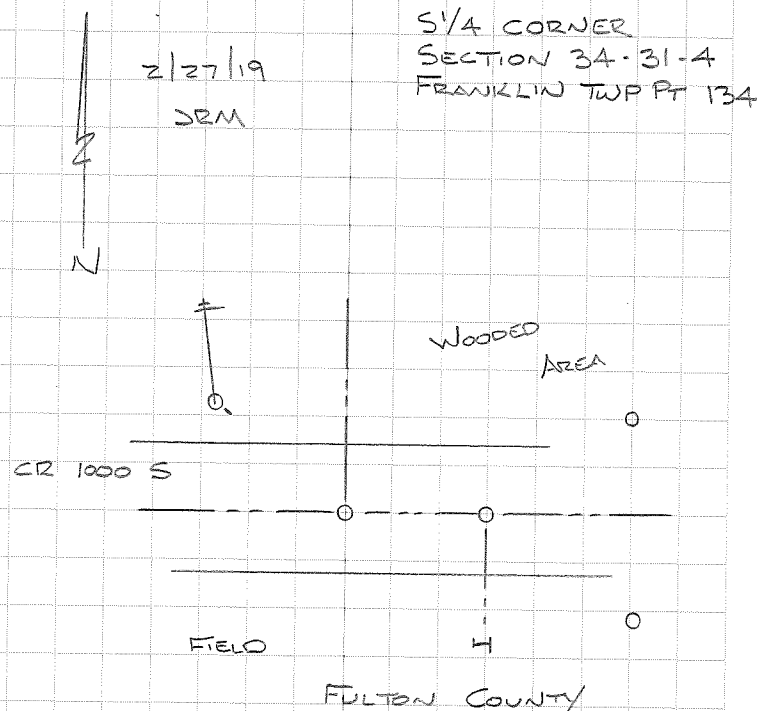

FO RR SPIKE 3" DEEP

DESCRIPTION	BEARING	DISTANCE
FO PK NAIL IN FENCE POST	W	21.50'
FO "KIMPEL" CAPPED IRON	W	19.90'
NAIL IN B. CAP IN POWER POLE	ENE	16.66'
± RR RAIL FCP LEANING EAST	E	16.85'

DEED RECORD # 2013040250

"WEISS" SURVEY MAY 18 2001 # 2001070246

"KIMPEL" SURVEY DEC 11 2013 # 2014010543


FRANKLIN 86

15



2/27/19
SRM

SE CORNER
SECTION 17-30-5
FRANKLIN TWP PT 173

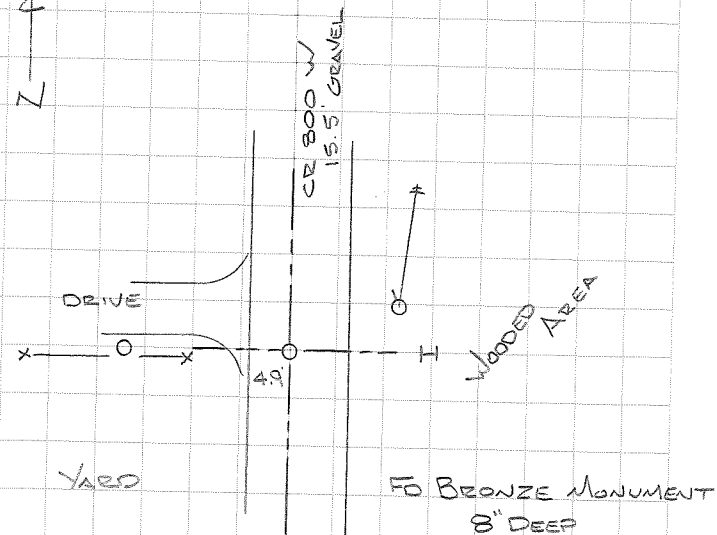

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP POWER POLE	SSW	45.27'
1/2" x 24" REBAR W/CAP	NE	29.54'
NAIL IN B. CAP POWER POLE	ENE	52.10'


"WEISS" SURVEY APRIL 20 1998 #98-06-0360

FRANKLIN 60

16

2/27/19
JRM

SW CORNER
SECTION 15-31-4
FRANKLIN TWP PT 67

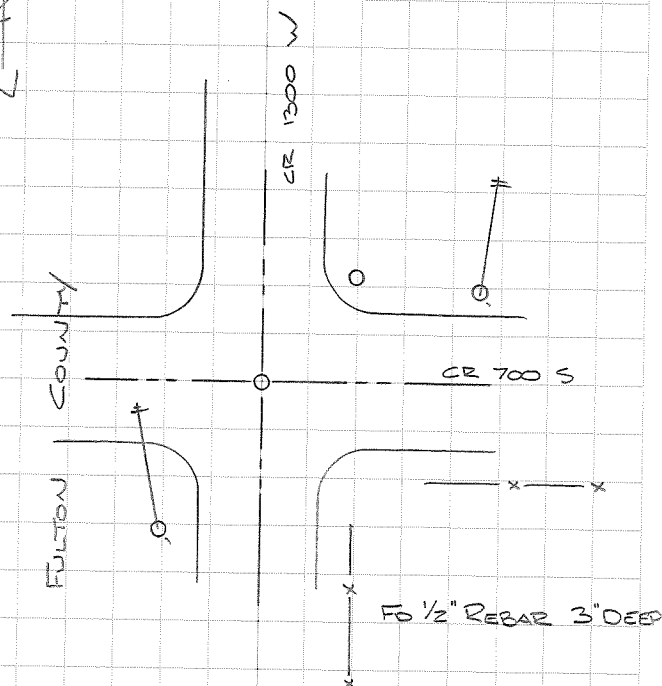


DESCRIPTION	BEARING	DISTANCE
SE CORNER RR RAIL FENCE POST	NW	26.76'
⊕ RR RAIL FCP	N	16.9'
1/2" x 24" REBAR w/cap 11" to E/p	SE	23.66'


"MICHEL" SURVEY AUGUST 11 2006 #200600012838
 SURVEY RECORD BOOK 4 Pg 250 MARCH 20 1912

FRANKLIN 60

17

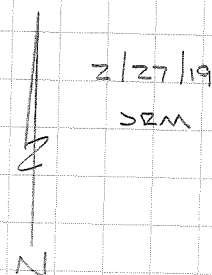

5 1/4 CORNER
 SECTION 15-31-4
 FRANKLIN TWP PT 68

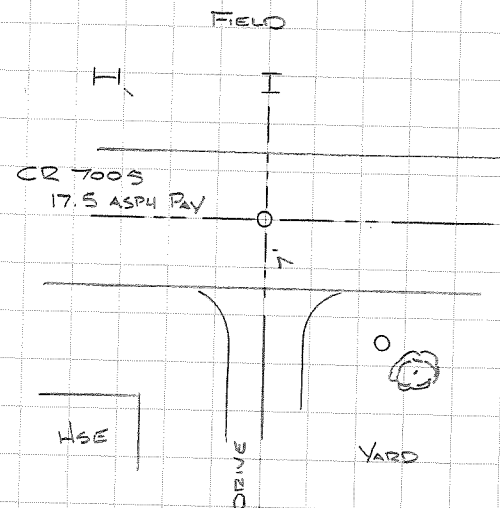

FO 1" PK NAIL 3" DEEP
 REPLACED WITH RR SPIKE

DESCRIPTION


BEARING DISTANCE

NAIL IN B CAP REMC POLE 4688	WNW	58.77'
1/2" x 24" REBAR W/CAP IN FENCE	SW	26.28'

"MICHEL" SURVEY AUGUST 11 2006 #200600012838
 SURVEY RECORD BOOK 4 P. 250 MARCH 20 1912

FRANKLIN CO

18

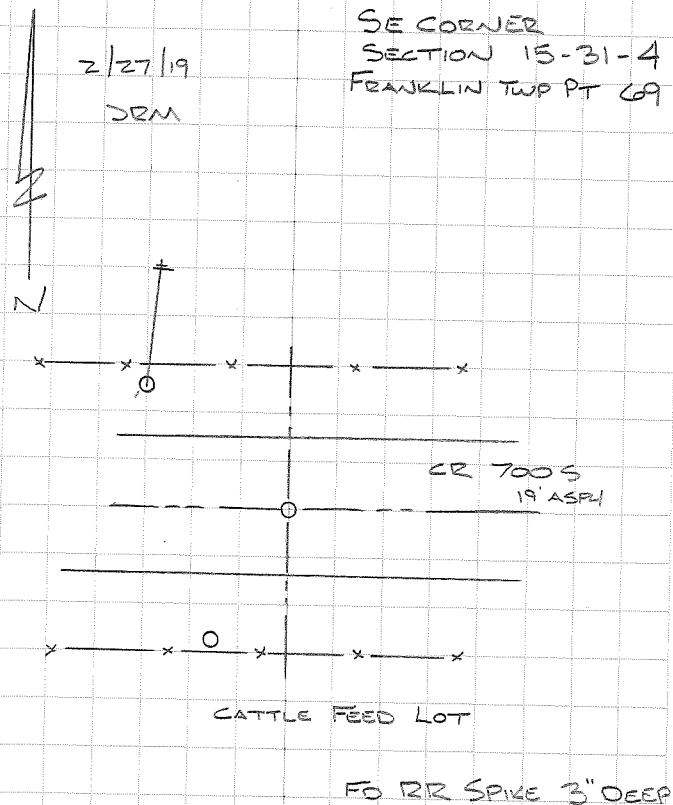

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP POWER POLE	WSW	65.94'
1/2 RAIL FCP	S	20.55'
1/2" x 24" REBAR W/CAP 11' to E/P	SE	27.60'

"WARD" SURVEY AUGUST 25 1997 # 99-02-0635


HARRISON 121

19



2/28/19
JRM


N 1/4 CORNER
SECTION 22-32-5
HARRISON TWP RT 96

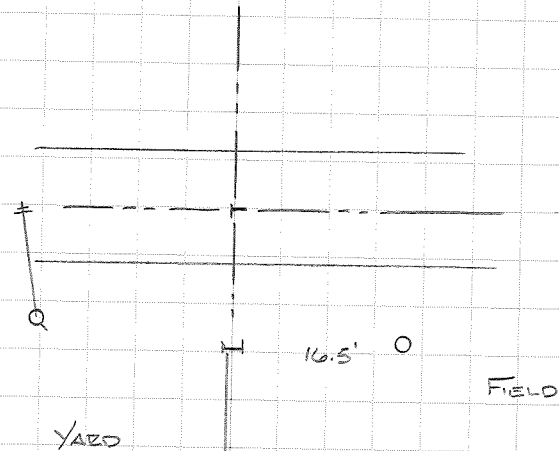

FO 1" x 1" TEE POST
10" DEEP
SET 4" GIN SPINDLE OVER

DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR W/CAP 13.8' TO E/P	SW	30.36'
4 RR RAIL FCP	S	19.45'
NAIL IN B. CAP POWER POLE	ESE	67.76'

HARRISON 115

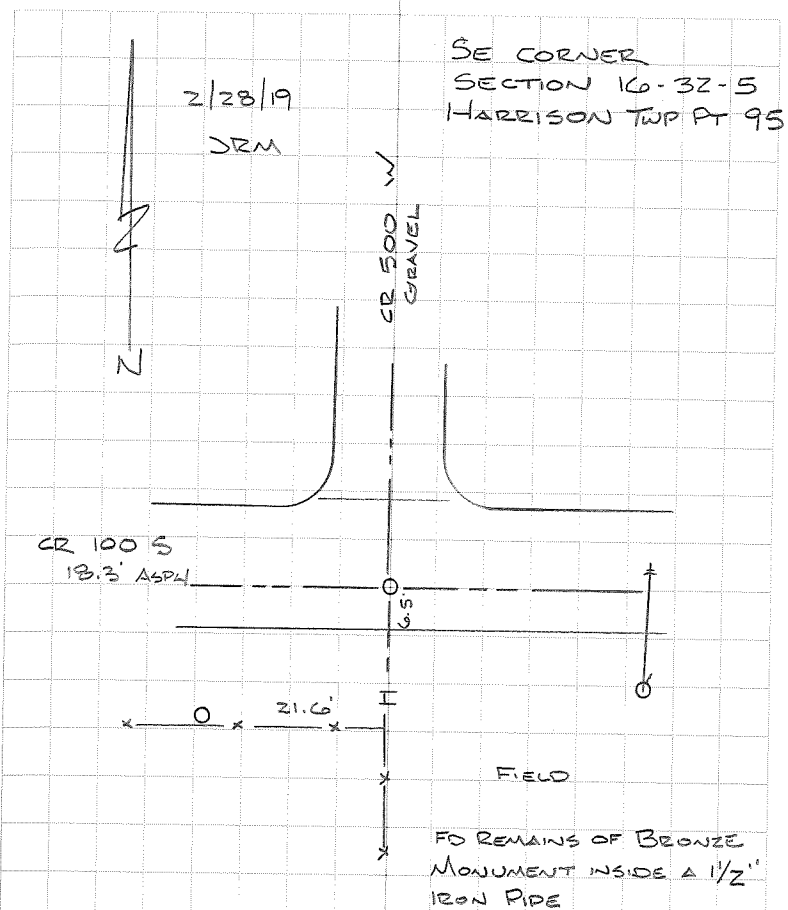

DESCRIPTION


BEARING DISTANCE

NAIL IN B. CAP POWER POLE	SSW	70.97'
NAIL IN B. CAP POWER POLE	NW	32.46'
NEAREST CORNER RR RAIL FCP	SE	43.35'

"KIMPEL" SURVEY APRIL 4 2002 # 2002050571

HARRISON 115

21

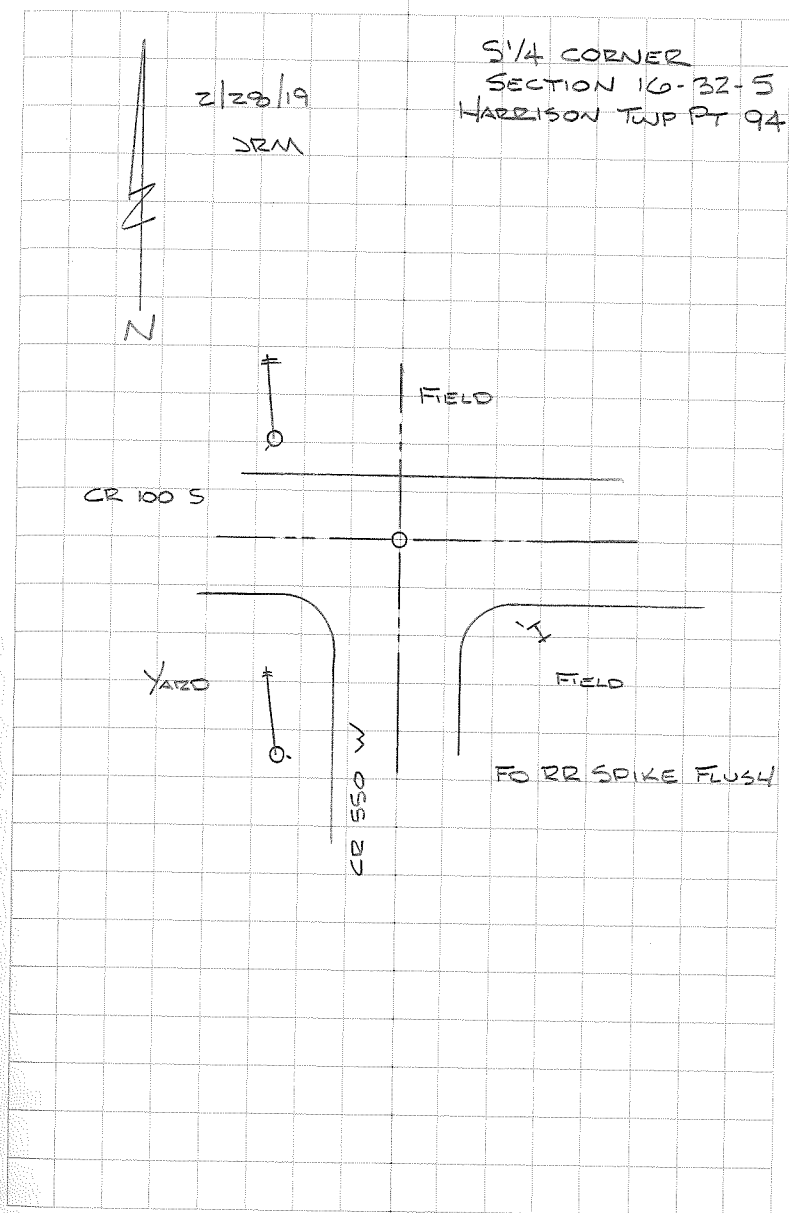


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP POWER POLE	NW	32.02'
NAIL IN B. CAP POWER POLE	NNE	70.23'
1/2" x 24" REBAR W/CAP	NE	34.94'

SURVEY RECORD BOOK 2 (COPY) Pg 346 FEB 26 1869
 "WALKER" SURVEY DEC 4 1997 #98-06-1875
 SURVEY FIELD BOOK 1 Pg 52 JULY 16 1996 KEMPER

HARRISON 115

22

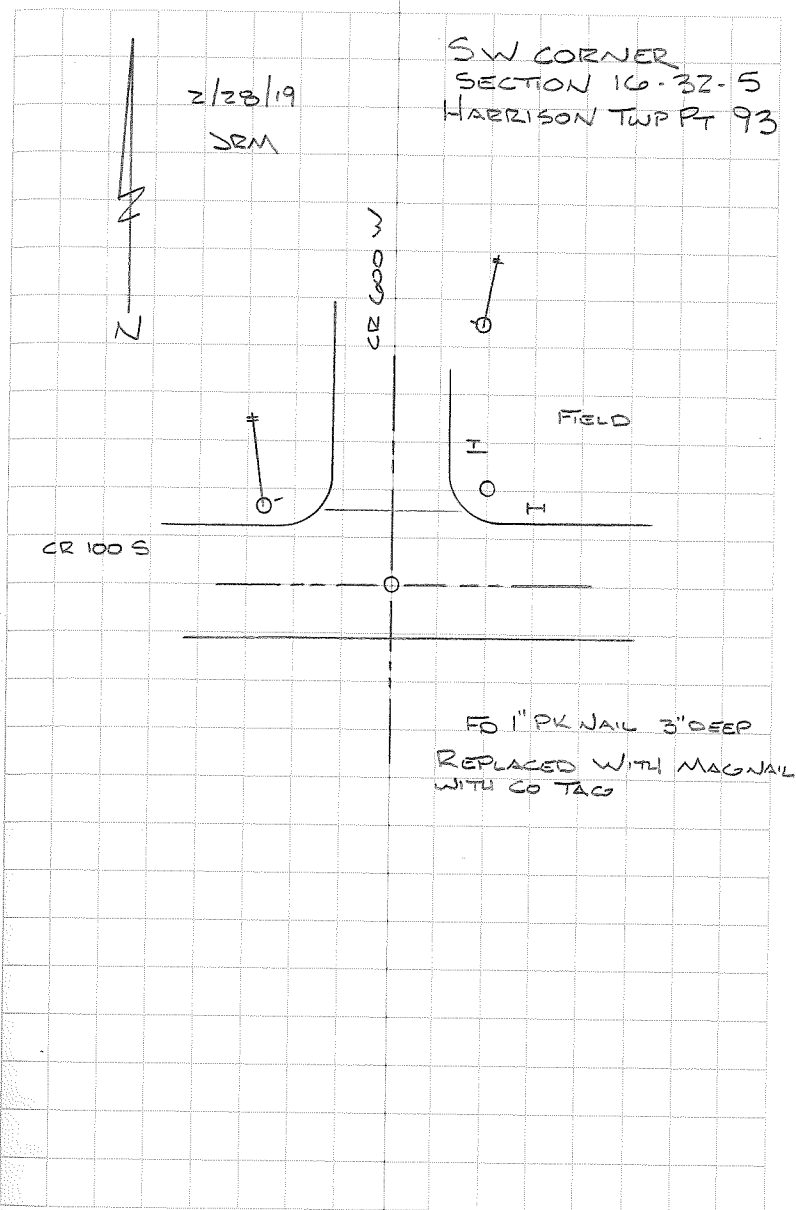

DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR w/CAP	NW	99.94'
1/2" x 24" REBAR w/CAP	NE	71.37'
FD "KAMER 890032" MAG NAIL w/TAG	E	198.50'


"KISSINGER" SURVEY/ APRIL 21 2004 # 200400008659

STATE ROAD 15 PLANS 1989

"KIMPEL" SURVEY/ MARCH 24 2010 # 2010050276

PLAIN 273


24



3/1/19

DEM: M. HUFFMAN

S 1/4 CORNER
SECTION 32-33-6
PLAIN TWP PT 160

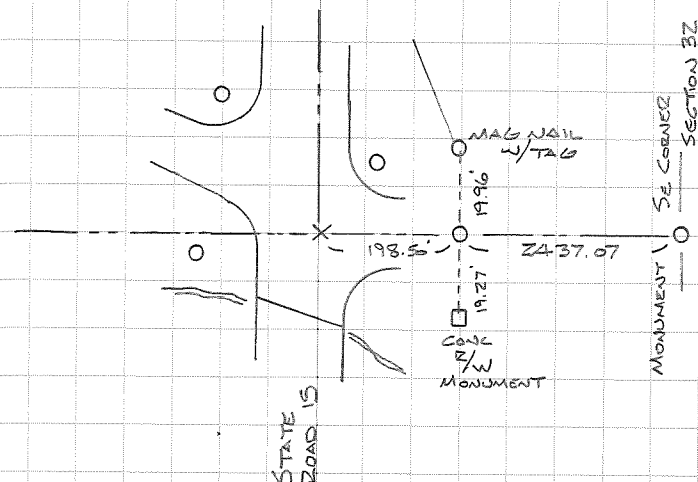

NO CORNER FD OR SET

DESCRIPTION


BEARING DISTANCE

± SOUTH BOLT ST TRAFFIC SIGNAL POST	WNW	57.84'
± SOUTH BOLT ST TRAFFIC SIGNAL POST	ENE	58.29'

"WARRANTY DEED" # 2016020629 TRACT VIII
 McEELROY HILL BUSINESS PARK PLAT BOOK 9 P. 51
 STATE R/W PLAN US 30 PLYMOUTH TO WARSAW

PLAIN 272

25

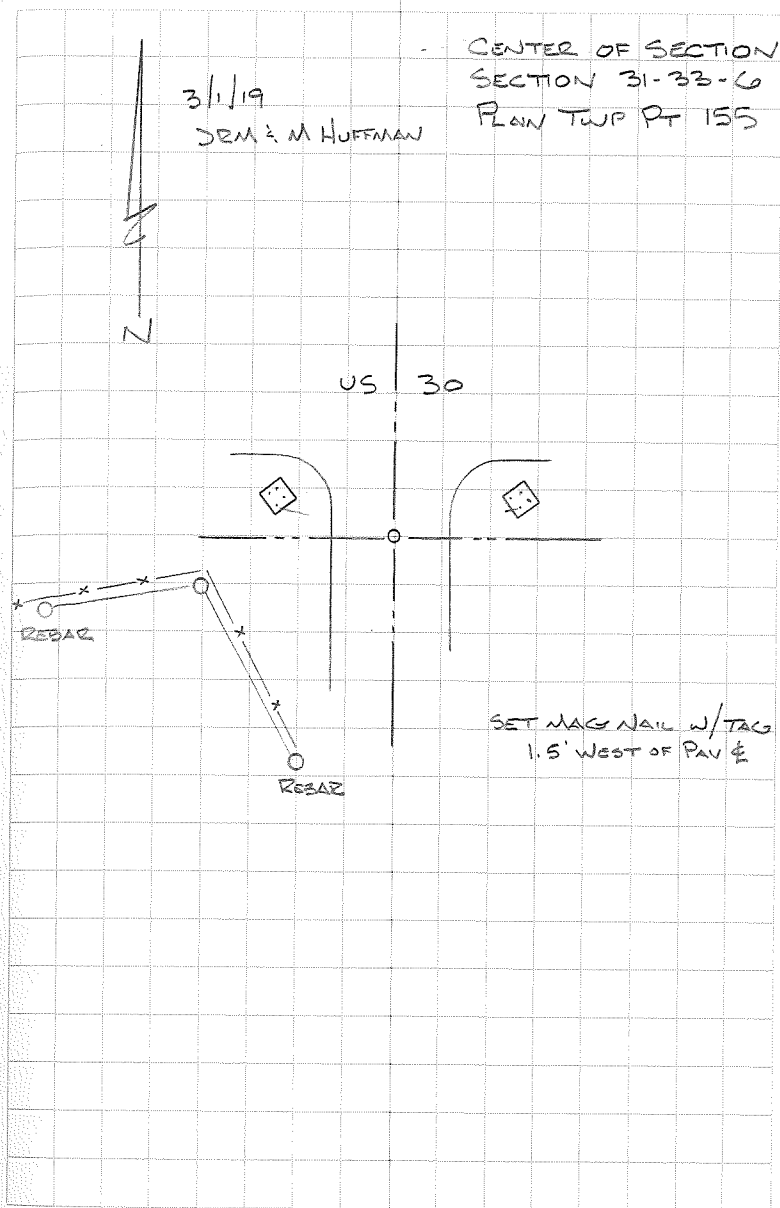


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP POWER POLE	W	19.77' PLUMB
WEST CORNER 2" ANGLE IRON FCP	E	21.15' PLUMB
1/2" x 24" REBAR W/ CAP 8.5' TO E/P	SE	30.06' PLUMB

"STONE" SURVEY RECORD BOOK 2 (COPY) Pg 332
 NOV 1, 1870 - UNLIKELY TO BE THERE RD HAS
 BEEN CUT DOWN 4'

HARRISON 9.7


26

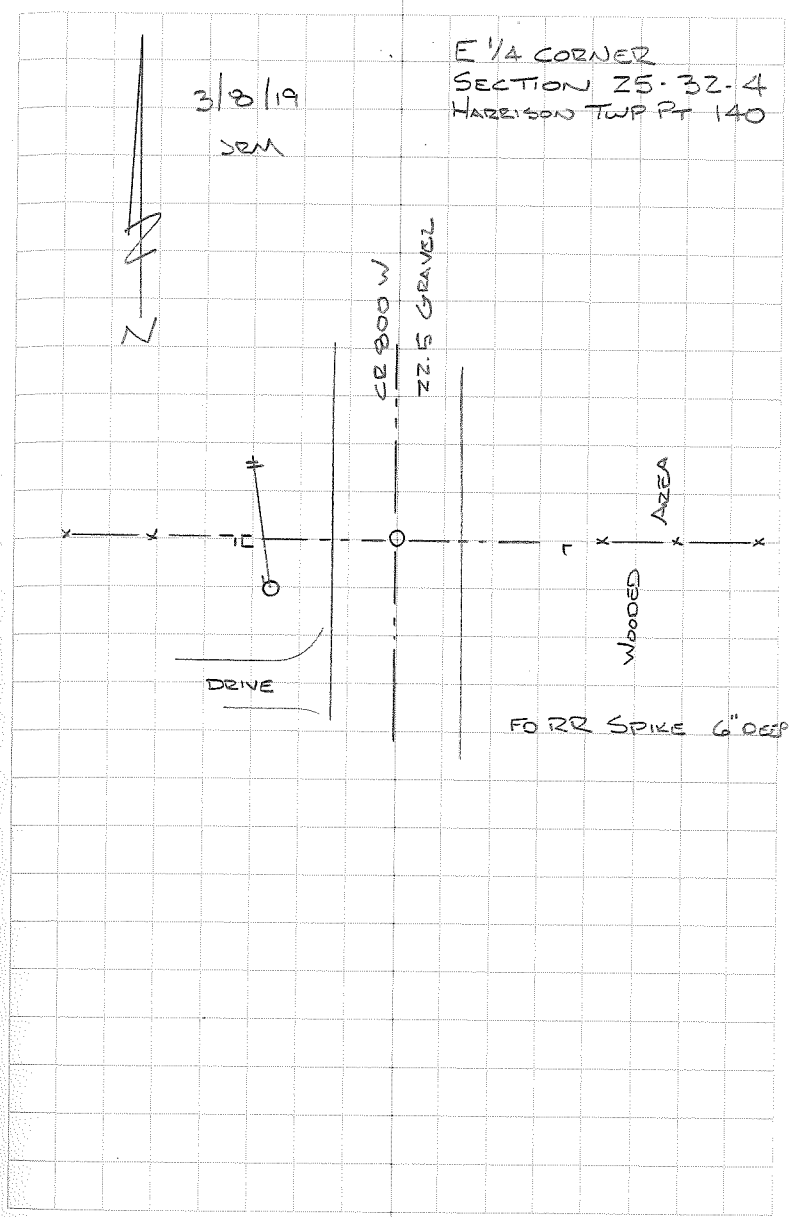

DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR W/CAP 5' TO E/P	SSW	42.80'
1/2" REBAR FCP	E	20.05'
1/2" x 24" REBAR W/CAP 13.2' TO E/P	ESE	23.39'

HARRISON 96


27

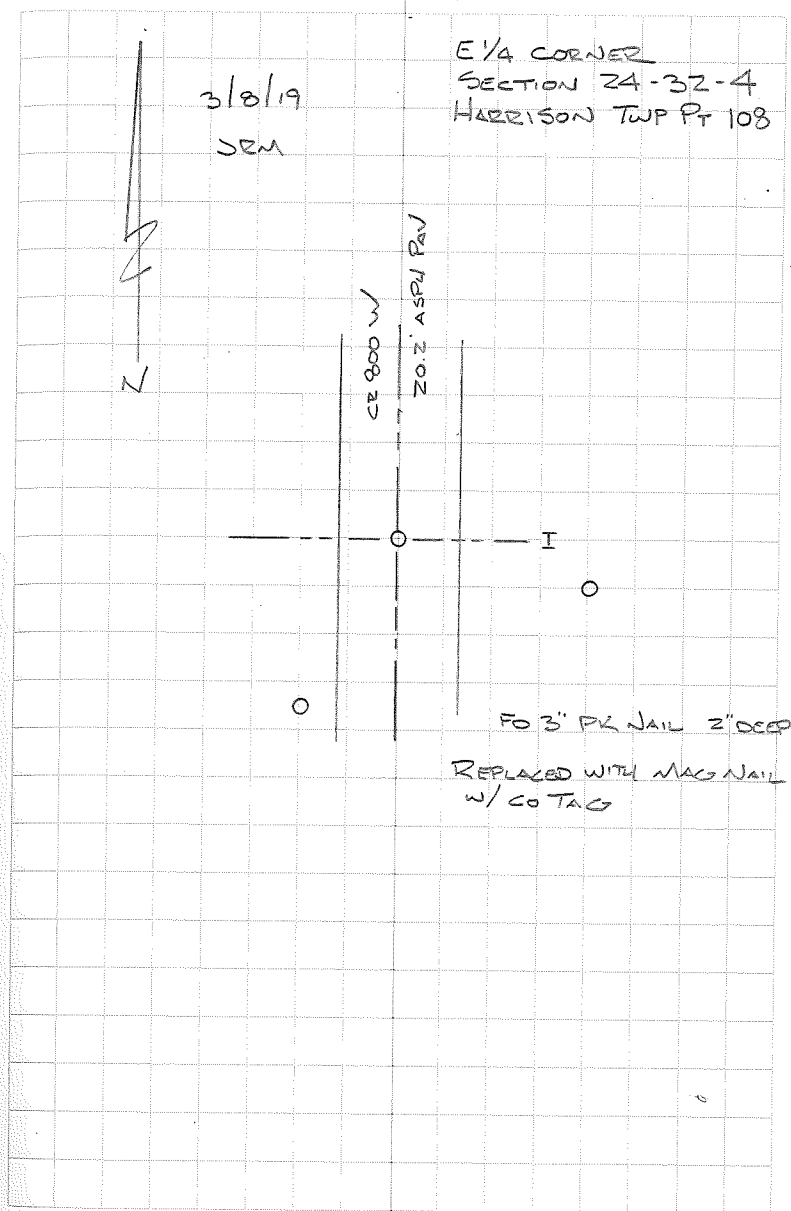

DESCRIPTION	BEARING	DISTANCE
8" SQ CONC FLP EAST FACE	W	20.1'
NAIL IN B. CAP REMC POLE 6478	WNW	18.90'
SW CORNER 16" SQ CONC FLP	E	20'
1/2" x 24" REBAR W/CAP 9.9' to E/P	SE	27.40'

HARRISON
101

28

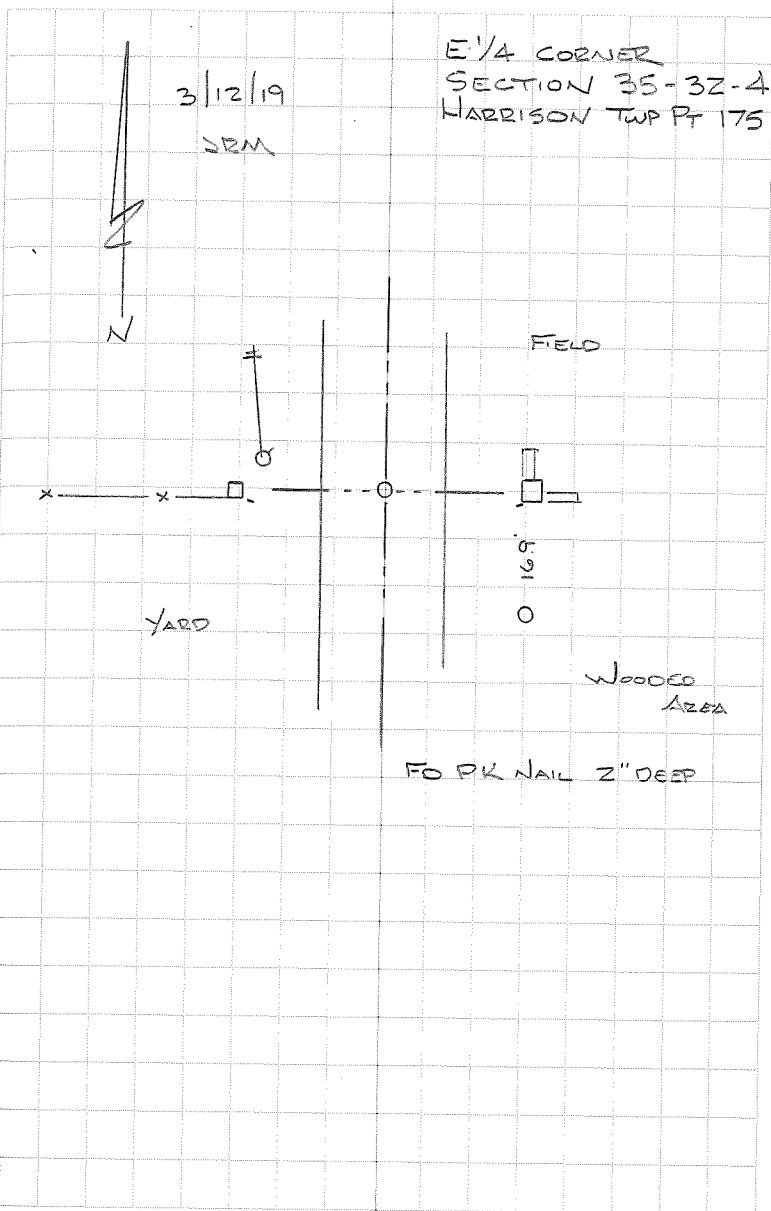


DESCRIPTION	BEARING	DISTANCE
FO RR SPIKE 5" DEEP	N	66.46'
FO MAG NAIL W/TAG "LS 80040428"	SSE	4.66'
1/2" X 24" REBAR W/CAP 7' to E/P	SE	37.80'
1/2" X 24" REBAR W/CAP 5.5' to E/P	SW	26.28'

"WEISS" SURVEY DEC 1 1995 #96-01-0673

HARRISON
50

29

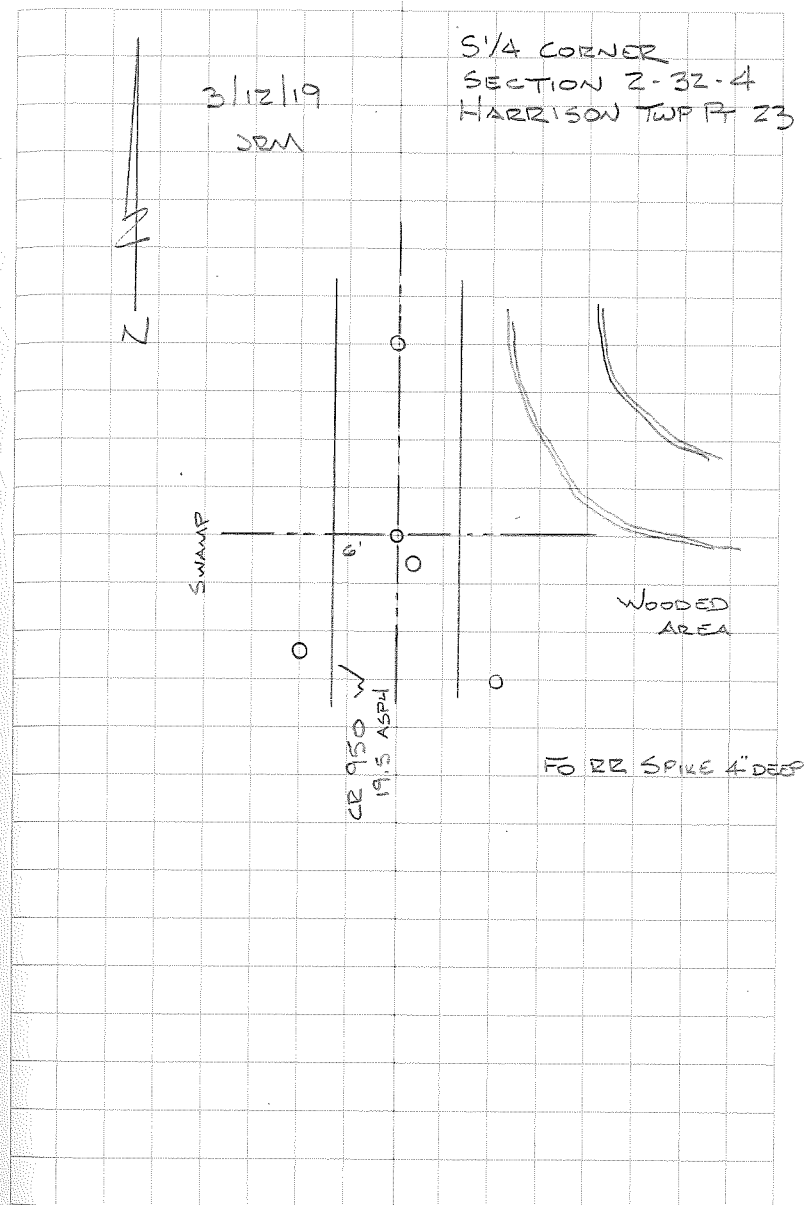


DESCRIPTION	BEARING	DISTANCE
1 RR RAIL FCP	W	21.3'
NAIL IN B. CAP IN POWER POLE	ENE	18.95'
WEST FACE 10" DIA CONC FCP	E	19.9'
NW CORNER RR RAIL FCP	SE	24.65'

"WALKER" SURVEY	NOV 9 1993	# 1994020658
"HUFFMAN" SURVEY	DEC 2 2013	# 2014010389

HARRISON 101


30

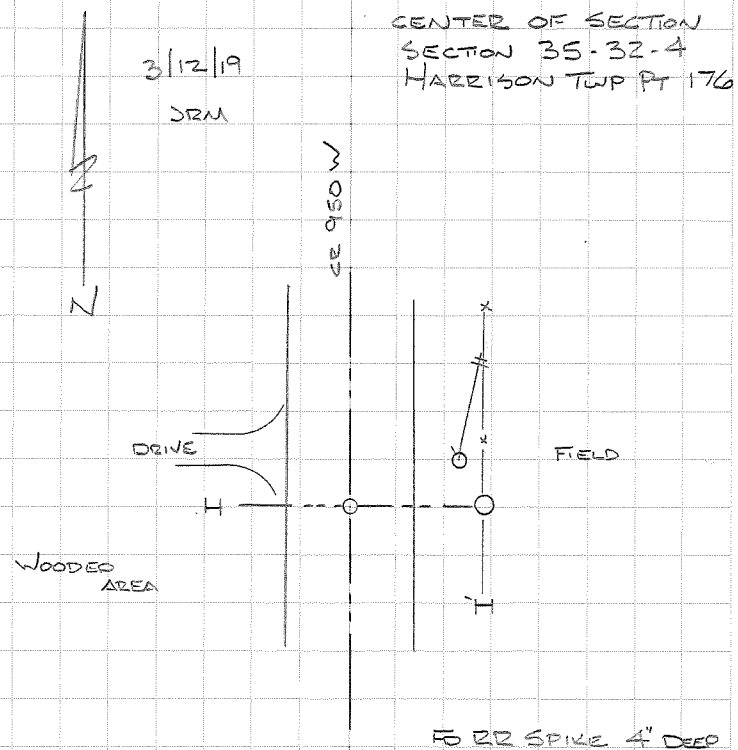

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	NNW	74.85'
4 RR RAIL FCP	S	19.35'
NAIL IN B. CAP IN POWER POLE	SSW	17.80'

HARRISON 97

31

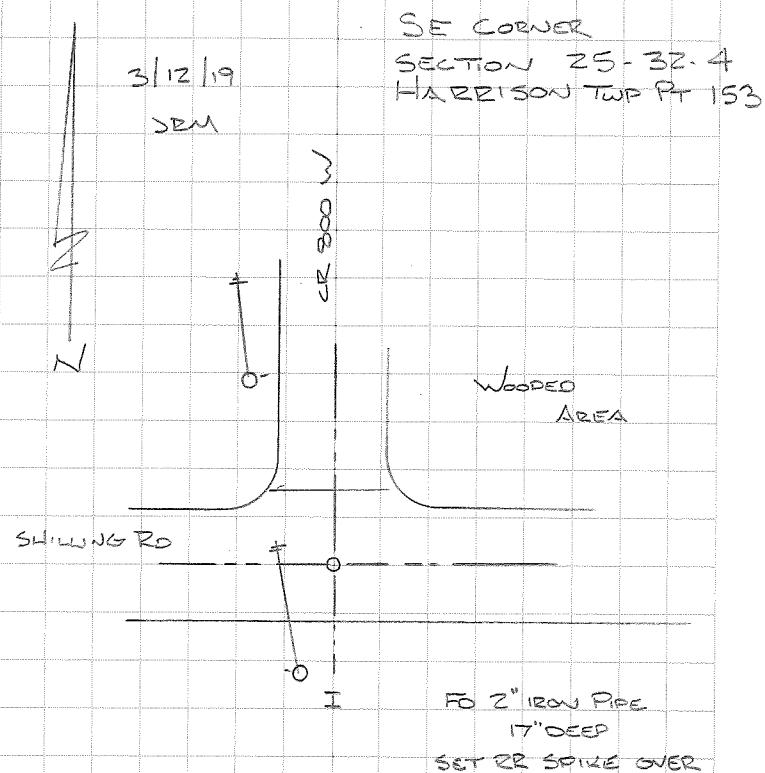


DESCRIPTION	BEARING	DISTANCE
EAST FACE 8" SQ CONC FCP	W	19.85'
± RR RAIL FCP	ENE	20.6'
NW CORNER RR RAIL FCP	SE	24.05'
NAIL IN B. CAP NIPSCO POLE 620/109	SSW	89.35'

"MICHEL" SURVEY DEC 27 2013 #2014010641


HARRISON
120

32



3/13/A
SRM

CENTER OF SECTION
SECTION 21-32-4
HARRISON TWP RT 103

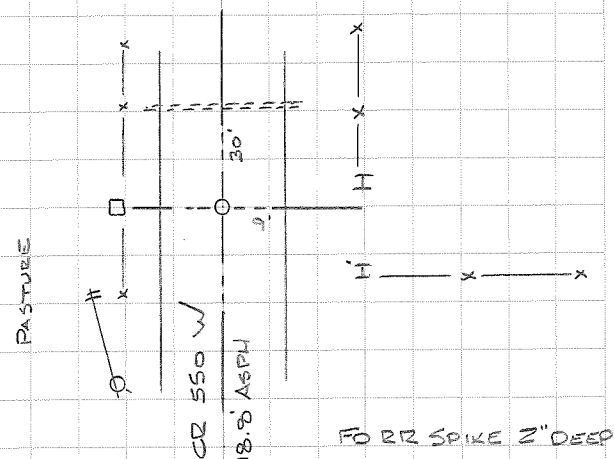

DESCRIPTION


BEARING DISTANCE

1/2" x 24" REBAR w/CAP 11' TO E/P	NW	39.40'
⊥ RR RAIL FCP	W	19.75'
⊥ RR RAIL FCP	E	19.4'

"LONG" SURVEY JULY 29 2002 #2002090140

HARRISON 126

33

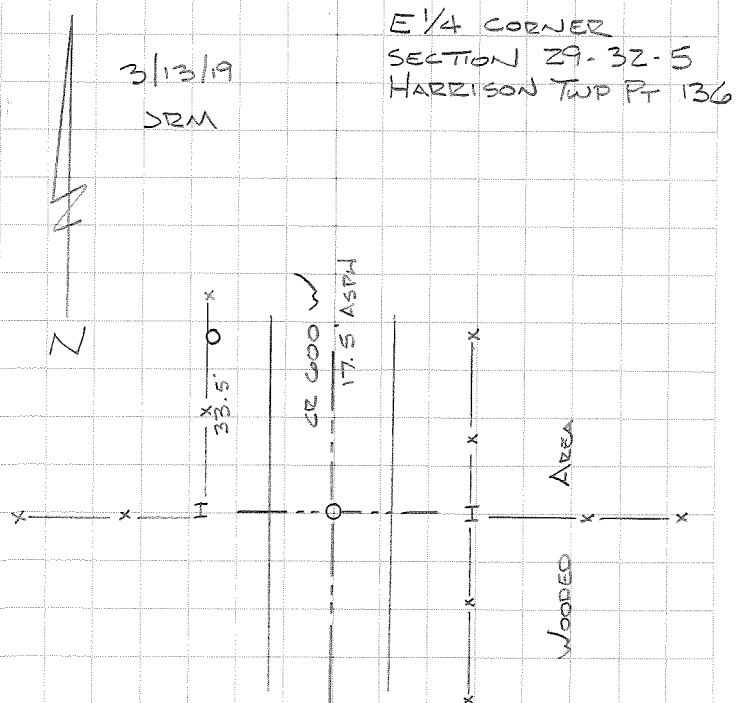


FO 3" PK NAIL
NOTHING UNDERNEATH
REPLACED WITH MAG
NAIL & TAG

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP POWER POLE	WSW	24.25'
FO 1/2" REBAR NO CAP	W	20.00'
E RR RAIL FCP	E	20.0'

"WALKER" SURVEY NOV 29 1994 #1995030966

HARRISON
129


34

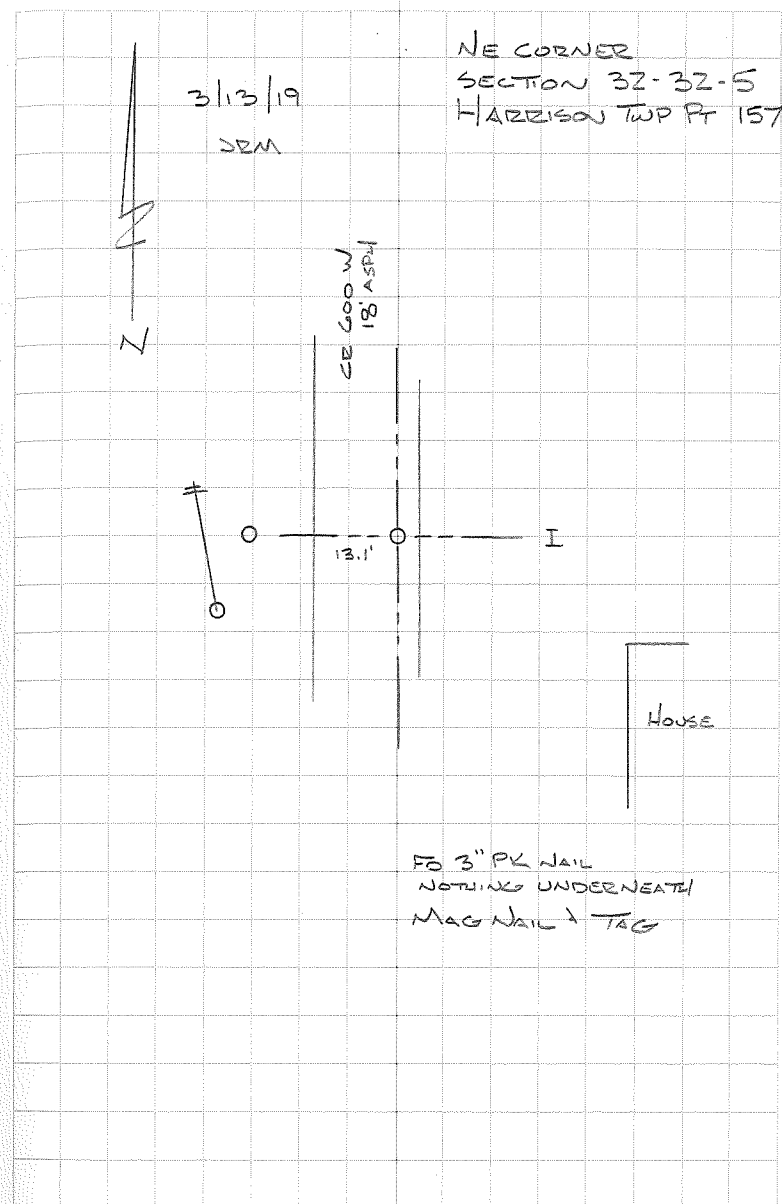

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP POWER POLE	NW	54.84'
NAIL IN B. CAP POWER POLE	ENE	45.00'
NAIL IN B. CAP POWER POLE	SSW	45.12'

HARRISON 128

35

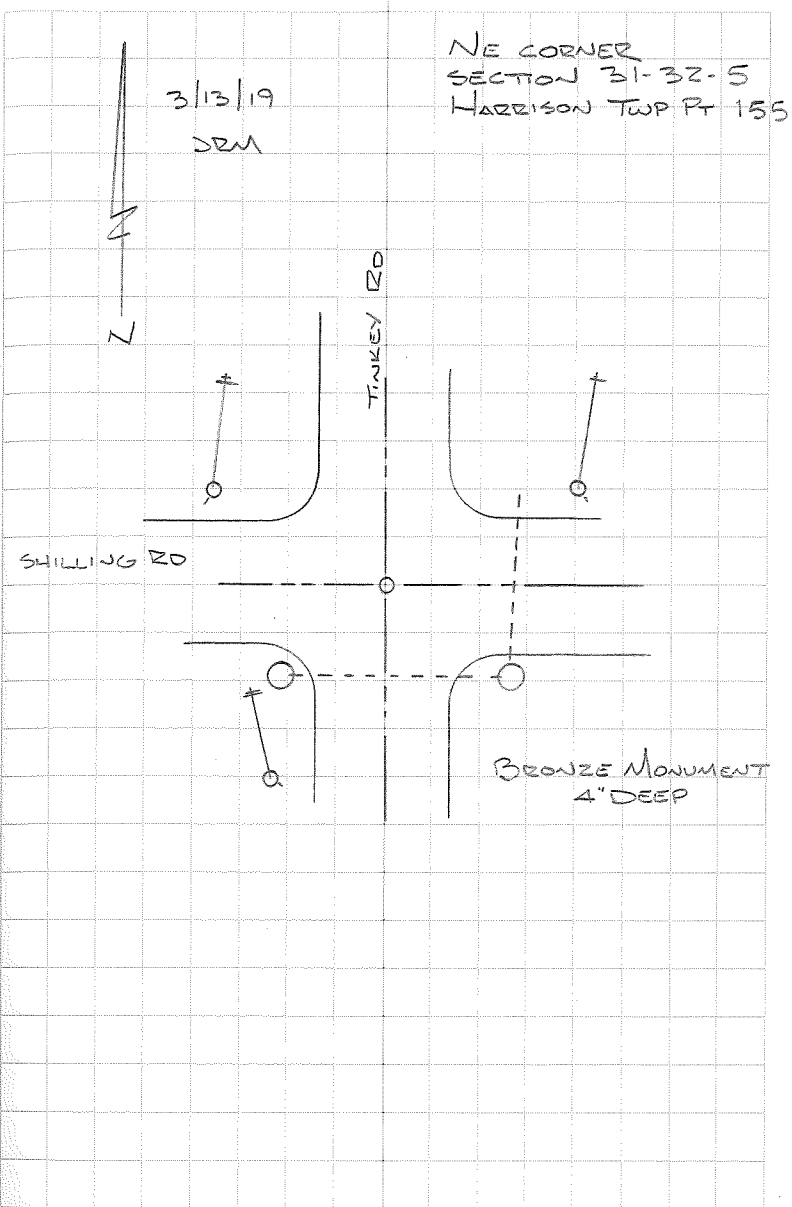


DESCRIPTION

BEARING DISTANCE

1/2" x 24" REBAR w/CAP	NW	34.43'
1/2" x 24" REBAR w/CAP 10.3' FROM CMP	NE	36.20'

JACKSON 140

36

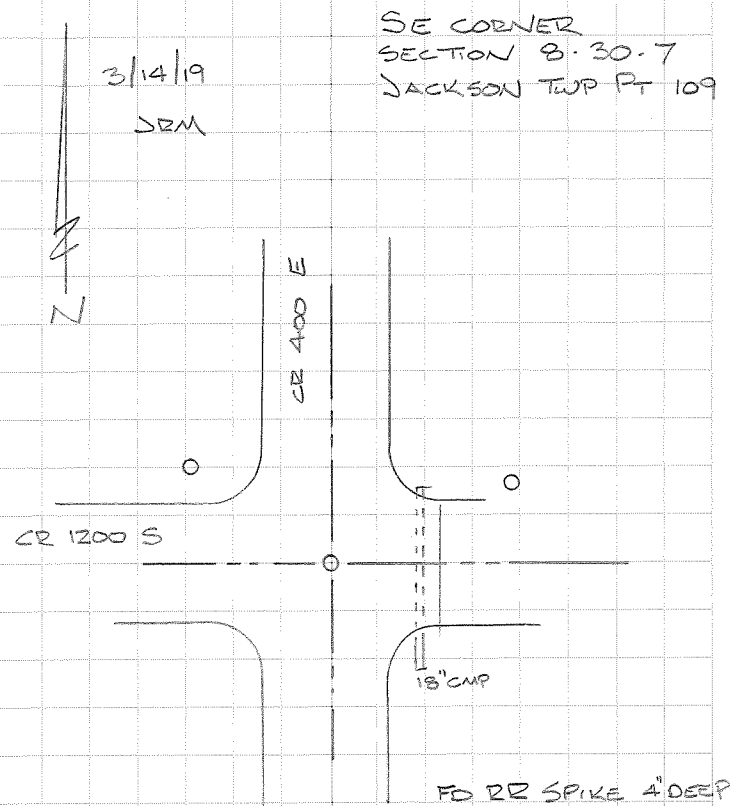


DESCRIPTION

BEARING DISTANCE

1/2" RR RAIL FCP	W	18.82'
1/2" x 24" REBAR w/cap 9' to E/P	NE	30.87'
1/2" RR RAIL FCP	E	18.73'

JACKSON, MO

37

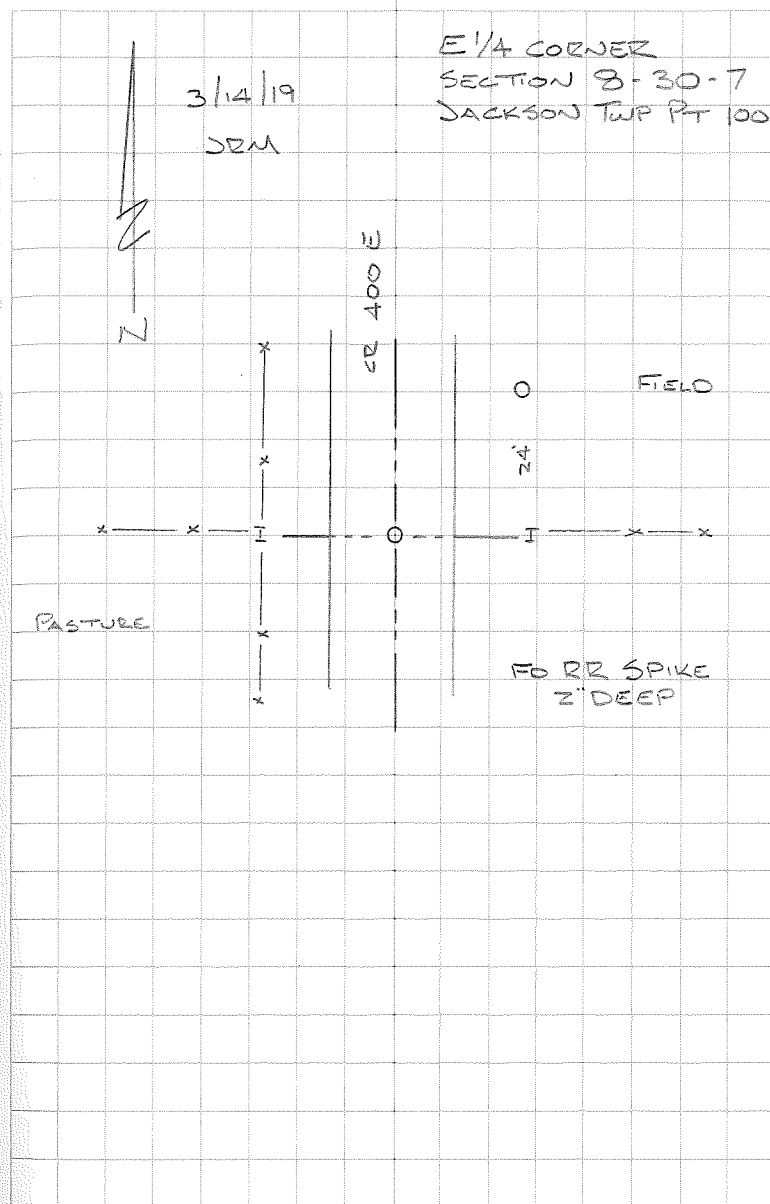

DESCRIPTION

BEARING DISTANCE

FO NAIL IN B. CAP POWER POLE

SSE 24.12'

FO 1/2" REBAR W/WITNESS CAP

NE 62.12'


FO BOAT SPIKE 4" DEEP

E 82.42'

SEE SECTION CORNER FIELD BOOK 2 Pg 41 1992

JACKSON 159

38

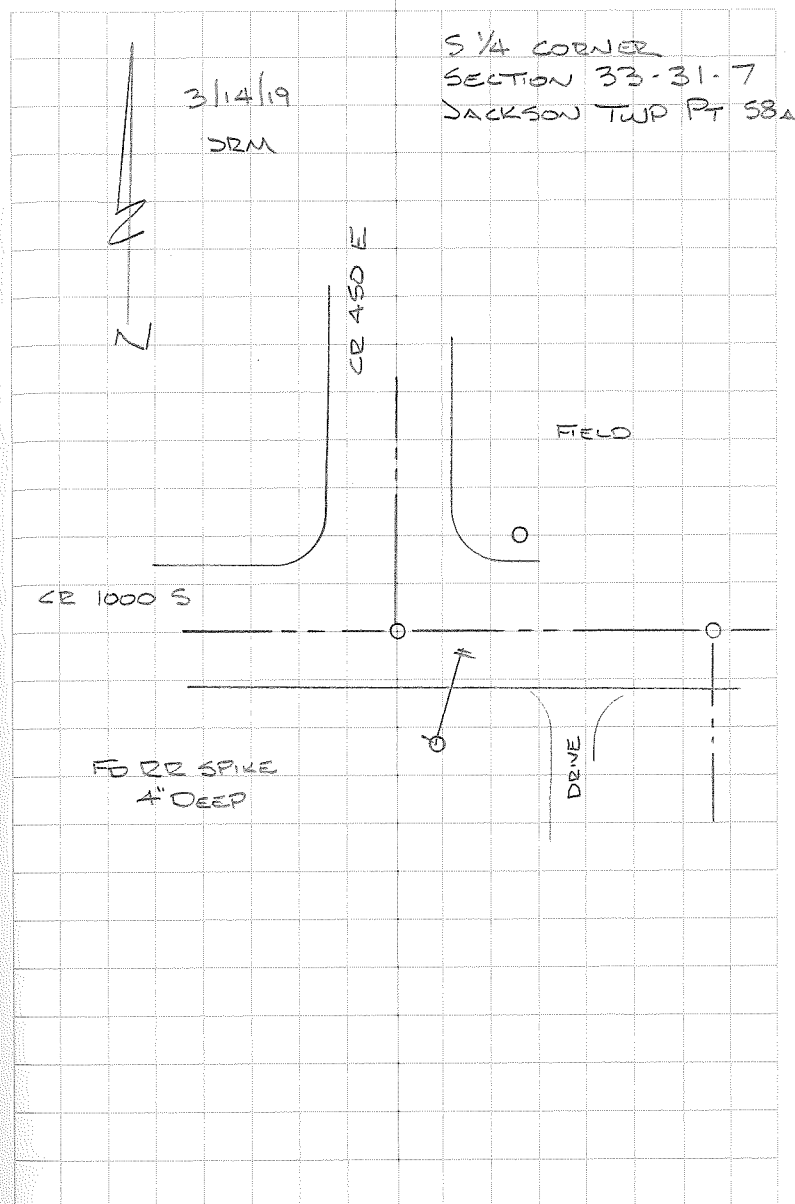


DESCRIPTION	BEARING	DISTANCE
FO NAIL IN B. CAP POWER POLE	WSW	72.85'
FO RR SPIKE 4' DEEP	W	82.42'
FO 1/2" REBAR W/ WITNESS CAP	NW	40.06'

SEE SECTION CORNER FIELD BOOK 2 P. 41 1992

JACKSON 136

39

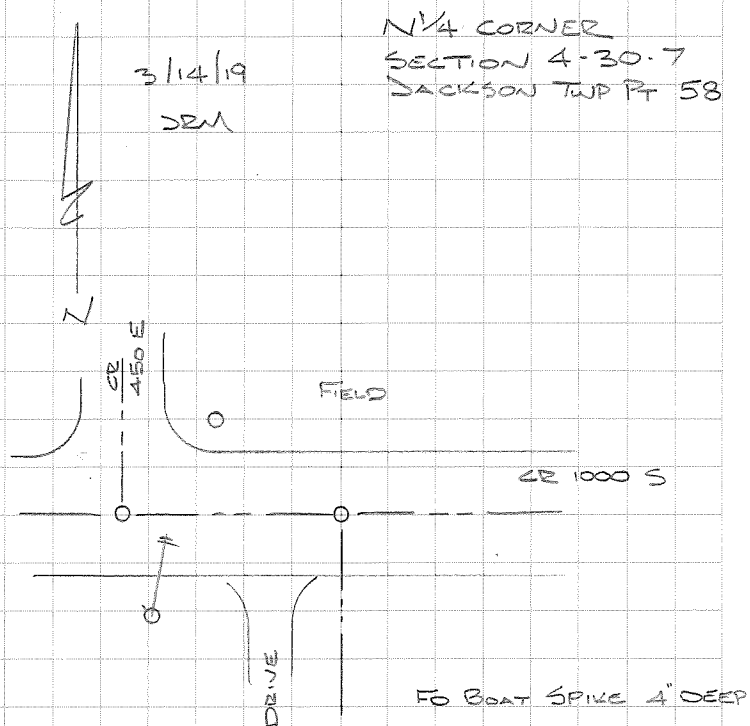

DESCRIPTION


BEARING DISTANCE

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP TELEPHONE POLE	NW	34.65'
NAIL IN B. CAP TELEPHONE POLE	SW	33.75'

SEE SECTION CORNER FIELD BOOK 1 P 24 1991

JACKSON
149

40

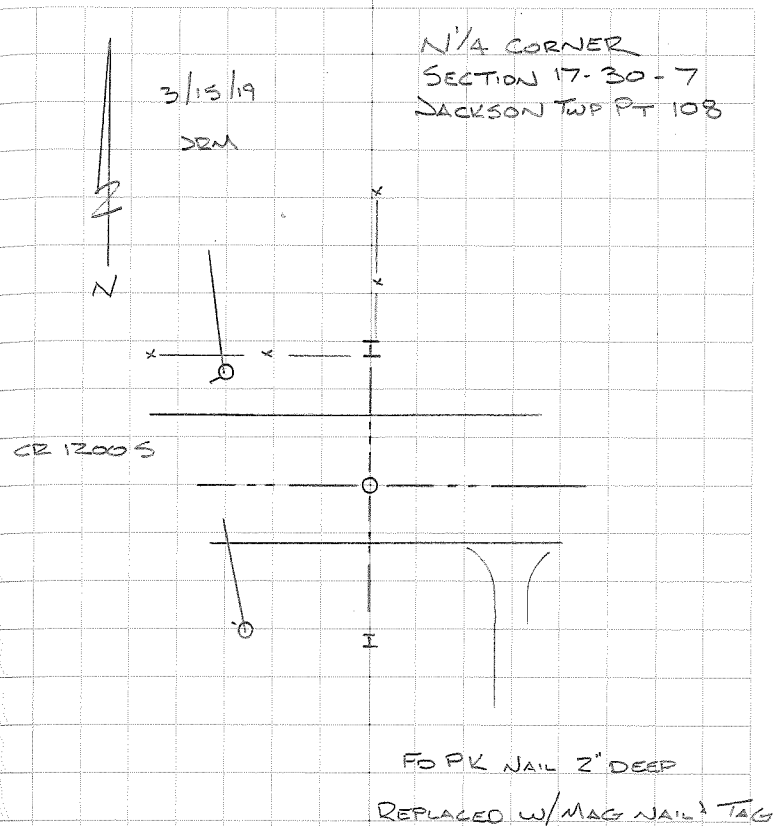

DESCRIPTION	BEARING	DISTANCE
FO PK NAIL IN POWER POLE	WSW	38.20'
1/2" x 24" REBAR W/CAP	SE	48.06'
1/2" x 24" REBAR W/CAP	NE	48.70'

"KIMPEL" SURVEY OCT 5 2005 # 200500016579

JACKSON
149°

41



3/13/19

SRM

CR 300 W

NW CORNER
SECTION 17-30-7
JACKSON TWP PT 107

FIELD

CR 1200 S

YARD

FO RE SPIKE 6" DEEP

DESCRIPTION

BEARING DISTANCE

⊕ RR RAIL FCP	W	21.8'
1/2" x 24" REBAR W/CAP 9.4' TO E/P	NW	36.70'
1/2" x 24" REBAR W/CAP 8.3' TO E/P	NE	25.11'
⊕ RR RAIL FCP	E	16.05'


"WALKER" SURVEY APRIL 10 1995 # 1995040224
 "CRAMER" SURVEY JULY 25 1995 # 1995081632

JACKSON
149

42

3/15/19
JRM

W 1/4 CORNER
 SECTION 17-30-7
 JACKSON TWP RT 128

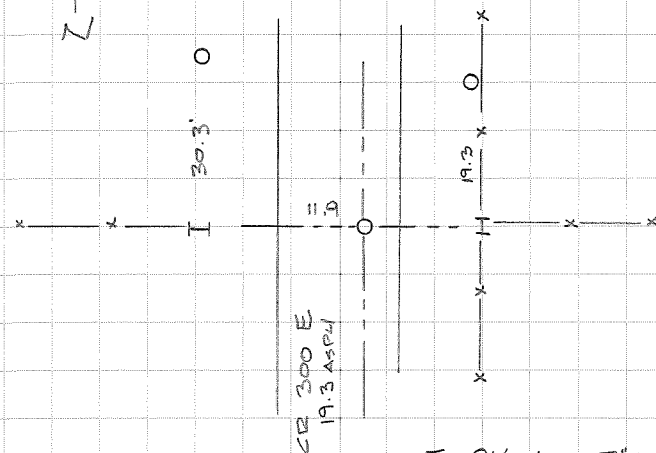


FO PK NAIL 2" DEEP
 REPLACED WITH MAG NAIL
 & CO TAG

DESCRIPTION	BEARING	DISTANCE
FO 5/8" REBAR NO CAP 6" TALL	SW	22.43'
FO 5/8" REBAR NO CAP 6" TALL	SE	24.65'

WABASH CO HAS GPS COORDINATES MARCH 28 2014


JACKSON
149

43



3/15/19
JRM

S 1/4 CORNER
SECTION 17-30-7
JACKSON TWP R 134

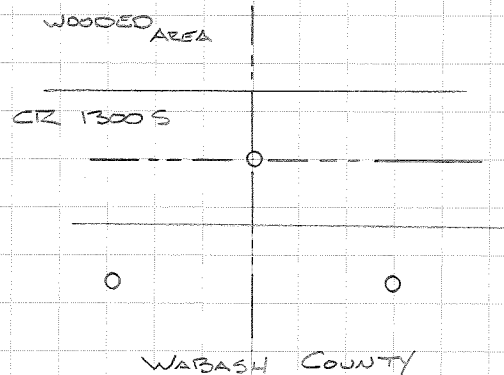

FO WABASH COUNTY
MONUMENT FLUSH

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP POWER POLE	NW	49.76'
1/2" x 24" REBAR w/ CAP	NE	42.33'


WABASH COUNTY HAS STATE PLANE COORDINATES 2014

JACKSON 150.

44

3/15/19
DEM

SE CORNER
SECTION 18-30-7
JACKSON TWP RT 133

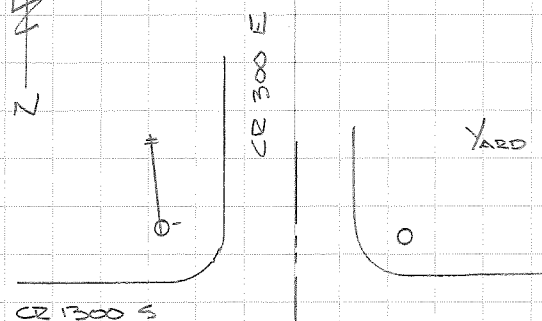

WABASH COUNTY


FO WABASH COUNTY
MONUMENT FLUSH

DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR w/CAP 11' to E/P	NW	34.27'
1/2" x 24" REBAR w/CAP 11' to E/P	NE	23.68'
⊕ RR RAIL FCP	S	20.2'

WABASH COUNTY HAS STATE PLANE COORDINATES 2014

JACKSON 150


45



3/13/19

SRM

S 1/4 CORNER
SECTION 18-30-7
JACKSON TWP R7 13Z

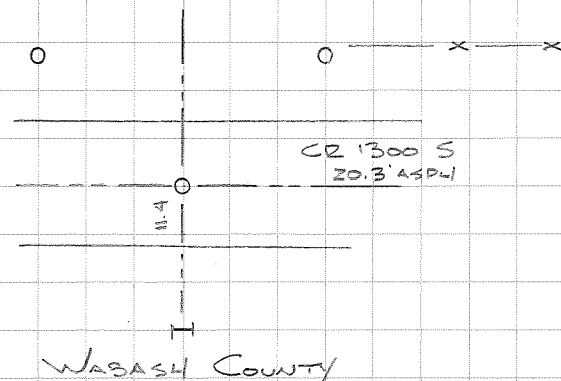


FO RR SPIKE 2" DEEP

DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR w/CAP 2' TO E/P	NW	35.90'
1/2" x 24" REBAR w/CAP 2' TO E/P	NE	29.23'

"TAZIAN" SURVEY MAY 23 1989 # 1992031417
 "WALKER" SURVEY OCT 28 1997 # 1997121095


JACKSON 148

46



3/15/19
JRM

W/4 CORNER
SECTION 16-30-7
JACKSON TWP RT 126

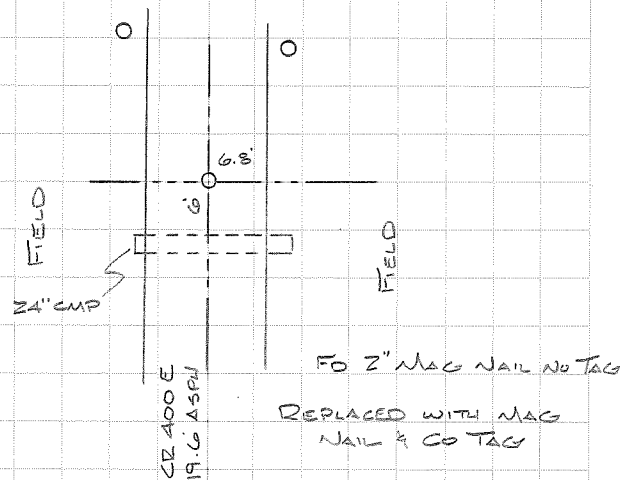


DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR w/CAP 7' TO E/P	NE	38.47'
FD NAIL IN B CAP W POWER POLE	SE	28.14'

MEK 5/84 FD PK NAIL
 "KIMPEL" SURVEY MARCH 27 1993 #1993111168
 "WALKER" SURVEY JAN 4 1999 #1999071106

JACKSON 142

47

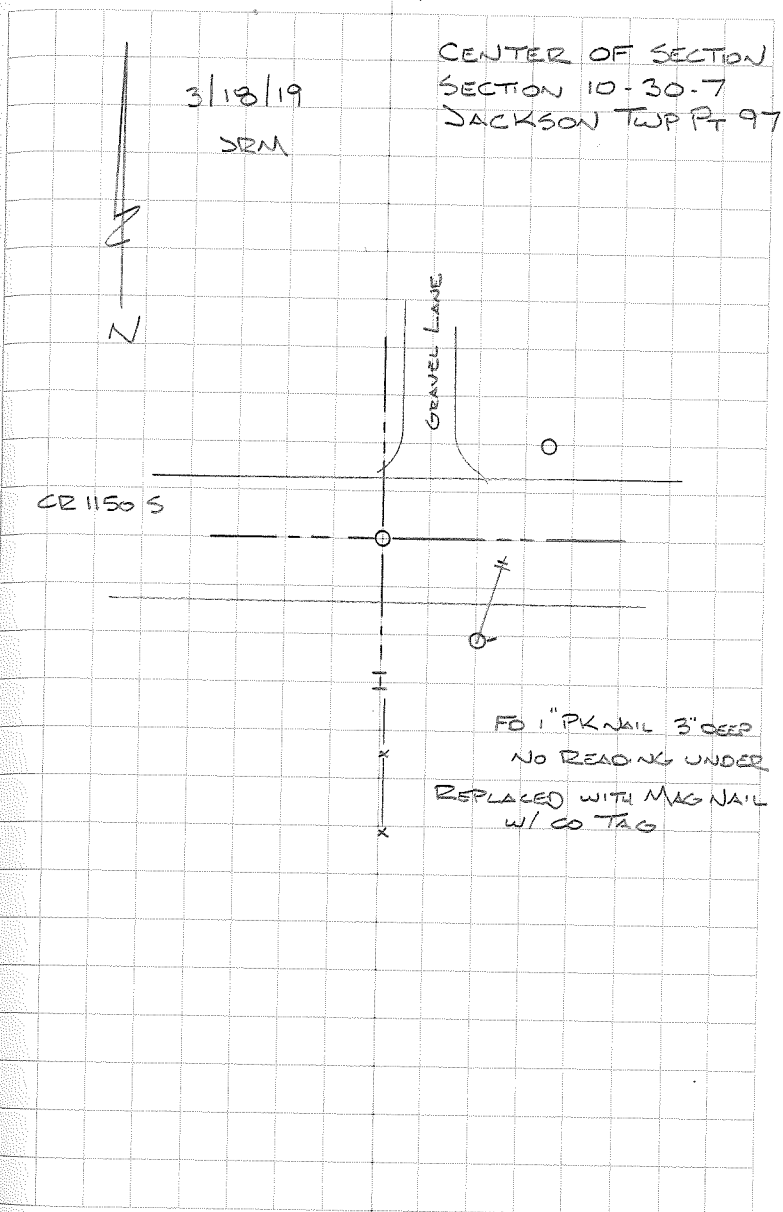


DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR w/CAP	NW	45.91'
NAIL IN B. CAP IN POWER POLE	SE	63.38'
NAIL IN B. CAP IN POWER POLE	SW	37.14'

"WALKER" SURVEY DEC 19 1994 # 1995030030

JACKSON
143

48

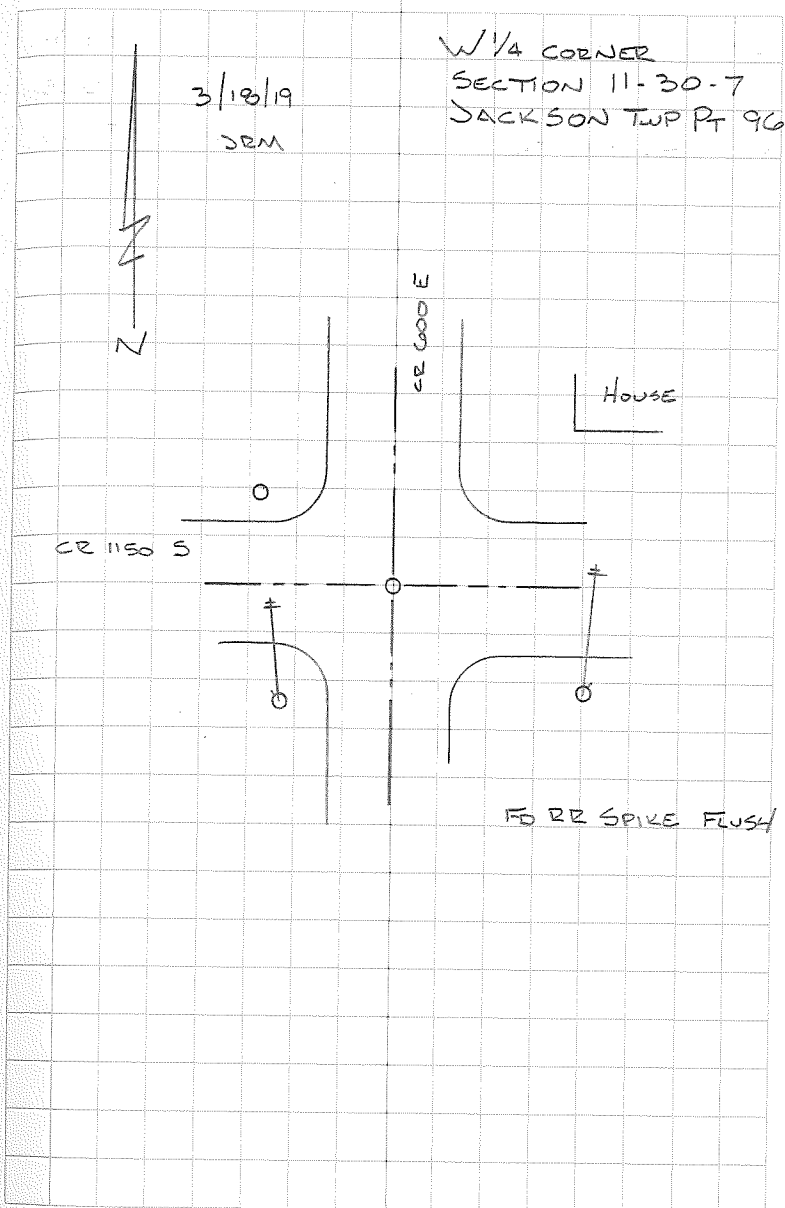


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	ENE	59.34'
NAIL IN B. CAP IN POWER POLE	ESE	68.20'
MAG NAIL NO TAG	E	20.00'

"WALKER" SURVEY OCT 30 1993 # 1994020626
DEED RECORD 163 Pg 339 MAY 3 1947

JACKSON 143

49

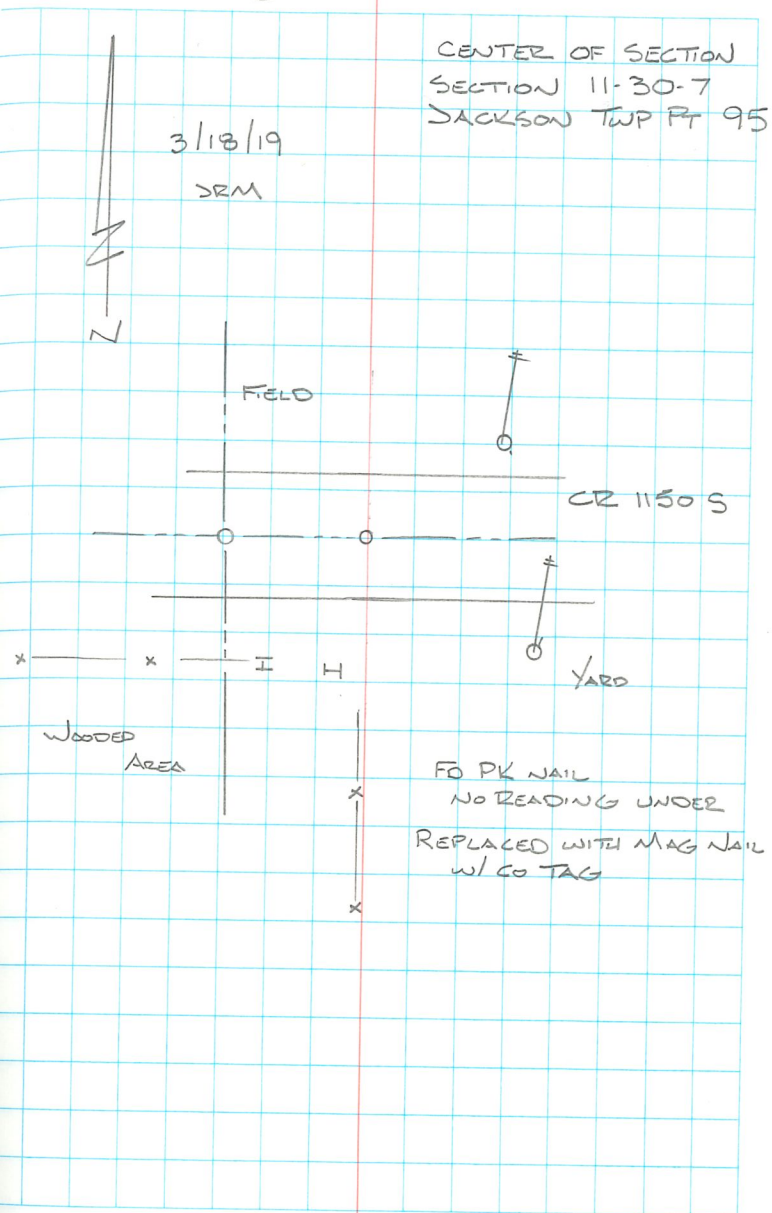

DESCRIPTION	BEARING	DISTANCE
FO REBAR W/CAP "REFERENCE POINT" AT E/P	SW	16.80'
FO MAG NAIL IN POWER POLE	NNE	66.35'
FO MAG NAIL IN POWER POLE	NE	47.00'


"WALKER" SURVEY MAY 18 1991 #1992010385
 "WOOLPERT" JAN 18 2012 COORDINATES #118

JACKSON 143

50

3/18/19
JRM

E 1/4 CORNER
SECTION 11-30-7
JACKSON TWP PT 94

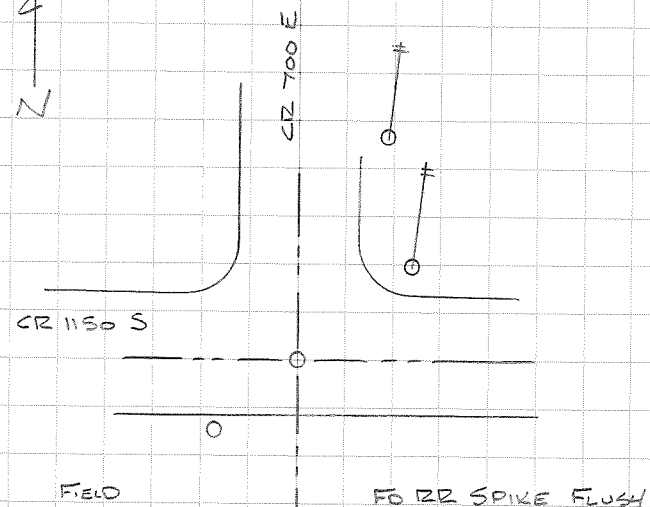

DESCRIPTION



BEARING DISTANCE

1/2" x 24" REBAR W/CAP 13.5' TO E/P	SW	25.58'
1/2" x 24" REBAR W/CAP 9' TO E/P	SE	30.31'
FO 5/8" REBAR BENT @ E/P	WNW	43.4'
FO 5/8" REBAR BENT @ E/P	WSW	41'

"WALKER" SURVEY OCT. 19 2000 #2001010291
 "WOOLPERT" PT #119 JAN 18 2012

JACKSON
144

51

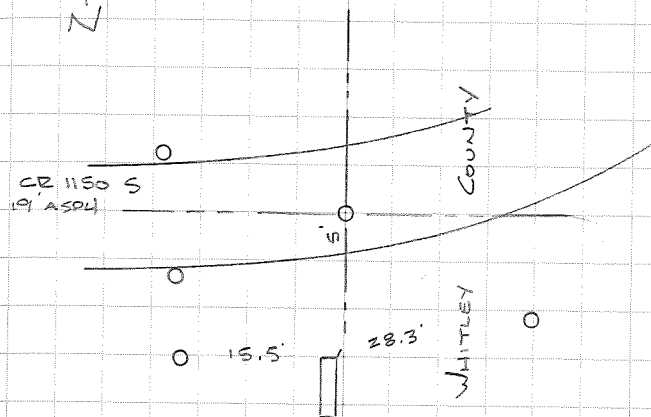3/18/19
SRME 1/4 CORNER
SECTION 12-30-7
JACKSON TWP PT 92

FO PK NAIL 3" DEEP
 NO READING UNDER
 REPLACED WITH MAG NAIL

DESCRIPTION	BEARING	DISTANCE
± RR RAIL FCP	W	20.0'
FO MAG NAIL IN POWER POLE	ENE	20.10'
± AT TOP 10" SQ CONC FCP	E	20.0'

SURVEY FIELD BOOK 2 Pg 15 JULY 15 1968 CB
 "WOOLPERT" Rt # 117 JAN 18 2012


JACKSON 146

52



3/18/19
 SDM

NE CORNER
 SECTION 14-30-7
 JACKSON TWP RT 115

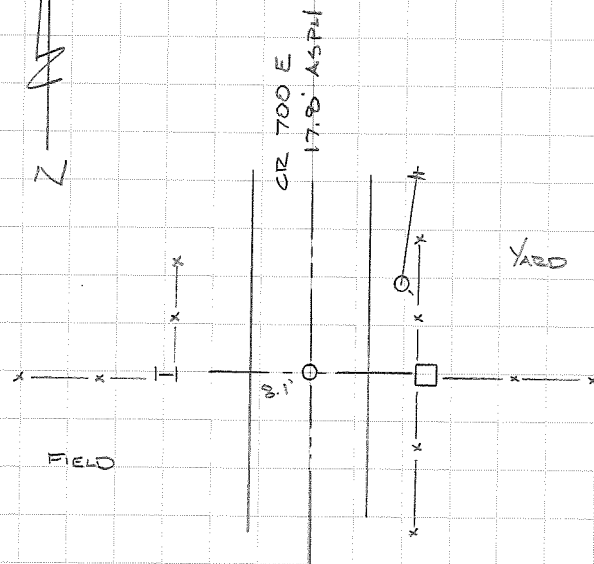

FO BRONZE MONUMENT
 FLUSH

DESCRIPTION

BEARING DISTANCE

E FACE 12" DIA CONC FCP	W	19.60'
NAIL IN B. CAP IN POWER POLE	ENE	56.73'
E RR RAIL FCP	E	20.75'

"MICHEL" SURVEY OCT 5 2010 #2011011023


JACKSON 146

53



3/18/19
JRM

E 1/4 CORNER
SECTION 14-30-7
JACKSON TWP RT 120

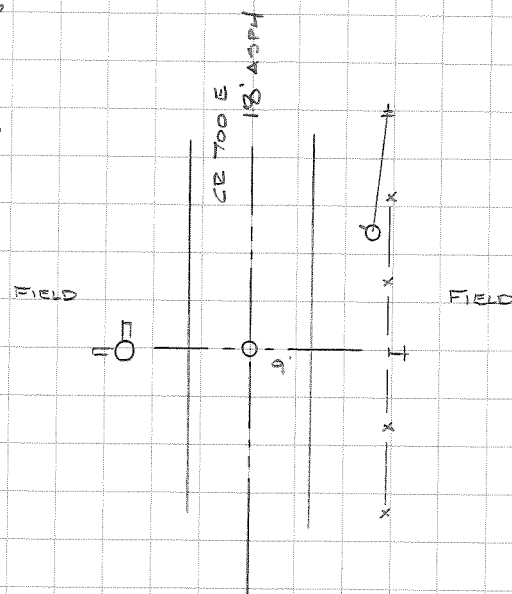


FO PK NAIL 2" DEEP
NO READING UNDER
REPLACED WITH MAG NAIL
W/ CO TAG

DESCRIPTION	BEARING	DISTANCE
± RR RAIL FCP	W	52.6'
NAIL IN B. CAP IN POWER POLE	NNW	41.72'
FO "McCREA" CAPPED IRON IN FENCE	N	90.0'
± RR RAIL FCP	N	41.4'

DEED RECORD # 2017061005
 "MAUREE" SURVEY OCT 12 1991 # 1992010528

JACKSON 147

54

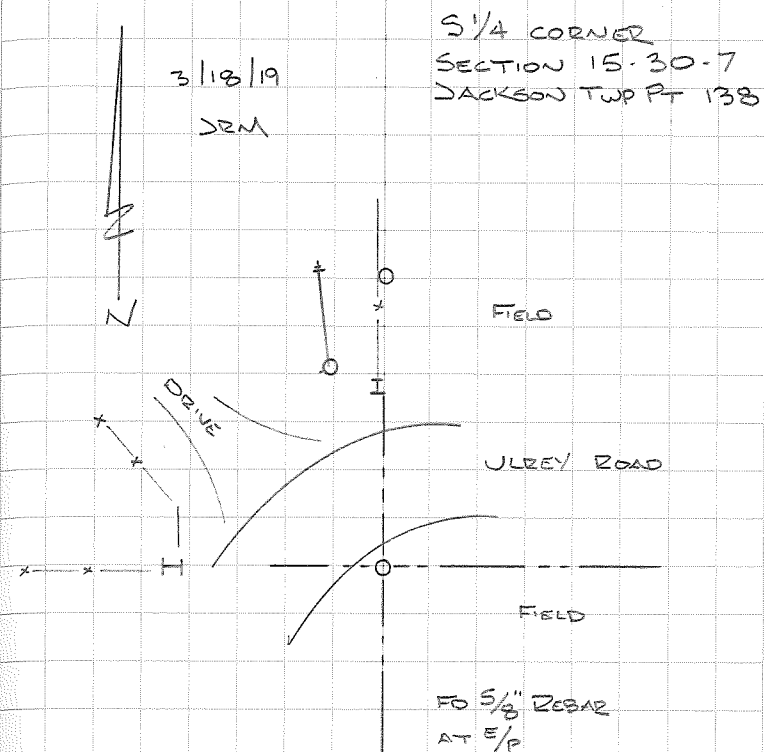


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	NNW	48.38'
NAIL IN B. CAP IN POWER POLE	N	15.75'
± RR RAIL FCP	S	16.77'

"WALKER" SURVEY JAN 27 1993 #93-04-1004

JACKSON
148


55

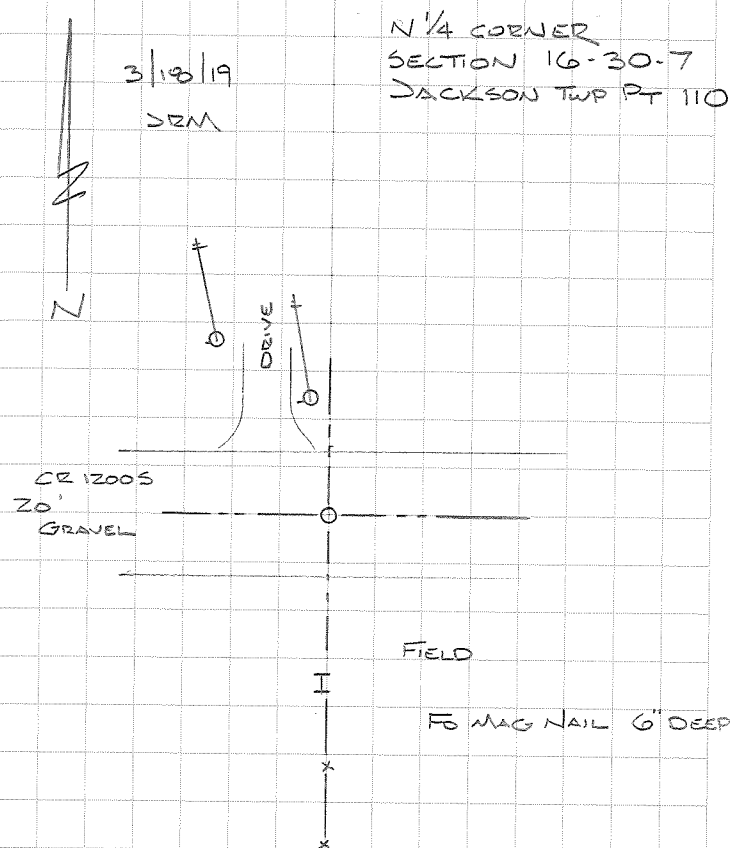

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN WOOD FCP	N	21.34'
1/2" x 24" REBAR W/CAP 10.1' TO E/P	NE	28.28'
1/2" RR RAIL FCP	S	21.55'
NAIL IN B. CAP NIPSCO P. POLE $\frac{673}{070}$	SSW	20.98'

JEFFERSON 167

56

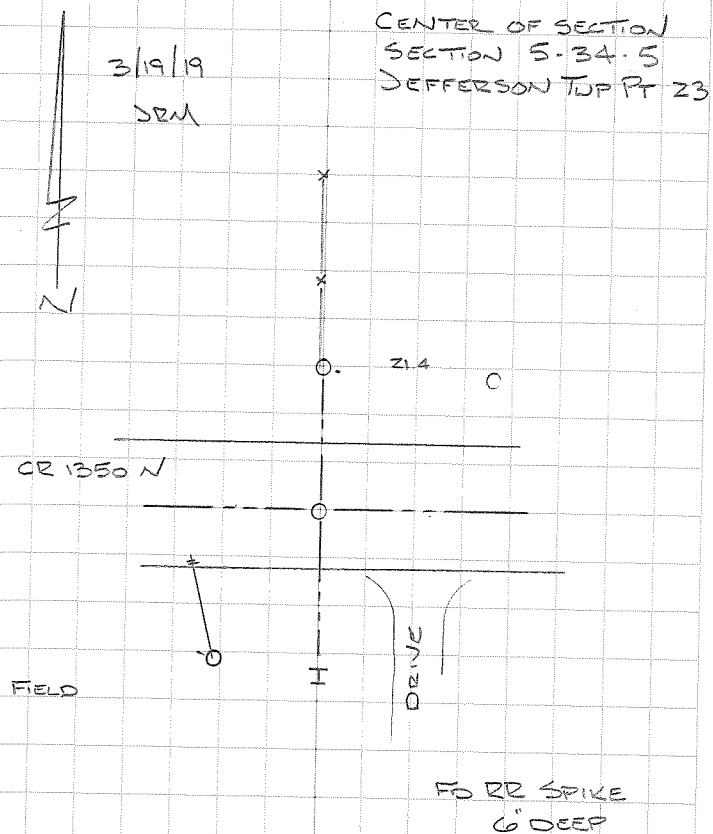


DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR W/CAP	NW	27.55'
FACE 12" DIA CONC FCP	NW	27.45'
1/2" x 24" REBAR W/CAP	SE	27.10'
4 2" DIA STEEL FCP	S	21.25'
NAIL IN B. CAP REMC POLE 1304	SW	36.97'

SURVEY FIELD BOOK 5 Pg 44 CB MAY 5 1972
 SURVEY RECORD BOOK 2 (COPY) Pg 175 JAN 12 1860

FRANKLIN⁵⁵

57

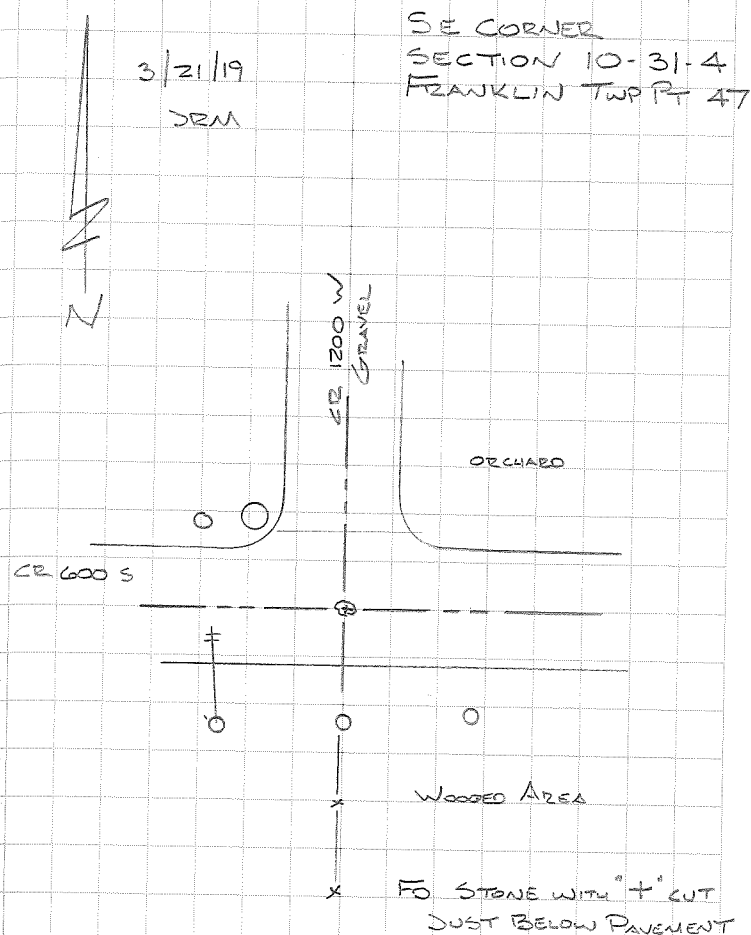


DESCRIPTION	BEARING	DISTANCE
SE CORNER CONC FCP	W	15.90'
℄ RR RAIL FCP	E	17.25'
1/2" x 24" REBAR W/CAP 8 TO E/P	SE	23.60'
1/2" x 24" REBAR W/CAP 7 TO E/P	SW	18.82'
FO 1" IRON PIPE 4" DEEP	SE	0.57'

SURVEY FIELD BOOK 5 Pg 44 CB MAY 5 1972
 SURVEY RECORD BOOK 2 (COPY) Pg 291 Nov 27, 1867

FRANKLIN 56

58

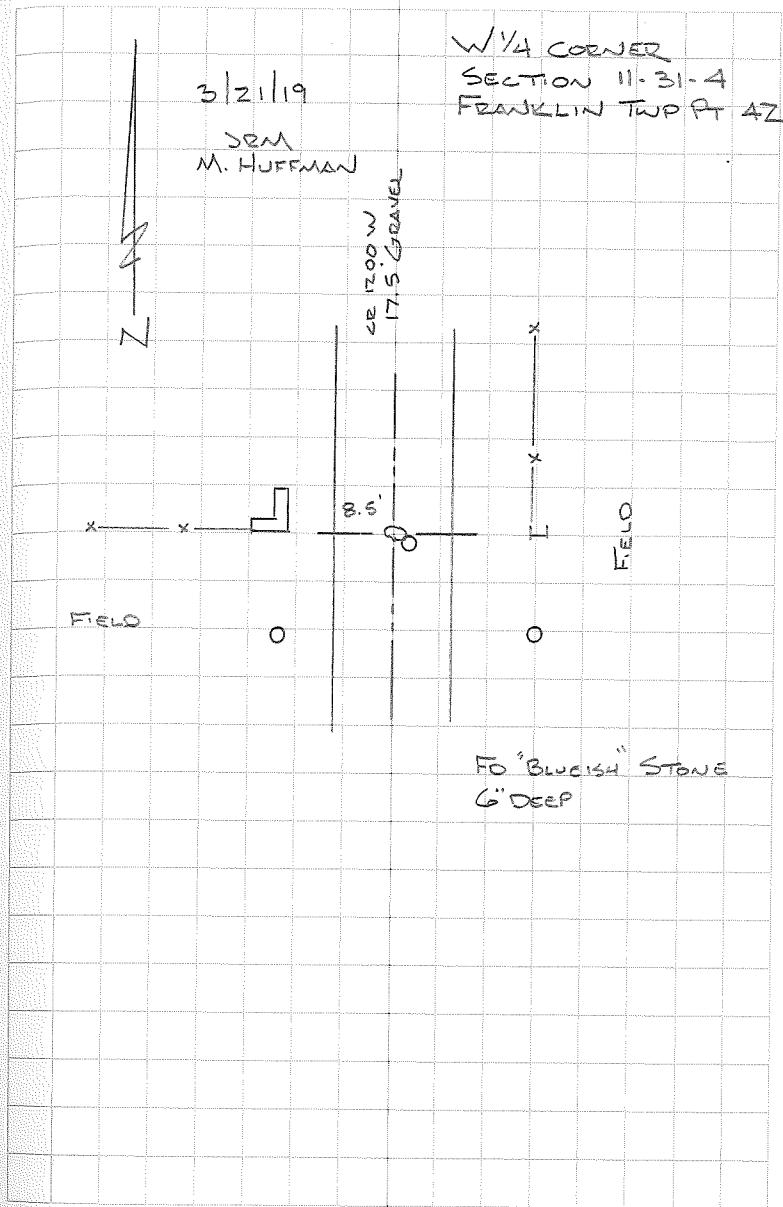

DESCRIPTION	BEARING	DISTANCE
NEAREST CORNER RR RAIL FCP	N	21.55'
NAIL IN B. CAP IN POWER POLE	NE	61.37'
NAIL IN B. CAP IN POWER POLE	SE	45.76'


"STEVEN" SURVEY MARCH 11 1994 #94-06-0125
 SURVEY RECORD BOOK 4 Pg 250 MARCH 20 1912

FRANKLIN 59

59

3/21/19
 JBM
 M. HOFFMAN

S 1/4 CORNER
 SECTION 14-31-4
 FRANKLIN TWP PT 70

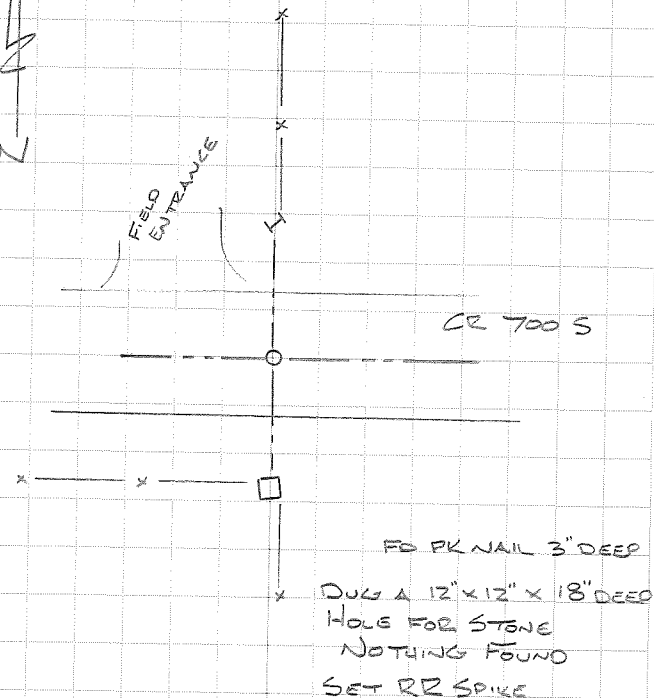

DESCRIPTION

BEARING DISTANCE

1/2" x 24" REBAR W/CAP 8.5' TO E/P	NW	36.90'
SE CORNER AT BASE 16" SQ CONC FCP	N	18.1'
1/2" x 24" REBAR W/CAP 5.8' TO E/P	SW	28.60'


"MICHEL" SURVEY MAY 1, 2006 # 2006 0000 8357

"HUFFMAN" SURVEY FEB 2 2012

WINONA INTERURBAN @ STA 737+02.7 @ CR 600 S

FRANKLIN 57

60

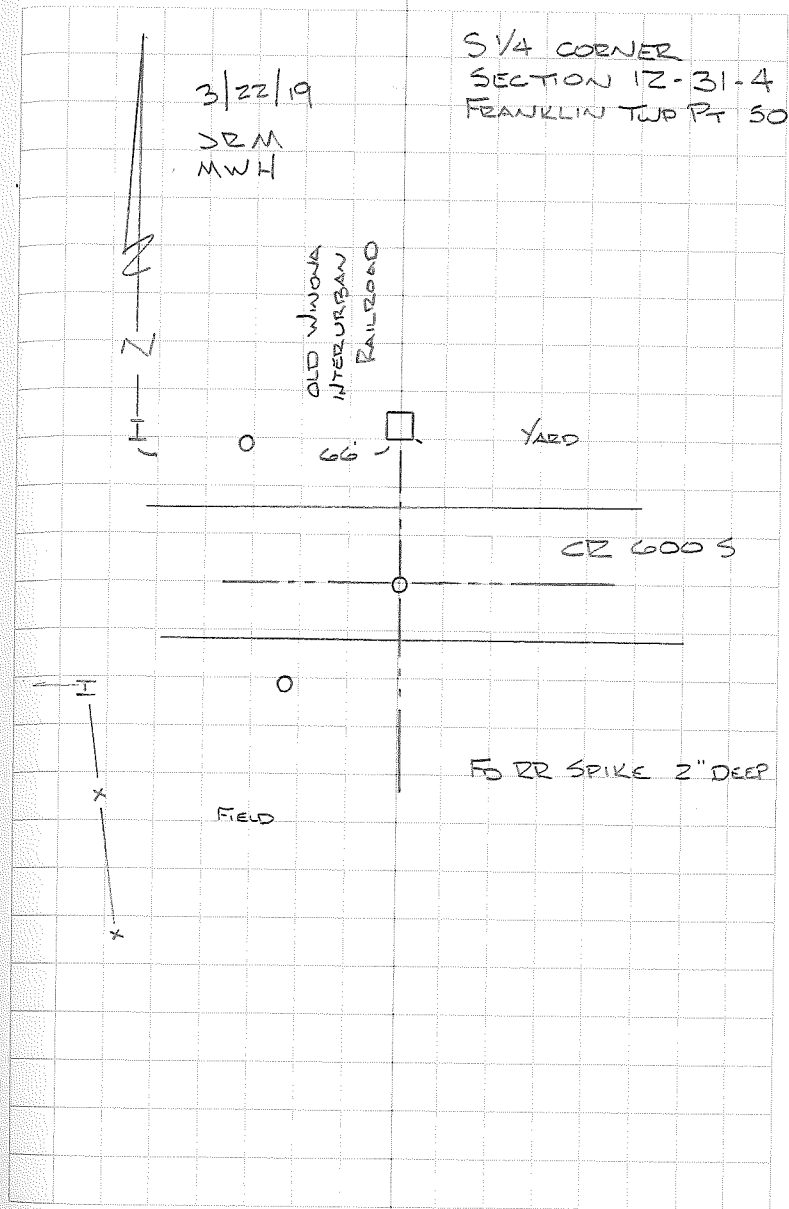


DESCRIPTION

BEARING DISTANCE

1/2" x 24" REBAR w/CAP 9.1' TO E/P	NW	24.30'
1/2" x 24" REBAR w/CAP 3.5' TO E/P	NE	41.66'
1/2" x 24" REBAR w/CAP 3.5' TO E/P	SW	43.95'

FRANKLIN 58

61

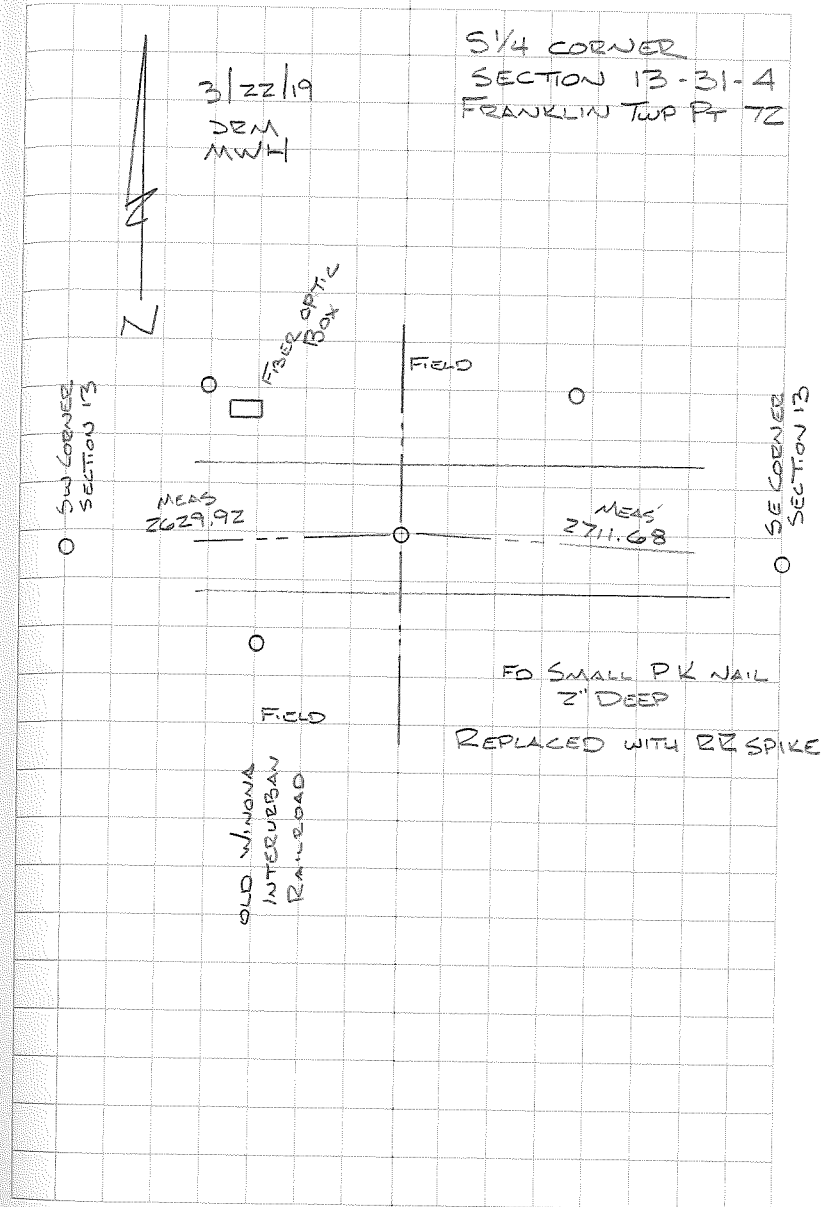


DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR W/CAP 1' TO B/C	NW	45.54'
1/2" x 24" REBAR W/CAP 4' TO B/C	SW	43.53'
OLD TIE		
NE BOLT OF AMC SIGN	SW	45.4' ✓

SURVEY FIELD BOOK 7 Pg 64
 "MICHEL" SURVEY AUGUST 30 2010 # 2010100614
 "MICHEL" SURVEY NOV 13 2012
 "HUFFMAN" SURVEY 2019

WAYNE 530

62

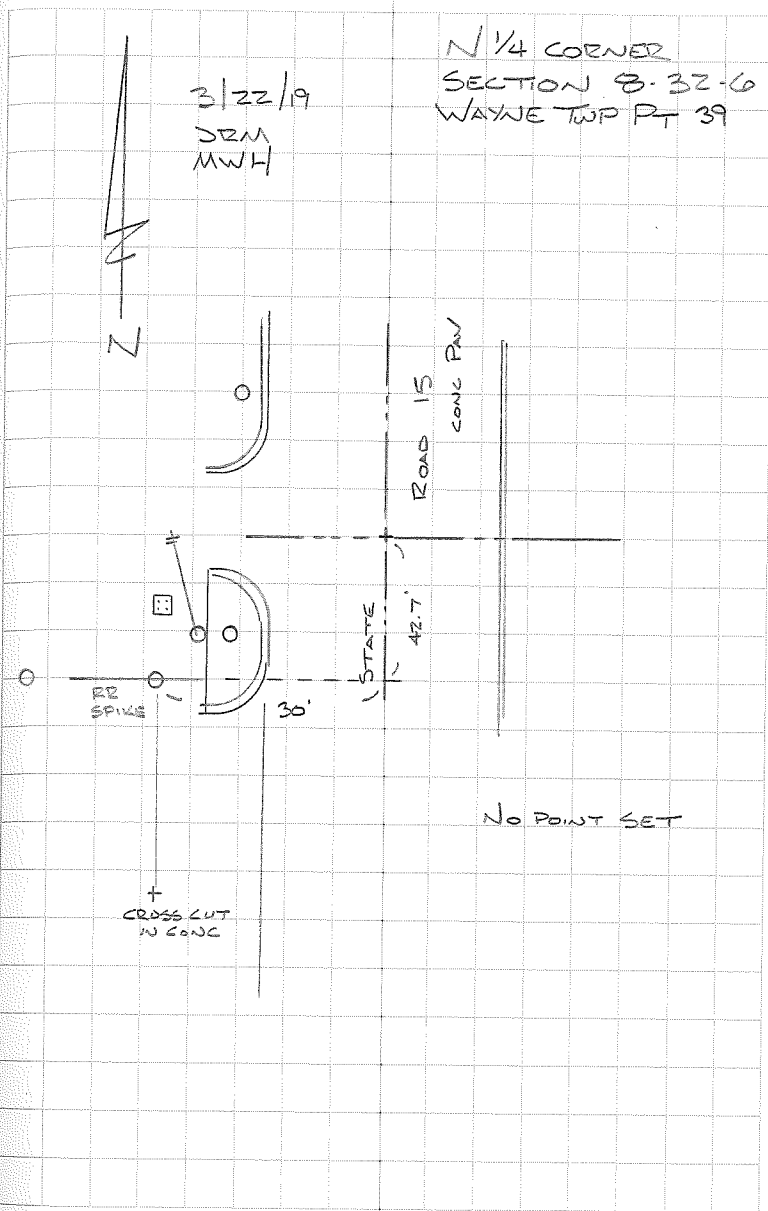

DESCRIPTION

BEARING DISTANCE


NAIL W.B. CAP NIPSCO POLE 683/982	NE	53.34'
1/2" x 24" REBAR W/CAP 8' TO E/P	SE	34.90'

JEFFERSON 180

63

3/23/19

W 1/4 CORNER
SECTION 18-34-5
JEFFERSON TWP R 78

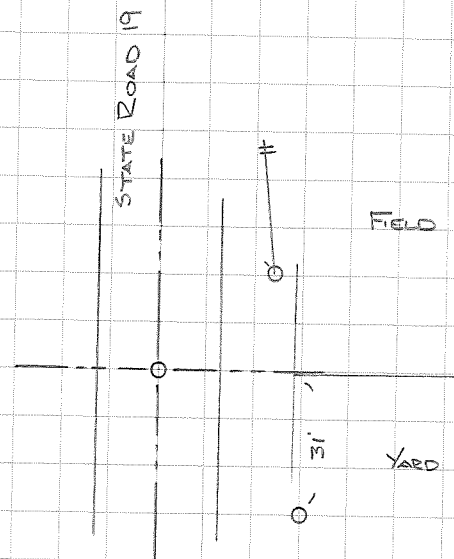

FO MAG NAIL W/
"LONG" TAG


REPLACED WITH MAG NAIL
W/ CO TAG

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	NW	37.55'
1/2" x 24" REBAR W/CAP	SW	49.22'

WABASH COUNTY STATE PLANE COORDINATES 2012

LAKE 206

64

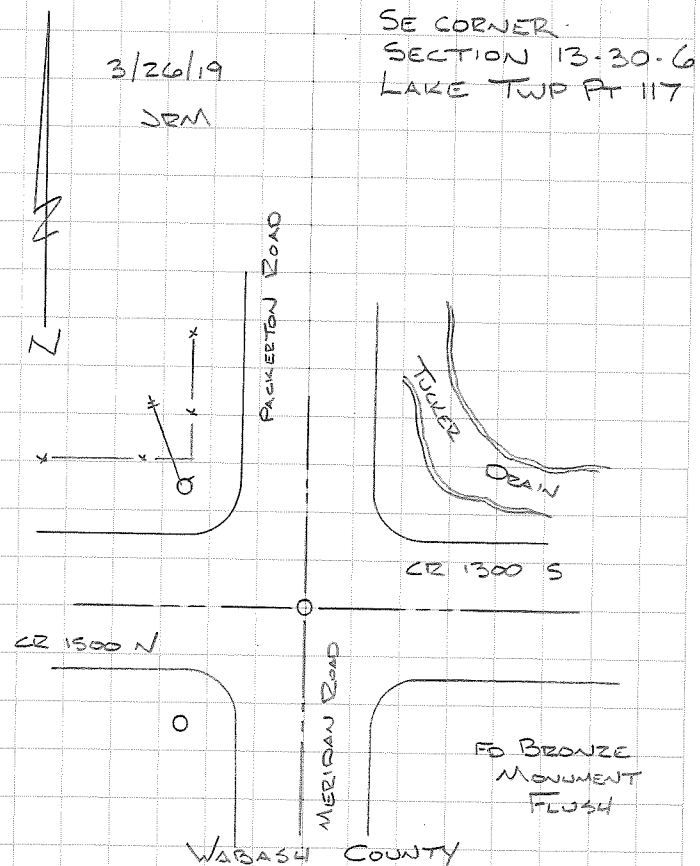

DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN POWER POLE	WNW	71.69'
± RR RAIL FCP	N	19.56'
± RR RAIL FCP	S	22.57'

WABASH CO FOUND STONE JULY 14 1992


LAKE 206

65



3/26/19
DEM

S 1/4 CORNER
SECTION 13-30-6
LAKE TWP RT 116

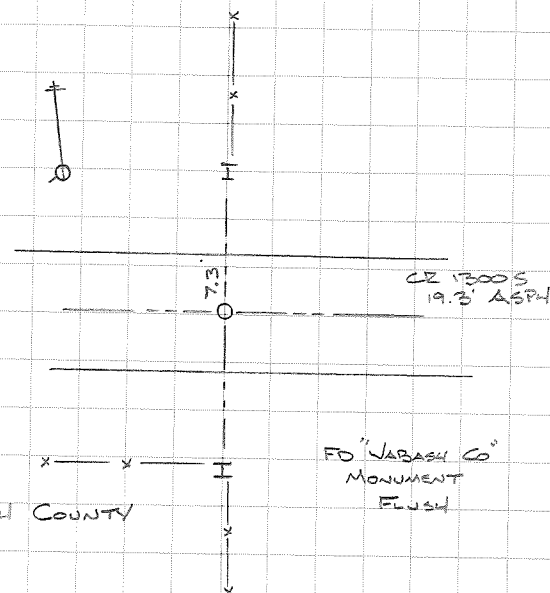


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP REMC POLE 1752	ENE	63.44'
NAIL IN B. CAP POWER POLE	SE	39.60'
NEAREST CORNER RR RAIL F&P	SSW	40.32'

SURVEY FIELD BOOK 7 Pg 79 1974

LAKE
ZOG

66

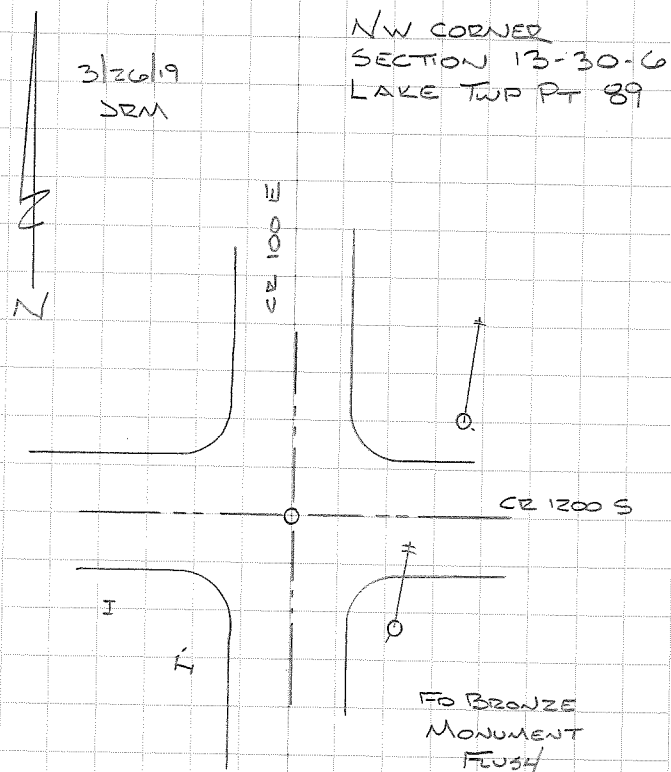

DESCRIPTION

BEARING DISTANCE

FO MAG NAIL W/ "JHS" TAG IN WOOD FCP	N	21.16'
FO MAG NAIL W/ "JHS" TAG IN POWER POLE	ENE	79.91'
FO 5/8" REBAR NO CAP @ E/P	SE	21.37'
FO 5/8" REBAR NO CAP @ E/P	SW	28.16'

LAKE 208

67



3/26/19

JRM

S 1/4 CORNER
SECTION 15-30-6
LAKE TWP PT 112

FIELD

CR 1500 N

45.2'

CR 1500 S

WABASH COUNTY

FO "WABASH CO"
MONUMENT
FLUSH

DESCRIPTION


BEARING DISTANCE

1/2" x 24" REBAR W/CAP N. OF ST B/W MARKER	NW	58.79'
FD 1 3/4" IRON ROD "WABASH CO MARKER"	NE	50.97'
FD 5/8" REBAR NO CAP @ E/P	SW	49.37'

SECTION CORNER FIELD BOOK 1 Pg 62 JUNE 24, 1992

LAKE 210

68

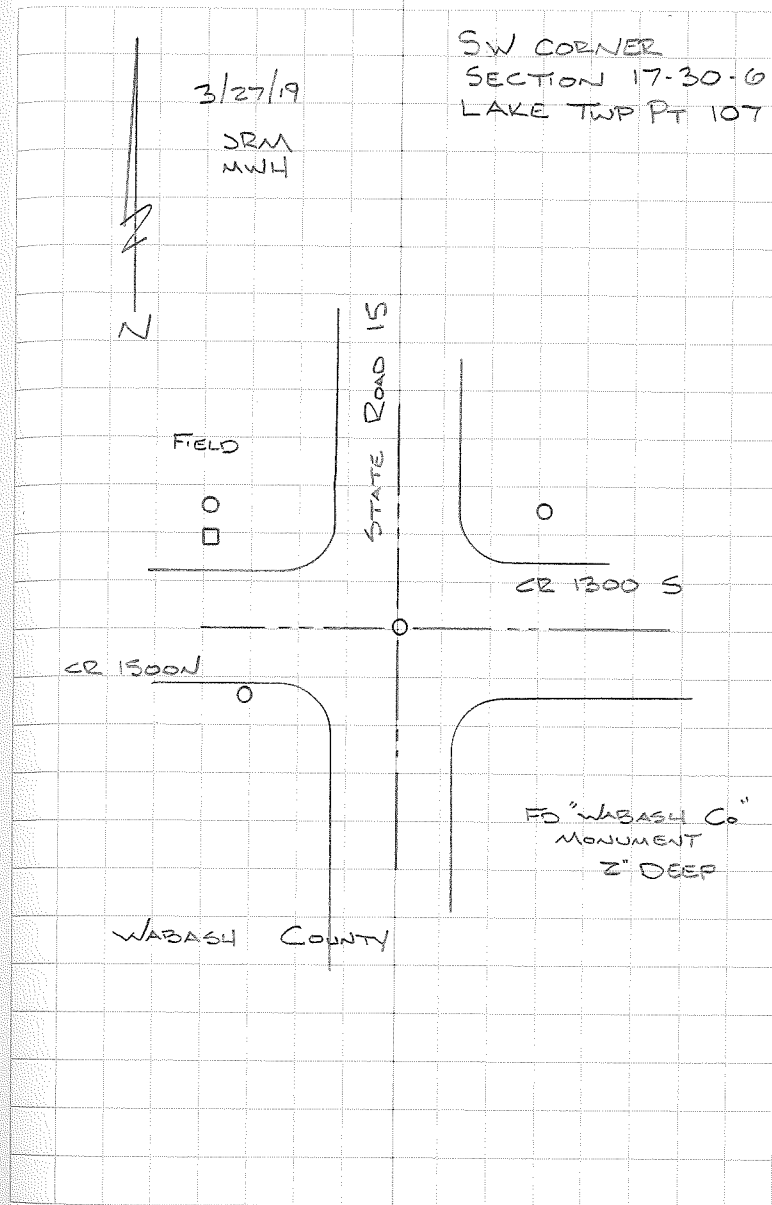

DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR W/CAP 1' TO E/P	ENE	35.43'
NAIL IN B. CAP DEMO POLE 7449Z	ESE	28.83'

"WALKER" SURVEY/ SEPT 19 2003 #200300120491


LAKE 211

69

3/27/19

DEM
MNH

SW CORNER
SECTION 18-30-6
LAKE TWP PT 105

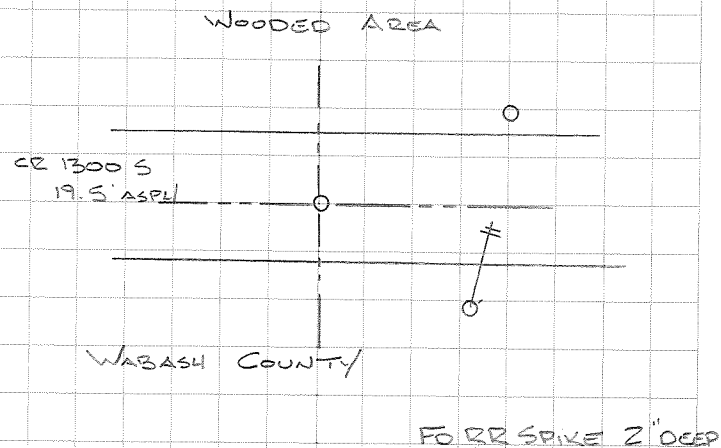


DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR W/CAP 5.3' TO FENCE	WNW	23.75'
1/2" RR RAIL FCP	W	10.5'
1/2" x 24" REBAR W/CAP IN FENCE	SW	15.80'

"KIMPEL" SURVEY JULY 30 2013 # 2013090932

LAKE 201

70

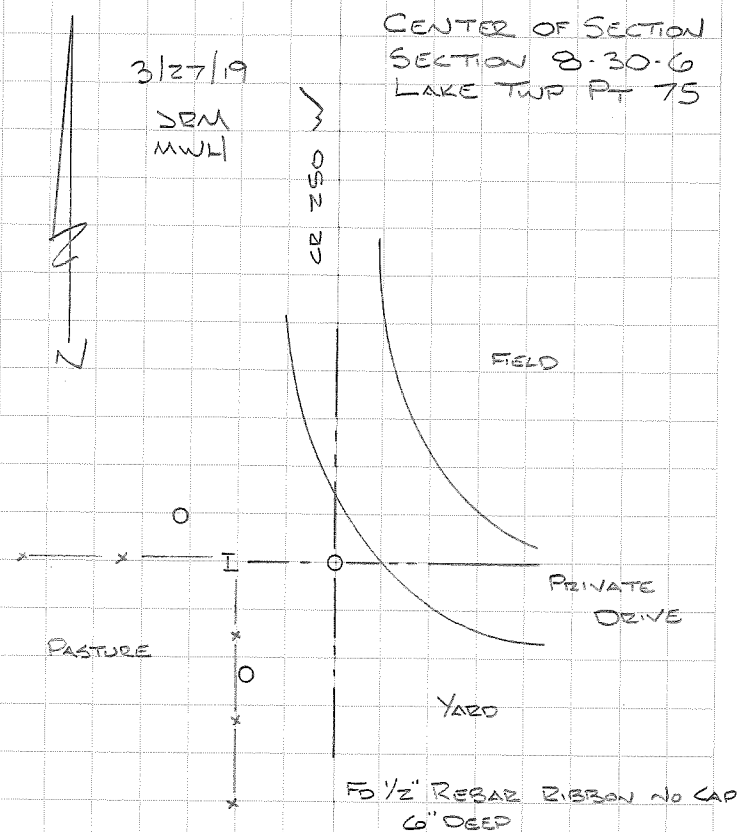


DESCRIPTION	BEARING	DISTANCE
NAIL IN B. CAP IN TELEPHONE POLE	WNW	48.24'
NAIL IN B. CAP IN TELEPHONE POLE	NE	42.36'
NAIL IN B. CAP IN POWER POLE	SE	31.99'

"WALKER" SURVEY JAN 4 2002 # 2002060818

LAKE 198

71

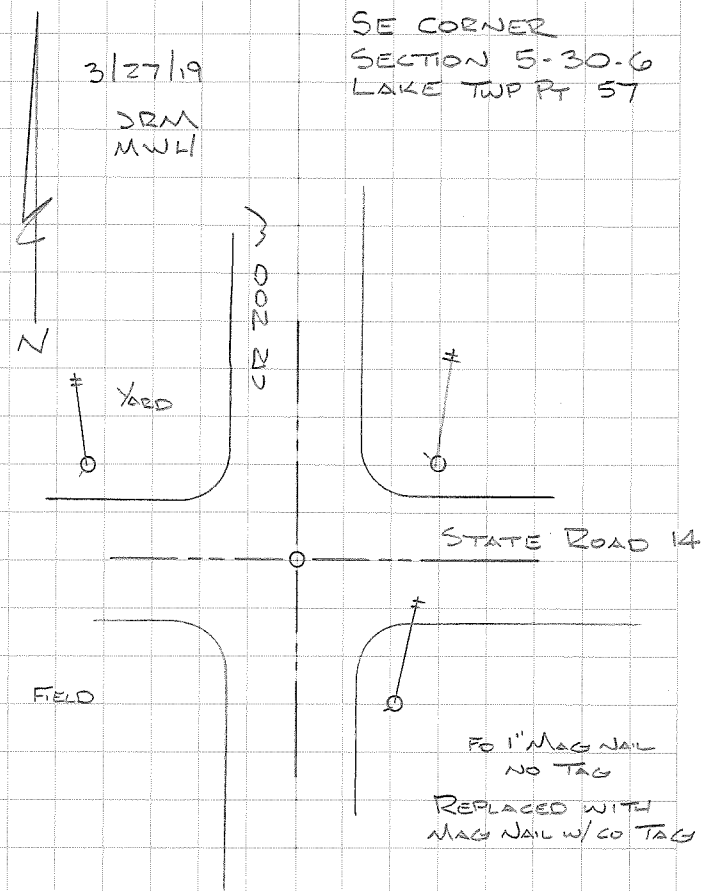

DESCRIPTION

BEARING DISTANCE

1/2" x 24" REBAR w/CAP 11' to E/P	NW	27.45'
FO "WALKER" CAPPED IRON 3" DEEP	W	20.00'
NAIL IN B. CAP IN POWER POLE	SW	32.17'


SURVEY FIELD BOOK 7 P. 78 11/16/74

"MICHEL" SURVEY SEPT 3 2003 # 200500017334

"KIMPEL" SURVEY JULY 30 2013 # 2013090932

LAKE 201

72

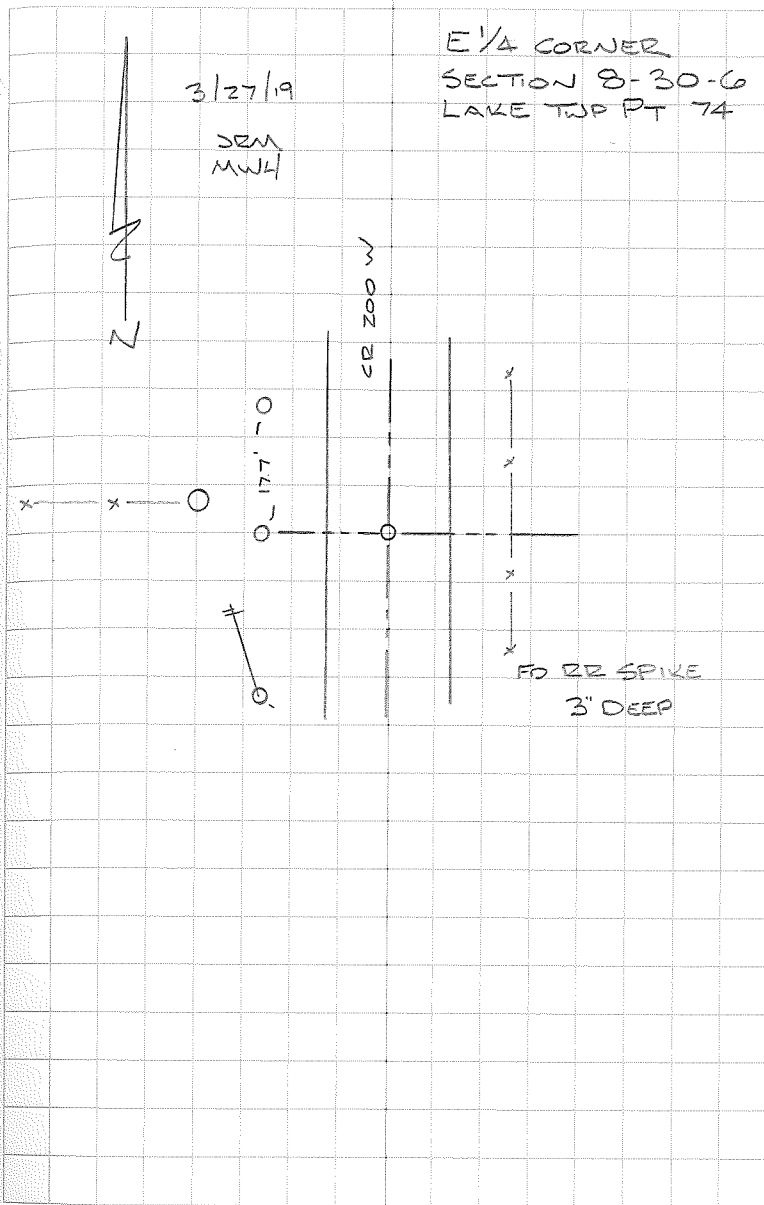

DESCRIPTION


BEARING DISTANCE

NAIL IN B. CAP IN TELEPHONE POLE	ENE	43.77'
NAIL IN B. CAP IN POWER POLE	SSE	21.11
NEAREST EDGE RR RAIL FCP	S	21.90'

"MICHEL" SURVEY DEC 9 2004 # 2005000433

LAKE 202

73

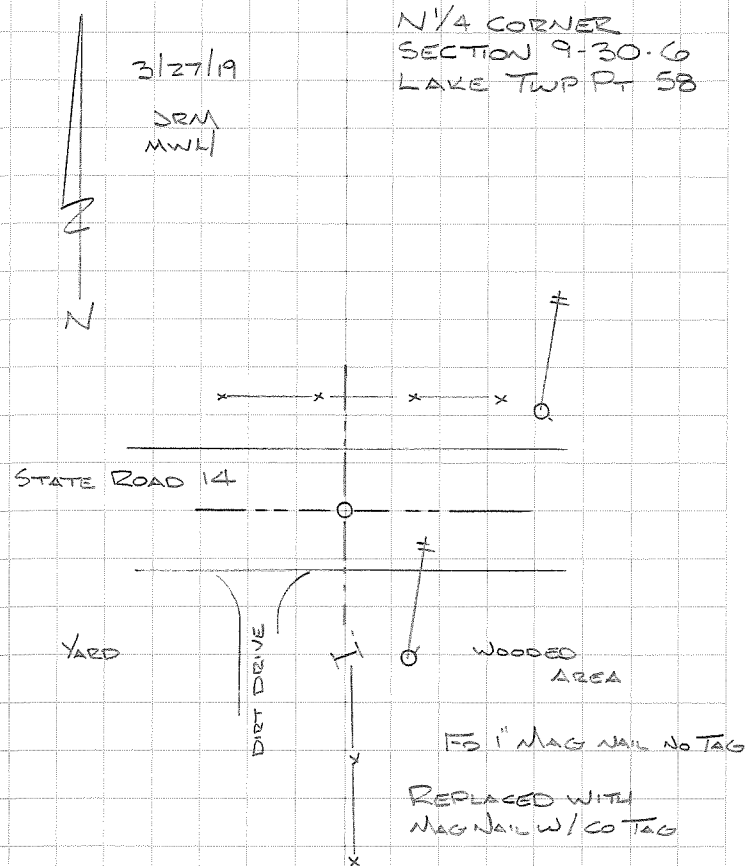


DESCRIPTION	BEARING	DISTANCE
1/2" x 24" REBAR w/CAP	SW	63.85'
1/2" x 24" REBAR w/CAP	SE	50.65'
NAIL IN B. CAP IN POWER POLE	SSE	84.71'

LAKE 203

74

3/27/19
SRM
MWH

NW CORNER
SECTION 10-30-6
LAKE TWP PT 59

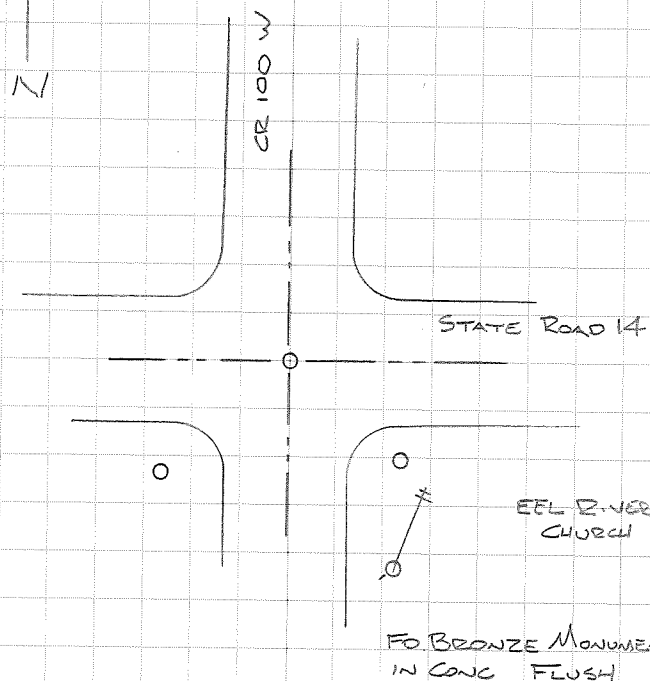


DESCRIPTION

BEARING DISTANCE

FO NAIL IN TAG IN POWER POLE	NNW	43.9'
FO NAIL IN TAG IN POWER POLE	SE	31.13'
4 RR RAIL FCP	S	31.3'

LAKE 203

75

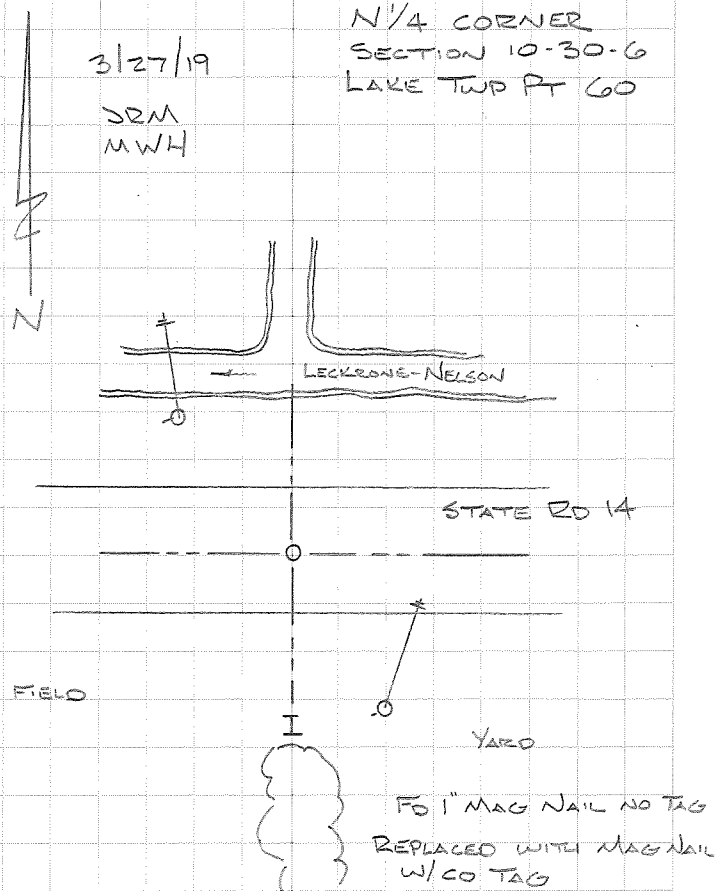

DESCRIPTION	BEARING	DISTANCE
EAST FACE 4" DIA STEEL FCP	W	21.6'
± 6" x 8" BROKEN CONG FCP	W	21.05'
± AT TOP RR RAIL FCP	E	21.55'
NAIL IN B. CAP IN POWER POLE	SE	59.80'


"MICHEL" SURVEY DEC 9 2004 # 2005 00043Z

LAKE 203

76


3/27/19
DEM
MWH

W 1/4 CORNER
SECTION 10-30-6
LAKE TWP PT 72

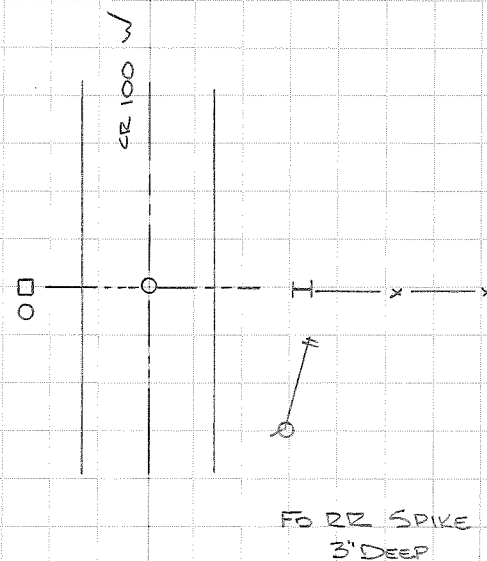

DESCRIPTION	BEARING	DISTANCE
E 12" DIA CONC FENCE CORNER POST	W	21.84'
1/2" x 24" REBAR W/CAP 11.8' TO E/P	NE	36.62'
1/2" x 24" REBAR W/CAP 11.8' TO E/P	SE	29.37'
48.03' BETWEEN REBARS		
FD WALKER MAG NAIL	SE	1.67'
FD RR RAIL FCP ON LINE	E	444.0'
FD RR RAIL FCP ON LINE	E	368.9'
FD 5/8" REBAR NO CAP USED FOR LINE	E	850.00'

WAYNE 528

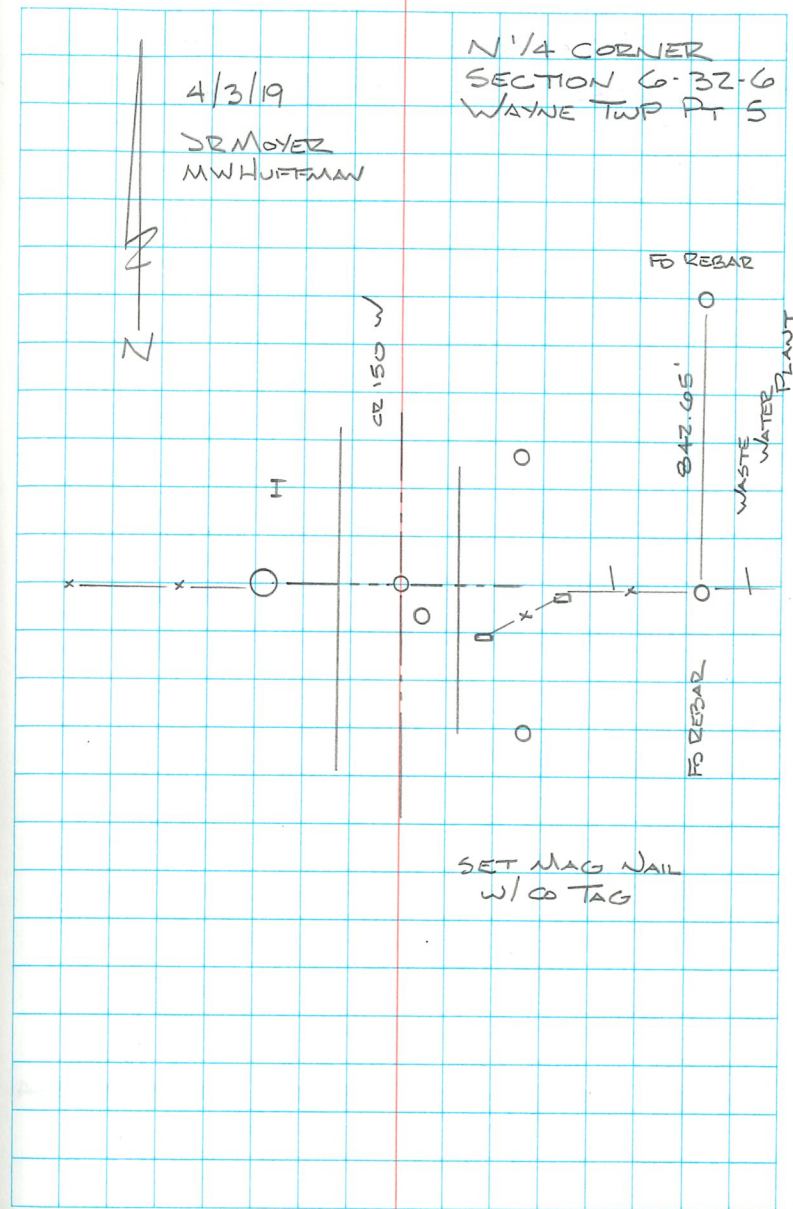

NAIL IN B. CAP IN POWER POLE	NNW	46.88'
1/2" x 24" REBAR W/CAP 10' TO E/P	NE	20.09'

"WALKED" SURVEY AUGUST 12 2005 #20050001544


LAKE 216

78



4/3/19
DEMOYER
MW HUFFMAN

S 1/4 CORNER
SECTION 35-31-6
LAKE TWP PT 36

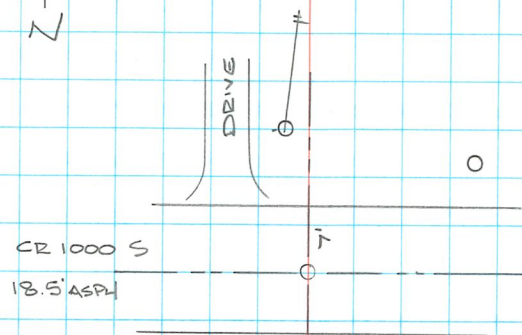

FORR SPIKE FLUSH